### Johnsonville Cafeteria / Environmental Health walk-thru 3/16/23

## Scullery

- -Rough wall seams
- -Areas of shallow grout
- -Rough wall finishes especially near frame out of doorway leading to ice machine area
- -Sill block under raceway at service window very rough with cracks and gaps across width
- -Caulk missing or not smooth and intact at 3 comp backsplash and wall juncture
- -Wall/paint damage under 3 comp at water supply piping
- -Wall mount shelf support bracket missing
- -Water piping under pre-rinse not flanged
- -Wall rough/damaged and unfinished at water piping under pre-rinse
- -Metal trims at dish machine exhaust to ceiling junctures not seated correctly
- -No soap dispenser at handsink
- -No hand drying provision at handsink

#### Custodial

- -Rough finishes at base to wall juncture especially behind door
- -Rough wall finishes in multiple areas including behind door and at hose bib

# Employee bathroom

- -Rough wall at water supply of toilet and sink
- -Rough wall at hose bib

### Dry storage

- -Rough wall at light switch
- -Rough wall seams

### Main kitchen area

- -Screw extruding from wall mounted shelf support bracket over 1 comp sink
- -Remaining shelf support brackets missing screws
- -Wall damage and rough areas under 1 comp sink
- -Rough, poorly filled wall seams
- -Metal frame out trim pieces at pass thru holding equipment not tight
- -Foot plates on tilt skillet and steamers have recessed areas, damaged screw heads
- -Multiple steamers dented or otherwise damaged
- -Area around conduits servicing floor outlets in multiple areas recessed or built up and rough
- -Open and rough juncture at walk-in freezer and wall.
- -Flooring of walk-in freezer installed poorly. Panels not level, not sealed correctly, gaps present. Caulk/mastic applied in unapproved manner
- -Flooring of walk-in cooler also has poor sealing and mastic
- -Ceiling panel of walk-in cooler dented/damaged
- -Ceiling seam seals not apparent
- -Gaps present at hood to ceiling bulkhead juncture
- -Right side compartment of 2 comp sink draining outside of hub onto floor
- -Rough wall and no flanges under 2 comp sink

### Serving line area

- -Recessed area where floor tile cut out around conduit servicing floor outlet
- -Milk cooler dented/damaged
- -Rough area, gaps at piping under handsink

### Dining area

- -Broken or missing floor tile
- -Side entry door does not completely self-close

## Male restroom

- -Rough walls in multiple areas
- -Toilets not properly sealed to wall around entire fixture, holes/gaps present
- -Screw missing on metal trim of stall partition
- -Tiles at entry threshold cut short, gap present between tile edge and marble threshold

## Female restroom

- -Tiles at entry threshold cut short, gap present between tile edge and marble threshold
- -Rough walls in multiple areas
- -Areas where paint has not sealed over air pocket voids
- -Toilets not properly sealed to wall around entire fixture, holes/gaps present
- -Void space / damaged area present between fame of corridor rear door and wall above door
- -Flanges throughout either missing or not seated/sealed properly