

ADDRESS : 4446 OLD US 421
 CONTRACTOR : ADIRONDACK DEVELOPMENT, LLC
 OWNER : KUTZA MOUSE R
 PARCEL : 13-0630- - -0038- -09-
 APPL NUMBER: 17-50041414 CP NEW RESIDENTIAL (SFD)
 DIRECTIONS : T/S: 05/18/2017 08:26 AM BPETRICH --
 TAKE US 421 N 4.3 MILES, TURN LEFT ONTO
 NEILL THOMAS ROAD - RIGHT ONTO OLD US
 HWY 421 - SITE IS .3 MILES ON THE RIGHT
 NEXT TO 4388 OLD US 421.


SUBDIV:
 PHONE : (919) 669-4579
 PHONE :

STRUCTURE: 000 000 77X77 3BDRM CRAWL W/DECK

FLOOD ZONE : FLOOD ZONE X
 # BEDROOMS : 3.00
 SEPTIC - EXISTING? : NEW
 PROPOSED USE : SFD
 WATER SUPPLY : COUNTY

PERMIT: CPSF 00 CP * SFD

TYP/SQ	REQUESTED COMPLETED	INSP RESULT	DESCRIPTION RESULTS/COMMENTS
A814 01	6/09/17 6/09/17	SB AP	ADDRESS CONFIRMATION TIME: 17:00 VRU #: 002982445 4446 OLD US 421 LILLINGTON 27546 T/S: 06/09/2017 11:56 AM SBENNETT -----
B101 01	6/23/17 6/23/17	JLP DA	R*BLDG FOOTING / TEMP SVC POLE VRU #: 002988173 1-PIERS NEED TO BE 24"x24"x12" 2- NEED GADE MARKERS IIN PER FOOTINGS.
B101 02	6/27/17 6/27/17	TSG AE	R*BLDG FOOTING / TEMP SVC POLE VRU #: 002989378 eng to send letter on what appears to be a doube pier in waste on plans not installed. ok tp pour footer. T/S: 06/27/2017 02:29 PM SGUY -----
B103 01	7/12/17 7/12/17	TSG DA	R*BLDG FOUND & TEMP SVC POLE VRU #: 002995842 still need eng letter for double pier not installed
B103 02	7/14/17 7/14/17	TSG AP	R*BLDG FOUND & TEMP SVC POLE VRU #: 002996887
B105 01	7/21/17 7/21/17	JLP AP	R*OPEN FLOOR VRU #: 003000601 T-POLE APPROVED
E207 01	7/25/17 7/25/17	JLP AP	R*ELEC TEMP SERVICE POLE TIME: 17:00 VRU #: 003002250 T/S: 07/24/2017 09:19 AM LLUCAS ----- HE SCHEDULED INSPECTION WRONG AND SO THAT WHY IT IS JUST A T-POLE ON BY ITSELF T/S: 07/25/2017 03:18 PM JPERRY -----
B101 03	10/26/17 10/26/17	TSG AP	R*BLDG FOOTING / TEMP SVC POLE TIME: 17:00 VRU #: 003044799 T/S: 10/25/2017 02:57 PM DJOHNSON ----- PLEASE RESULT THIS INSPECTION AS APPROVED. T/S: 10/26/2017 10:00 AM SGUY -----
R425 01	10/26/17 10/26/17	TSG DA	FOUR TRADE ROUGH IN TIME: 17:00 VRU #: 003044781 T/S: 10/25/2017 02:56 PM DJOHNSON ----- 1- FIRE STOP MISSING 2-ENG TO VERIFY CHANGE TO WINDOW HEADER REAR WALL 3-STUDY WALL PER PLAN REQUIRES 2X6 4-VERIFY STRAPING ON 24" LVLS TO TOP PLATE 5- GAS TEST PRESURE DOWN 6-HOUSE WRAP MISSING IN REAR
R425 02	10/30/17	TSG	FOUR TRADE ROUGH IN VRU #: 003046171

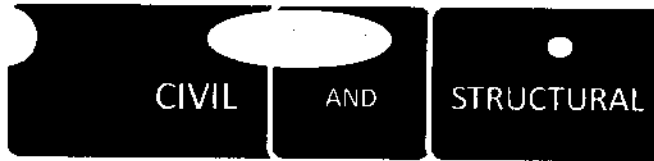

CIVIL AND STRUCTURAL ENGINEERING SERVICES, PLLC

SAMIR W. BAHHO, P.E.

Date: October 29,, 2017

**Inspection Department
Harnett County**

**Reference: Framing Certification, BP 006U01, CP1750041414,
Addressing Inspector Comments and Certification**

Upon request of the owner, the site of the house being constructed at 4446 Old US421, in Lillington, North Carolina was visited on October 27, 2017. The purpose of the visit was to address Harnett County Inspector comments. Comments are addressed in the same sequence as per inspection report as follows:

2. Change to window headers on the back side. Window headers were changed upon my recommendation. As-built Window headers are structurally stable and meet the structural requirement of NCBC, Residential, 2012
3. Change in study room walls from 2x6 to 2x4 stud walls were make upon my recommendations and meets structural requirement of NCBC, Residential, 2012
4. Strapping to 24" LVL: LVL and the back end shall be strapped as recommended by County Inspector. Right side end of both 24" LVL are well braced and need no additional strapping

My Seal and signature affixed below for certification.

For any further questions, please call me or email me. My telephone number is 919-621-0628. My email address is ba.casespllc@gmail.com

Sincerely,

**Samir W. Bahho, P.E. (License # 16941)
Business License- P-0537**

Cc: File

10/29/2017

1