

COMMENTS:

9/17/2010 Met with Tommy Coley because D-Box was over flowing.

Suggested to replace Box with larger D-Box. Tommy adjusted the

to their length to reduce amount of float coming into box.

9/14/2011 Met with Tommy Coley on site. The first part of

drain line has been flooded out because the first step down was

damaged & not repaired properly. Attempts were made to adjust the amount

of water coming into D-Box & it also appears that the zone valve does not

completely shut off water when switching one float to the next.

10/5/2011 BmtOT capped the original line in D-Box to eliminate the

first part of drain line that had been overly saturated & was not taking any more

water. New s/c'do installed & connected to drain line just after 1st

step down that had been damaged

COMMENTS: \_\_\_\_\_

Field with manifold was dry.

10/6/2011 PM Adjusted floats & valve in effort to reduce dose amount. Added s/c 40 from d-box & tied into 2nd step down b/c section after 1st step down was damaged but does take effluent slowly.

10/9/2011

2/9/2012 Site visit made to first repair drain field.

Sewage bubbling up. Went to drain field behind store (2nd field), ran pump sewage backed up in D-Box & in less than 60 sec. Sewage surfacing.

2/15/2012 went to Ducon Junction with Gale Green to deliver violation letters.

He stated that there was another area (wooded) on the property. OT & I

went back and looked at the wooded area. ~~There~~ the area is too small

to fix the drain field. He asked about "tinkering" with the 2nd drain field. I told him to have Tommy Cdey to call me & we would do what we could.

2/21/2012 BY Tommy Cdey

Last 3 step down have been uncovered & checked. All 3 OK