

On May 4, 2021, Lynn Environmental Consulting personnel visited 220 Pylant Tree Lane to complete a septic inspection. A full septic inspection was not completed due to the system not being in working order. The septic tank was pumped out during the site visit. There was no control panel present for the pump tank. Lynn Environmental personnel returned on May 16, 2021 to determine if the pump was working. A control panel was temporarily installed to supply power to the pump. Delivery of effluent was verified but the effluent did not appear to flow properly to the dispersal field. Shortly after turning on the pump, the effluent overflowed out of the distribution box. It appeared that roots were blocking the outlet pipes in the distribution box.

Lynn Environmental personnel returned on June 19 & 21, 2021 to replace the distribution box, and to install a pump control panel, septic tank risers and a PVC outlet tee. A significant amount of roots were removed around and inside of the distribution box and a new distribution box was installed. Septic tank risers, a PVC outlet tee, a float tree and a control panel were installed. The pump was manually operated to verify delivery to the distribution box and it appeared that effluent was flowing properly to the dispersal field.

Carson Lynn
Lynn Environmental Consulting
NCOWCICB
Installer License # 5366
Inspector License # 5366I