

Job 72326181REP1	Truss A1	Truss Type Truss	Qty 4	Ply 1	LG1 HOMES\BLANCO GL RF Job Reference (optional)
---------------------	-------------	---------------------	----------	----------	--

UFP Mid Atlantic LLC, 5631 S. NC 62, Burlington, NC, JMP

Run: 8.62 S Sep 22 2022 Print: 8.620 S Sep 22 2022 MiTek Industries, Inc. Thu Sep 28 15:33:57

Page: 1

ID:FRuGPTXeQ07sCcEW?q_fh0yB_nK-Qy7LIBU8?BhYp?vblN3LnOLtdUoxaeQGK?VRfyZ4?O


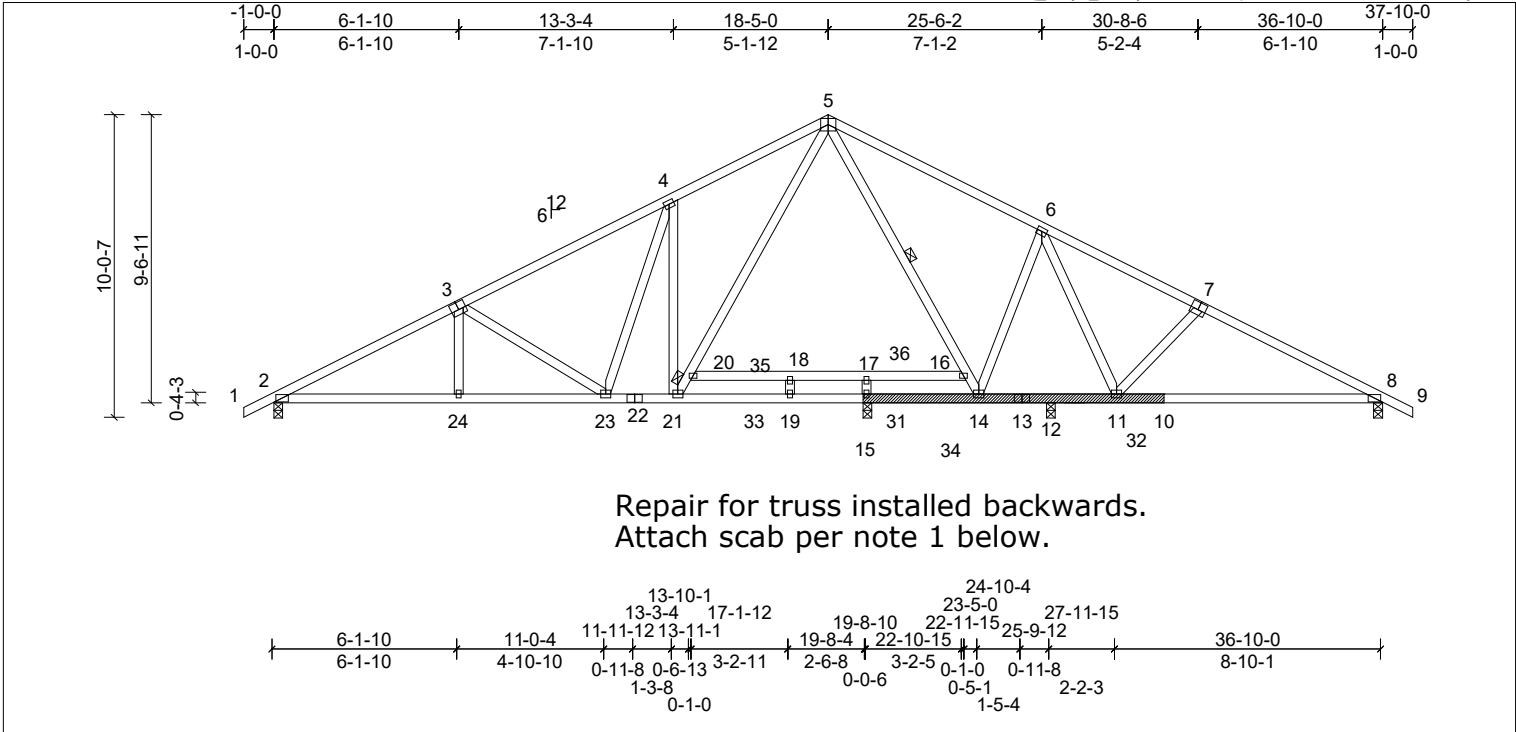


Plate Offsets (X, Y): [3:0-3-0,0-3-0], [7:0-3-0,0-3-0]

Loading	(psf)	Spacing	2-0-0	CSI	DEFL	in	(loc)	l/defl	L/d	PLATES	GRIP
TCLL (roof)	20.0	Plate Grip DOL	1.15	TC	Vert(LL)	-0.12	11-30	>999	240	MT20	244/190
TCDL	10.0	Lumber DOL	1.15	BC	Vert(CT)	-0.32	11-30	>414	180		
BCLL	0.0*	Rep Stress Incr	YES	WB	Horz(CT)	0.06	8	n/a	n/a		
BCDL	10.0	Code	IRC2015/TPI2014	Matrix-MSH						Weight: 235 lb	FT = 20%

LUMBER		BRACING	
TOP CHORD	2x4 SP No.2	TOP CHORD	Structural wood sheathing directly applied or 3-8-8 oc purlins.
BOT CHORD	2x4 SP No.2	BOT CHORD	Rigid ceiling directly applied or 2-2-0 oc bracing.
WEBS	2x4 SP No.3	WEBS	1 Row at midpt 5-14
LBR SCAB	15-10 SP No.2 one side		
REACTIONS			
All bearings 0-3-8.			
(lb) - Max Horiz 2=169 (LC 10)			
Max Uplift All uplift 100 (lb) or less at joint(s) except 2=-185 (LC 10), 8=-147 (LC 11), 12=-120 (LC 11)			
Max Grav All reactions 250 (lb) or less at joint(s) except 2=1132 (LC 1), 8=755 (LC 1), 12=853 (LC 1), 15=748 (LC 2)			
FORCES			
(lb) - Max. Comp./Max. Ten. - All forces 250 (lb) or less except when shown.			
TOP CHORD	2-3=-1968/525, 3-4=-1474/460, 4-5=-1304/572, 5-6=-679/374, 6-7=-824/268, 7-8=-1045/294		
BOT CHORD	2-24=-355/1723, 23-24=-354/1726, 22-23=-137/1097, 21-22=-137/1097, 21-33=0/623, 19-33=0/623, 15-19=0/623, 15-31=0/623, 31-34=0/623, 14-34=0/623, 13-14=-25/653, 12-13=-25/653, 11-12=-25/653, 11-32=-142/899, 10-32=-142/899, 8-10=-142/899		
WEBS	4-23=-119/414, 7-11=-330/206, 6-14=-459/235, 4-21=-716/376, 20-21=-337/908, 5-20=-296/909, 5-16=-390/105, 14-16=-364/81, 3-23=-584/249, 15-17=-306/0		

- NOTES (8)**
- Attach 10-0-0 scab 10 to 15, one face 2x4 SP No.2 with 2 rows of 10d (0.131"x3") nails spaced 9" o.c.
 - Unbalanced roof live loads have been considered for this design.
 - Wind: ASCE 7-10; Vult=130mph (3-second gust) Vasd=103mph; TC DL=6.0psf; BCDL=6.0psf; h=35ft; Cat. II; Exp B; Enclosed; MWFRS (envelope) exterior zone and C-C Exterior (2) zone; cantilever left and right exposed; end vertical left and right exposed; C-C for members and forces & MWFRS for reactions shown; Lumber DOL=1.60 plate grip DOL=1.60
 - This truss has been designed for a 10.0 psf bottom chord live load nonconcurrent with any other live loads.
 - * This truss has been designed for a live load of 20.0psf on the bottom chord in all areas where a rectangle 3-06-00 tall by 2-00-00 wide will fit between the bottom chord and any other members, with BCDL = 10.0psf.
 - Provide mechanical connection (by others) of truss to bearing plate capable of withstanding 185 lb uplift at joint 2, 146 lb uplift at joint 8 and 119 lb uplift at joint 12.
 - This truss is designed in accordance with the 2015 International Residential Code sections R502.11.1 and R802.10.2 and referenced standard ANSI/TPI 1.
 - This repair has been prepared based on information and use conditions supplied by client. Designer has made a good faith effort to outline damage and repair conditions as reported by client. When actual field conditions do not approximate those indicated on this drawing, client shall immediately inform the engineer and refrain from applying the repair.

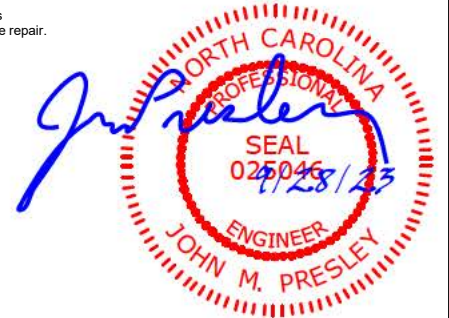

This design is based upon parameters shown, and is for an individual building component to be installed and loaded vertically. Applicability of design parameters and proper incorporation of component is responsibility of the Building Designer. Building Designer shall verify all design information on this sheet for conformance with conditions and requirements of the specific building and governing codes and ordinances. Building Designer accepts responsibility for the correctness or accuracy of the design information as it may relate to a specific building. Certification is valid only when truss is fabricated by a UFPI plant. Bracing shown is for lateral support of truss members only and does not replace erection and permanent bracing. Refer to Building Component Safety Information (BCSI) for general guidance regarding storage, erection and bracing available from SBCA and Truss Plate Institute.

