

NC FIRM LICENSE NO.: P-2854 1991 EDDIE HOWARD ROAD | WILLOW SPRING, NC 27592 ZACH@HAYESSTRUCTURAL.COM | (919) 210-3480

Date: October 23, 2024

To: Garrett Scott

**Drees Homes** 

8521 Six Forks Road, Suite 500

Raleigh, NC 27615

**Re:** 24-FRM-127

Framing Inspection Lot 361 Serenity 27 Songbird Court

Fuquay-Varina, NC 27526 Permit No.: SFD2408-0121

Mr. Scott:

At your request, a site visit was made to the above referenced single family residence under construction to address the valley trusses lacking continuous bearing.

## Observations:

The roof sheathing above the front left and front right sides of the house was terminated short causing the "V02" and "V11" valley trusses to lack continuous bearing. Additionally, the bottom chord of the "V11" valley truss was ripped flat to an approximate 3" depth. The metal gusset plates on the ripped bottom chord were intact and undamaged.

## **Analysis and Recommendations:**

Install 2x4 blocks beneath the "V02" and "V11" valley trusses between the top chords of the perpendicular trusses below. Fasten the blocks with (2) 10d toe nails at each end. The ripped bottom chord of the "V11" valley truss is adequate as long as continuous bearing is provided with blocking as described above. These prescribed configurations will provide the required support for all imposed loads.

Please call me if you have any questions.

Respectfully submitted,

Zachary H. Hayes, PE Owner/Structural Engineer Hayes Structural Consulting & Design, PLLC



Digitally signed by Zachary H. Hayes, PE Date: 2024.10.23

12:16:05 -04'00'