

## ReBUILD NO Damage Repair Verification Estimate

The North Carolina Homeowners Assistance Program

Insured: John McNeil

Property: 5019 Titan Roberts Road

Erwin, NC 28339

Claim Number: APP-09015 **Policy Number:** INSP-0007786 Type of Loss: Hurricane

Date Contacted: 4/29/2021 12:00 AM

Date of Loss: 9/14/2018 12:00 AM Date Received: 4/29/2021 12:00 AM Date Inspected: 5/19/2021 2:00 PM Date Entered: 5/20/2021 9:39 AM

Date Est. Completed: 7/31/2021 4:18 PM

> Price List: NCFA8X\_JUN18

> > Restoration/Service/Remodel

Estimate: 09015\_ECR\_BID



Met with the owner on site at 2:00 PM on 05/19/2021. The residence is a 937 sq ft, one-story single-family home which is currently occupied. During the storm the home experienced wind damage to roof and flooding underneath the home level with the bottom of the floorboards but did not enter the residence.

Repairs completed to date include: Lowes Home Improvement was hired to replace the wind damaged roof and most of the windows which were damaged by the home shifting/settling. An independent contractor was hired to replace the living room flooring. The flooring of this room is still experiencing minor warping. Other contractors were also hired to replace the central HVAC (unit only) and the old front wood door which swelled with a metal door. The applicant painted some walls and ceilings and caulking separation or cracks between walls and ceilings.

The foundation is experiencing possible settlement/shifting noted by the remainder of the floors experiencing warping, sinking, and soft spots. There are minor water spots on the ceilings from when the roof leaked. The ductwork was never replaced. The applicant mentioned a bad smell when the HVAC is operating, and possible mold could be seen in the HVAC floor registers. There also appeared to be mold inside the bathroom vanity.

The home has one resident who experienced a stroke requiring the use of a wheelchair and will require accessibility accommodations.

All Program-funded properties must comply with Green Building Standards as required by 81 Fed. Reg. 83254, Sec. VI, no. 28(a)–(d). To meet these requirements, NCORR has adopted the ENERGY STAR Certified Home Standard for reconstruction projects (see Appendix M for Energy Star Checklist). Rehabilitation projects must apply the HUD CPD Green Building Retrofit Checklist (see Appendix N). Green Building Standards will be applied as described below.

Homes reconstructed by the ReBuild NC Program will be designed to meet the Energy Star Certified Home Standard (see checklist in Appendix M). As part of this process, all house plans available for selection will be reviewed and certified as compliant prior to use by the Program and all required materials, products, and labor needed to meet Green Building Standards will be properly scoped. Program inspectors will ensure that reconstructed homes meet checklist requirements by evaluating compliance with Green Building Standards at each construction draw request. A copy of the certified house plan and checklist will be uploaded to each applicant file prior to construction closeout. Contractors not adhering to these standards will be sanctioned by the program.

All homes rehabilitated by the ReBuild NC Program will be scoped to meet the requirements of the HUD CPD Green Building Retrofit Checklist (see Appendix N) which requires Contractors to meet Green Building Standards when replacing items on the checklist as scoped in Xactimate. During the course of construction, Contractors will be responsible for filling in information on the form and collecting all necessary documentation regarding materials used to rehabilitate the home in order to ensure that the Program is meeting the requirements of the HUD Green Building Retrofit Checklist. All items listed on the form that do not apply or are not being replaced should be marked as not applicable on this form. A copy of the completed checklist and documentation must be provided to the Construction Manager prior to the final inspection. As part of this process, the Contractor will be required to certify that the materials and or products installed, as itemized in their Estimated Cost of Repair (ECR) meet the Green Building Retrofit Checklist. In addition, Contractors are required to collect any material and or product specification sheets to support meeting the Green Building Standards and must submit them during the Construction Closeout Process. Contractors not adhering to these standards will be sanctioned by the program.

Xactimate pricing is in accordance with the requirements found in the Green Building Standards.

09015\_ECR\_BID 3/27/2023 Page: 2



# ReBUILD NG Damage Repair Verification Estimate

The North Carolina Homeowners Assistance Program

### 09015\_ECR\_BID **Main Level**

### **Main Level**

DESCRIPTION			QTY	UNIT PRICE	TOTAL
HVAC			_		
Contractor replaced central HVAC unit,	out ductwork was not replaced. N	o Receipt Re	place duct	twork and connect to	new unit
1a. Remove Ductwork system - hot or co	•	-	EA @	417.17 =	417.17
1b. Replace Ductwork system - hot or co	old air - 901 to 1199 SF home	1.00	EA@	2,859.55 =	2,859.55
2a. Remove Rigid conduit, 3/4"		6.00	LF@	2.52 =	15.12
2b. Replace Rigid conduit, 3/4"		6.00	LF@	6.73 =	40.38
Den					Height: 7' 3"
Missing Wall - Goes to Floor	4' 3" X 6' 8"	0	pens into	BEDROOM_2	
Missing Wall - Goes to Floor	2' 8" X 6' 8"	0	pens into	DINING_ROOM	
DESCRIPTION			QTY	UNIT PRICE	TOTAL
GENERAL (	CONDITIONS				
3. Final cleaning - construction - Reside	ntial	118.22	SF@	0.22 =	26.01
4. Apply anti-microbial agent to more th	an the floor	150.22	SF@	0.20 =	30.04
CEILINGS					
The ceiling texturing has tested positiv	e for ACM.				
5a. Remove 5/8" drywall - hung, taped,	floated, ready for paint	32.00	SF@	0.42 =	13.44
5b. Replace 5/8" drywall - hung, taped, t	loated, ready for paint	32.00	SF@	1.64 =	52.48
Patch ceiling spot					
6a. Remove Blown-in insulation - 14" de	epth - R38	32.00	SF@	1.07 =	34.24
6b. Replace Blown-in insulation - 14" de	epth - R38	32.00	SF@	1.07 =	34.24
7. Paint more than the ceiling - two coats	S	387.49	SF@	0.61 =	236.37
FLOORING					
8a. Remove Sheathing - OSB - 5/8"		118.22	SF@	0.56 =	66.20
8b. Replace Sheathing - OSB - 5/8"		118.22	SF@	1.67 =	197.43
9a. Remove Batt insulation - 6" - R19 - 1	paper faced	118.22	SF@	0.29 =	34.28
9b. Replace Batt insulation - 6" - R19 - J	paper faced	118.22	SF@	0.81 =	95.76
10. Remove Carpet - Standard grade		118.22	SF@	0.28 =	33.10
11. Replace Carpet - Standard grade		135.96	SF@	2.24 =	304.55
15 % waste added for Carpet - Standard	grade.				
12a. Remove Carpet pad		118.22	SF@	0.12 =	14.19
12b. Replace Carpet pad		118.22	SF@	0.52 =	61.47
13a. Remove Baseboard - 3 1/4"		36.58	LF@	0.46 =	16.83
13b. Replace Baseboard - 3 1/4"		36.58	LF@	2.61 =	95.47
14. Paint baseboard - two coats		36.58	LF@	0.87 =	31.82

Page: 3 09015\_ECR\_BID 3/27/2023



Subroom: Closet 1A (1)

## ReBUILD NC Damage Repair Verification Estimate

The North Carolina Homeowners Assistance Program

Dining Room			Height: 7' 3"
Missing Wall - Goes to Floor	4' 8" X 6' 8"	Opens into LIVING_ROOM	
Missing Wall	11' 1" X 7' 3"	<b>Opens into KITCHEN</b>	

**Missing Wall** 11' 1" X 7' 3" Missing Wall - Goes to Floor 2' 8" X 6' 8" Opens into DEN

		-		
DESCRIPTION		QTY	UNIT PRICE	TOTAL
GENERAL CONDITIONS				
15. Final cleaning - construction - Residential	95.13	SF@	0.22 =	20.93
16. Apply anti-microbial agent to the floor	95.13	SF@	0.20 =	19.03
FLOORING				
17a. Remove Sheathing - OSB - 5/8"	95.13	SF@	0.56 =	53.27
17b. Replace Sheathing - OSB - 5/8"	95.13	SF@	1.67 =	158.87
18a. Remove Batt insulation - 6" - R19 - paper faced	95.13	SF@	0.29 =	27.59
18b. Replace Batt insulation - 6" - R19 - paper faced	95.13	SF@	0.81 =	77.06
19a. Remove Underlayment - 1/4" hardboard	95.13	SF@	0.89 =	84.67
19b. Replace Underlayment - 1/4" hardboard	95.13	SF@	1.32 =	125.57
20. Remove Vinyl floor covering (sheet goods) - Standard grade	95.13	SF@	0.93 =	88.47
21. Replace Vinyl floor covering (sheet goods) - Standard grade	109.40	SF@	2.07 =	226.46
22a. Remove Baseboard - 3 1/4"	20.92	LF@	0.46 =	9.62
22b. Replace Baseboard - 3 1/4"	20.92	LF@	2.61 =	54.60
23a. Remove Base shoe	20.92	LF@	0.17 =	3.56
23b. Replace Base shoe	20.92	LF@	1.10 =	23.01
24. Paint baseboard w/cap &/or shoe - two coats	20.92	LF@	1.07 =	22.38

Height: 7' 3" **Bedroom 1** Height: 7' 3" Subroom: Closet 1B (2)

Height: 7' 3"

DESCRIPTION	QTY	UNIT PRICE	TOTAL
GENERAL CONDITIONS			
25. Final cleaning - construction - Residential	118.28 SF@	0.22 =	26.02
26. Apply anti-microbial agent to the floor	118.28 SF@	0.20 =	23.66
ELECTRICAL			
27. Replace Combination CO/Smoke detector - Standard grade	1.00 EA@	67.43 =	67.43
FLOORING			
28a. Remove Sheathing - OSB - 5/8"	118.28 SF@	0.56 =	66.24
28b. Replace Sheathing - OSB - 5/8"	118.28 SF@	1.67 =	197.53
29a. Remove Batt insulation - 6" - R19 - paper faced	118.28 SF@	0.29 =	34.30
29b. Replace Batt insulation - 6" - R19 - paper faced	118.28 SF@	0.81 =	95.81
30. Remove Carpet - Standard grade	118.28 SF@	0.28 =	33.12
31. Replace Carpet - Standard grade	136.02 SF @	2.24 =	304.68
9015_ECR_BID		3/27/2023	Page: 4

#### **CONTINUED - Bedroom 1**

DESCRIPTION		QTY	UNIT PRICE	TOTAL
15 % waste added for Carpet - Standard grade.				
32a. Remove Carpet pad	118.28	SF@	0.12 =	14.19
32b. Replace Carpet pad	118.28	SF@	0.52 =	61.51
33a. Remove Baseboard - 3 1/4"	71.50	LF@	0.46 =	32.89
33b. Replace Baseboard - 3 1/4"	71.50	LF@	2.61 =	186.62
34. Paint baseboard - two coats	71.50	LF@	0.87 =	62.21

Bedroom 2 Height: 7' 3"

Missing Wall - Goes to Floor	4' 3" X 6' 8"	0	pens into	DEN	
DESCRIPTION			QTY	UNIT PRICE	TOTAL
GENERAL C	ONDITIONS				
35. Final cleaning - construction - Reside	ntial	110.74	SF@	0.22 =	24.36
36. Apply anti-microbial agent to the floo	or	110.74	SF@	0.20 =	22.15
ELECTRICA	L				
37. Replace Combination CO/Smoke dete	ector - Standard grade	1.00	EA@	67.43 =	67.43
FLOORING					
38a. Remove Sheathing - OSB - 5/8"		110.74	SF@	0.56 =	62.01
38b. Replace Sheathing - OSB - 5/8"		110.74	SF@	1.67 =	184.94
39a. Remove Batt insulation - 6" - R19 -	paper faced	110.74	SF@	0.29 =	32.11
39b. Replace Batt insulation - 6" - R19 - 1	paper faced	110.74	SF@	0.81 =	89.70
40. Remove Carpet - Standard grade		110.74	SF@	0.28 =	31.01
41. Replace Carpet - Standard grade		127.35	SF@	2.24 =	285.26
15 % waste added for Carpet - Standard g	rade.				
42a. Remove Carpet pad		110.74	SF@	0.12 =	13.29
42b. Replace Carpet pad		110.74	SF@	0.52 =	57.58
43a. Remove Baseboard - 3 1/4"		37.92	LF@	0.46 =	17.44
43b. Replace Baseboard - 3 1/4"		37.92	LF@	2.61 =	98.97
44. Paint baseboard - two coats		37.92	LF @	0.87 =	32.99

Bedroom 3 Height: 7' 3"

09015\_ECR\_BID 3/27/2023 Page: 5



Subroom: Closet 3 (1)

49a. Remove Batt insulation - 6" - R19 - paper faced

49b. Replace Batt insulation - 6" - R19 - paper faced

15 % waste added for Carpet - Standard grade.

50. Remove Carpet - Standard grade

51. Replace Carpet - Standard grade

53a. Remove Baseboard - 3 1/4"

53b. Replace Baseboard - 3 1/4"

52a. Remove Carpet pad

52b. Replace Carpet pad

Kitchen

### ReBUILD NC Damage Repair Verification Estimate

The North Carolina Homeowners Assistance Program

DESCRIPTION **QTY UNIT PRICE TOTAL** -----GENERAL CONDITIONS------45. Final cleaning - construction - Residential 117.25 SF@ 0.22 =25.80 46. Apply anti-microbial agent to the floor 117.25 SF@ 0.20 =23.45 -----ELECTRICAL-----47. Replace Combination CO/Smoke detector - Standard grade 1.00 EA@ 67.43 =67.43 -----FLOORING-----48a. Remove Sheathing - OSB - 5/8" 117.25 SF@ 0.56 =65.66 48b. Replace Sheathing - OSB - 5/8" 117.25 SF@ 195.81 1.67 =

117.25 SF@

117.25 SF@

117.25 SF@

134.84 SF@

117.25 SF@

117.25 SF@

59.83 LF@

59.83 LF@

Height: 7' 3"

34.00

94.97

32.83

302.04

14.07

60.97

27.52

156.16

Height: 7' 3"

0.29 =

0.81 =

0.28 =

2.24 =

0.12 =

0.52 =

0.46 =

2.61 =

54. Paint baseboard - two coats	59.83 LF @	0.87 =	52.05

Missing Wall 11' 1" X 7' 3"		Opens into DINING_ROOM		
DESCRIPTION		QTY	UNIT PRICE	TOTAL
GENERAL CONDITIONS				
55. Final cleaning - construction - Residential	79.43	SF@	0.22 =	17.47
56. Apply anti-microbial agent to more than the floor	158.86	SF@	0.20 =	31.77
CEILINGS				
57. Remove Acoustic ceiling tile	79.43	SF@	0.61 =	48.45
58. Replace 5/8" drywall - hung, taped, floated, ready for paint	79.43	SF@	1.64 =	130.27
59a. Remove Blown-in insulation - 14" depth - R38	79.43	SF@	1.07 =	84.99
59b. Replace Blown-in insulation - 14" depth - R38	79.43	SF@	1.07 =	84.99
60. Paint more than the ceiling - two coats	263.70	SF@	0.61 =	160.86
CABINETS				
61. Detach & Reset Cabinetry - upper (wall) units - Standard grade	10.00	LF@	44.25 =	442.50
62. Detach & Reset Cabinetry - lower (base) units - Standard grade	11.00	LF@	51.75 =	569.25
63. Detach & Reset Countertop - post formed plastic laminate - Stand	lard 11.00	LF @	14.55 =	160.05
grade				
ELECTRIC				
64. Remove Outlet	1.00	EA@	5.04 =	5.04
0015_ECR_BID			3/27/2023	Page

### **CONTINUED - Kitchen**

DESCRIPTION	QTY	UNIT PRICE	TOTAL
65. Replace Ground fault interrupter (GFI) outlet	1.00 EA @	26.03 =	26.03
66. Detach & Reset Sink - double - Standard grade	1.00 EA @	111.12 =	111.12
67. Replace Water heater overflow drain panAPPLIANCES	1.00 EA @	38.86 =	38.86
68. Detach & Reset Range hood - Standard grade	1.00 EA @	68.26 =	68.26
69. Detach & Reset Refrigerator - top freezer - 18 to 22 cf - Std grade	1.00 EA @	32.11 =	32.11
70. Detach & Reset Range - freestanding - electric - Standard gradeFLOORING	1.00 EA @	43.02 =	43.02
71a. Remove Sheathing - OSB - 5/8"	79.43 SF @	0.56 =	44.48
71b. Replace Sheathing - OSB - 5/8"	79.43 SF @	1.67 =	132.65
72a. Remove Batt insulation - 6" - R19 - paper faced	79.43 SF @	0.29 =	23.03
72b. Replace Batt insulation - 6" - R19 - paper faced	79.43 SF @	0.81 =	64.34
73a. Remove Underlayment - 1/4" hardboard	79.43 SF @	0.89 =	70.69
73b. Replace Underlayment - 1/4" hardboard	79.43 SF @	1.32 =	104.85
74. Remove Vinyl floor covering (sheet goods) - Standard grade	79.43 SF @	0.93 =	73.87
75. Replace Vinyl floor covering (sheet goods) - Standard grade	91.35 SF@	2.07 =	189.09
76a. Remove Baseboard - 3 1/4"	25.42 LF@	0.46 =	11.69
76b. Replace Baseboard - 3 1/4"	25.42 LF@	2.61 =	66.35
77a. Remove Base shoe	25.42 LF@	0.17 =	4.32
77b. Replace Base shoe	25.42 LF@	1.10 =	27.96
78. Paint baseboard w/cap &/or shoe - two coats	25.42 LF @	1.07 =	27.20

Laundry Room			He	eight: Sloped
DESCRIPTION		QTY	UNIT PRICE	TOTAL
GENERAL CONDITIONS				
79. Final cleaning - construction - Residential	55.88	SF@	0.22 =	12.29
80. Apply anti-microbial agent to the surface area	32.00	SF@	0.20 =	6.40
CEILINGS				
81a. Remove 5/8" drywall - hung, taped, floated, ready for paint	32.00	SF@	0.42 =	13.44
81b. Replace 5/8" drywall - hung, taped, floated, ready for paint	32.00	SF@	1.64 =	52.48
Patch ceiling spot				
82a. Remove Blown-in insulation - 14" depth - R38	32.00	SF@	1.07 =	34.24
82b. Replace Blown-in insulation - 14" depth - R38	32.00	SF@	1.07 =	34.24
9015_ECR_BID			3/27/2023	Page: 7

The North Carolina Homeowners Assistance Program

### **CONTINUED - Laundry Room**

DESCRIPTION	QTY	UNIT PRICE	TOTAL
83. Paint more than the ceiling - two coatsELECTRIC	335.34 SF @	0.61 =	204.56
84. Remove Outlet	1.00 EA @	5.04 =	5.04
85. Replace Ground fault interrupter (GFI) outlet	1.00 EA @	26.03 =	26.03


Bathroom 1		H	Height: Sloped
Subroom: Bath 1 Closet (1)		I	Height: Sloped
DESCRIPTION	QTY	UNIT PRICE	TOTAL
GENERAL CONDITIONS			
86. Final cleaning - construction - Residential	61.50 SF @	0.22 =	13.53
87. Apply anti-microbial agent to the floorELECTRICAL	61.50 SF @	0.20 =	12.30
88. Remove Outlet	1.00 EA @	5.04 =	5.04
89. Replace Ground fault interrupter (GFI) outletPLUMBING	1.00 EA @	26.03 =	26.03
90. Detach & Reset Toilet - Standard grade	1.00 EA @	170.98 =	170.98
91. Detach & Reset Fiberglass tub & shower combination - Standard gradeVANITIES	1.00 EA @	439.33 =	439.33
92. Detach & Reset Vanity - Standard grade	4.00 LF @	44.25 =	177.00
93. Detach & Reset Vanity top - one sink - cultured marble	4.00 LF @	34.25 =	137.00
FLOORING			
94a. Remove Sheathing - OSB - 5/8"	61.50 SF @	0.56 =	34.44
94b. Replace Sheathing - OSB - 5/8"	61.50 SF @	1.67 =	102.71
95a. Remove Batt insulation - 6" - R19 - paper faced	61.50 SF @	0.29 =	17.84
95b. Replace Batt insulation - 6" - R19 - paper faced	61.50 SF@	0.81 =	49.82
96a. Remove Underlayment - 1/4" hardboard	61.50 SF @	0.89 =	54.74
96b. Replace Underlayment - 1/4" hardboard	61.50 SF @	1.32 =	81.18
97. Remove Vinyl floor covering (sheet goods) - Standard grade	61.50 SF @	0.93 =	57.20
98. Replace Vinyl floor covering (sheet goods) - Standard grade	70.73 SF @	2.07 =	146.41
99a. Remove Baseboard - 3 1/4"	45.33 LF @	0.46 =	20.85
99b. Replace Baseboard - 3 1/4"	45.33 LF @	2.61 =	118.31
100a. Remove Base shoe	45.33 LF @	0.17 =	7.71
100b. Replace Base shoe	45.33 LF @	1.10 =	49.86
9015_ECR_BID		3/27/2023	Page:



#### **CONTINUED - Bathroom 1**


DESCRIPTIO	ON				QTY	UNIT PRICE	TOTAL
101. Paint baseboard w/cap &/or shoe - two coats				45.33	LF @	1.07 =	48.50
Grand Tota	al Areas:						
2,972.26	SF Walls	937.40	SF Ceiling		3,909.66	SF Walls and Ceiling	
936.62	SF Floor	104.07	SY Flooring		405.00	LF Floor Perimeter	
0.00	SF Long Wall	0.00	SF Short Wall		428.33	LF Ceil. Perimeter	
936.62	Floor Area	1,032.03	Total Area		3,029.06	Interior Wall Area	
1,438.13	Exterior Wall Area	135.67	Exterior Perimeter of Walls				
1,628.92	Surface Area	16.29	Number of Squares		267.66	Total Perimeter Length	
41.92	Total Ridge Length	0.00	Total Hip Length			-	

09015\_ECR\_BID 3/27/2023 Page: 9

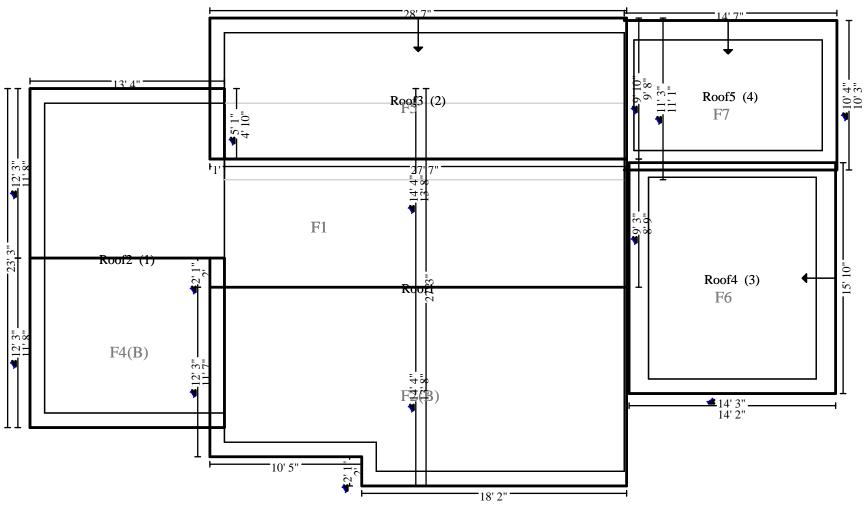



Roof

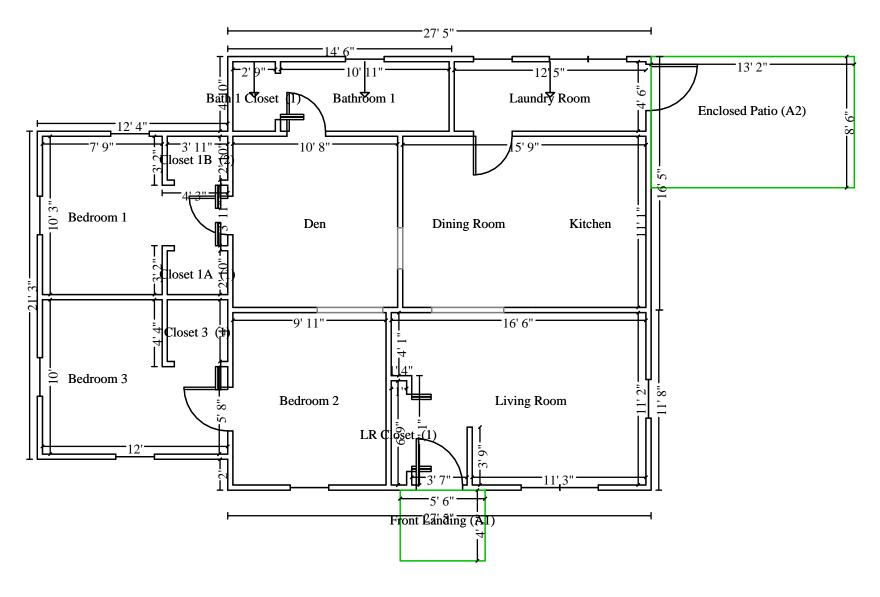



### Main Level