

ADDRESS : 38 WILLOWCROFT CT
 CONTRACTOR : WILLIAM ELMORE BUILDERS
 OWNER : OXENDINE CHARLES & JANE
 PARCEL : 02-1518- - -0099- -19-
 APPL NUMBER: 15-50035475 CP NEW RESIDENTIAL (SFD)
 DIRECTIONS : T/S: 02/09/2015 09:31 AM JBROCK ----
 LEIGH LAUREL #16
 LAND NOTES : LXMN 6/18/04 LEIGH LAUREL LOT#16
 LXMN 6/21/04 SPLIT FROM THE 03 PARCEL

SUBDIV: LEIGH LAUREL
 PHONE : (919) 820-3661
 PHONE :


STRUCTURE: 000 000 88X56 4BDR CRAWL W/ GARAGE

FLOOD ZONE : FLOOD ZONE X
 # BEDROOMS : 4000000.00
 SEPTIC - EXISTING? : NEW TANK
 PROPOSED USE : SFD
 WATER SUPPLY : COUNTY

PERMIT: CPSF 00 CP * SFD

TYP/SQ	REQUESTED COMPLETED	INSP RESULT	DESCRIPTION RESULTS/COMMENTS
B101 01	4/07/15	DT	R*BLDG FOOTING / TEMP SVC POLE VRU #: 002642787
	4/07/15	AP	T/S: 04/07/2015 02:02 PM DETAYLOR -----
A814 01	4/22/15	TW	ADDRESS CONFIRMATION TIME: 17:00 VRU #: 002649564
	4/22/15	AP	38 WILLOWCROFT CT DUNN 28334 T/S: 04/22/2015 08:38 AM TWARD -----
B103 01	4/22/15	DT	R*BLDG FOUND & TEMP SVC POLE TIME: 17:00 VRU #: 002649556
	4/22/15	AP	T/S: 04/22/2015 11:37 AM DETAYLOR -----
B105 01	5/01/15	DT	R*OPEN FLOOR TIME: 17:00 VRU #: 002653277
	5/01/15	AP	T/S: 04/29/2015 01:18 PM LBENNETT ----- T/S: 04/30/2015 08:07 AM LBENNETT ----- T/S: 05/01/2015 10:03 AM DETAYLOR -----
B104 01	6/25/15	JB	R*FOUND & SETBACK VERIF SURVEY TIME: 17:00 VRU #: 002680072
	6/25/15	AP	T/S: 06/25/2015 01:52 PM JBROCK -----
R425 01	6/26/15	KS	FOUR TRADE ROUGH IN TIME: 17:00 VRU #: 002680106
	6/26/15	DA	Mr. Elmore would like to have someone call him prior to going so that he can be on site. 919-820-3661 or 910-892-6900. T/S: 06/26/2015 02:54 PM KSLATTUM ----- 1. Portal framing not done correctly. 2. Stove vent not installed 3. Electrical wiring frounds not tied. Numerous staples missing. 4. Plan calls for 2 11 7/8 lvl's--9 1/4 used instead (in foyer and cat walk). 5. Air barrier not installed in master bath. 6. Air barrier missing at duct chase. 7. No collar ties in foyer. 9. Metal box in upstairs bath not bonded. 10 Gas line test at 0 psi. 11. No flashing for brick at floor level. 12. HVAC air handler blocks dry stacked. 13. Romex in crawl not stapled. 14. Studs in garage bored 2 inch holes for SE cable. Remove and replace or sister 2x4 next to each. Do not side or insulate.
R425 02	7/02/15	TI	FOUR TRADE ROUGH IN TIME: 17:00 VRU #: 002682573
	<i>7/2/15</i>	<i>DA DA</i>	T/S: 07/01/2015 02:10 PM LBENNETT ----- PLEASE CALL (919) 820 3661 OR (910) 892-6900 BEFORE GOING

COMMENTS AND NOTES

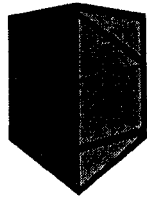

TONY JOHNSON ARCHITECT

July 1, 2015


Mr. William Elmore
Elmore Realty and Builders
Dunn, NC

RE: Oxendine Residence
Permit #1550035475

Mr. Elmore:

On the above noted project the following items have been changed from the original sealed drawings. These changes are structurally adequate to support the required loads.

1. The garage door header supporting the triple 24" lvl is now (3) 1.75x11-7/8" LVL.
2. The beam supporting the balcony at the Great Room is now (2) 1.75x9.25 LVL.
3. The beam supporting the balcony at the Foyer is now (2) 1.75x9.25 LVL.

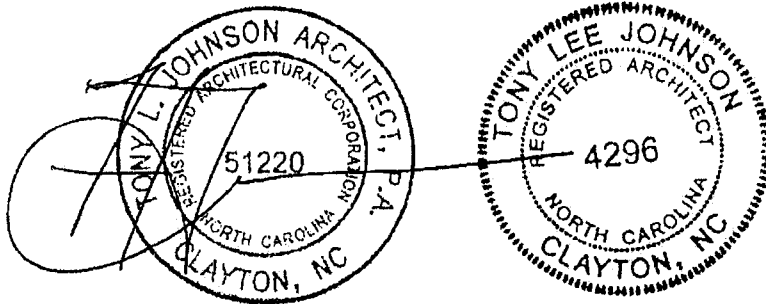

7/1/2015