


FACTORS		PRO												
		1	2	3	4	5	6	7	8	9	10			
LANDSCAPE POSITION	.1940													
SLOPE (%)	.1940													
HORIZON 1 DEPTH		0-16	0-16	0-12	0-30	0-8	0-22	0-32						
Texture Group	.1941(A)(1)	CLL	CLL	Org Loam	S/Wet	Org Sand	CLL	CLL						
Consistence	.1941				Water			30" water						
Structure	.1941(A)(2)				in horiz									
Mineralogy	.1941(A)(3)													
HORIZON 2 DEPTH		16-32	16-30	12-20	30+	8-27	22-36							
Texture Group	.1941(A)(1)	SCL	SCL	EXP	EXP clay	SL	SCL							
Consistence	.1941	VF	VF	CLAY			Fv							
Structure	.1941(A)(2)	SBR	SBR				SBR(Gr)							
Mineralogy	.1941(A)(3)	SEXP	SEXP				N EXP							
HORIZON 3 DEPTH						27-36								
Texture Group	.1941(A)(1)					SCL								
Consistence	.1941					Fv								
Structure	.1941(A)(2)					SBR								
Mineralogy	.1941(A)(3)					SEXP								
HORIZON 4 DEPTH														
Texture Group	.1941(A)(1)													
Consistence	.1941													
Structure	.1941(A)(2)													
Mineralogy	.1941(A)(3)													
SOIL WETNESS	.1942	28"	28"			30"	33"							
RESTRICTIVE HORIZON	.1944													
SAPROLITE	.1943/.1956													
CLASSIFICATION	.1948	PS	PS	X	?	PS	PS							
LONG TERM ACCEPTANCE RATE	.1955	.3	.3	X	?	.35	.45							

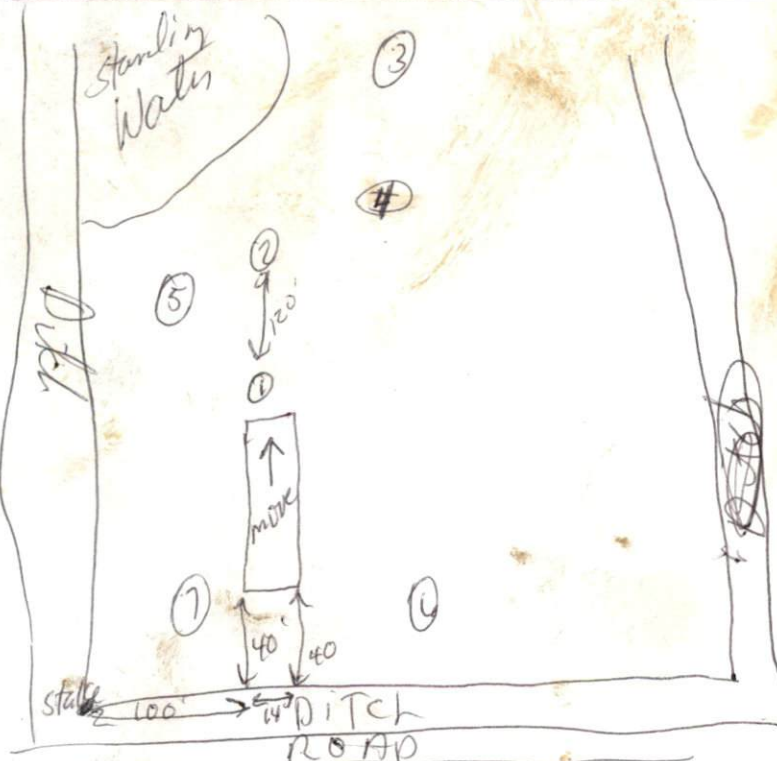

16 Feb 99
 * Possible fence drain
 * move house up hill
 * Call & talk to client