


I, MICHAEL P. GRIFFIN, certify that under my direction and supervision this map was drawn from an actual field survey; that the error of closure of the survey as calculated by coordinates is 1: 10,000+; that the area shown hereon was calculated by coordinates.

Witness my hand and seal this day of MONTH 2019.

BK 2019 PGS #21-424
HARNETT CO. REGISTRY

IMPERVIOUS AREAS

HOUSE	1526 SQ. FT.
DRIVE & WALKS	856 SQ. FT.
SCREEN PORCH	87 SQ. FT.
PATIO	32 SQ. FT.
TOTAL	2501 SQ. FT.
ALLOWED	\$250 SQ. FT.

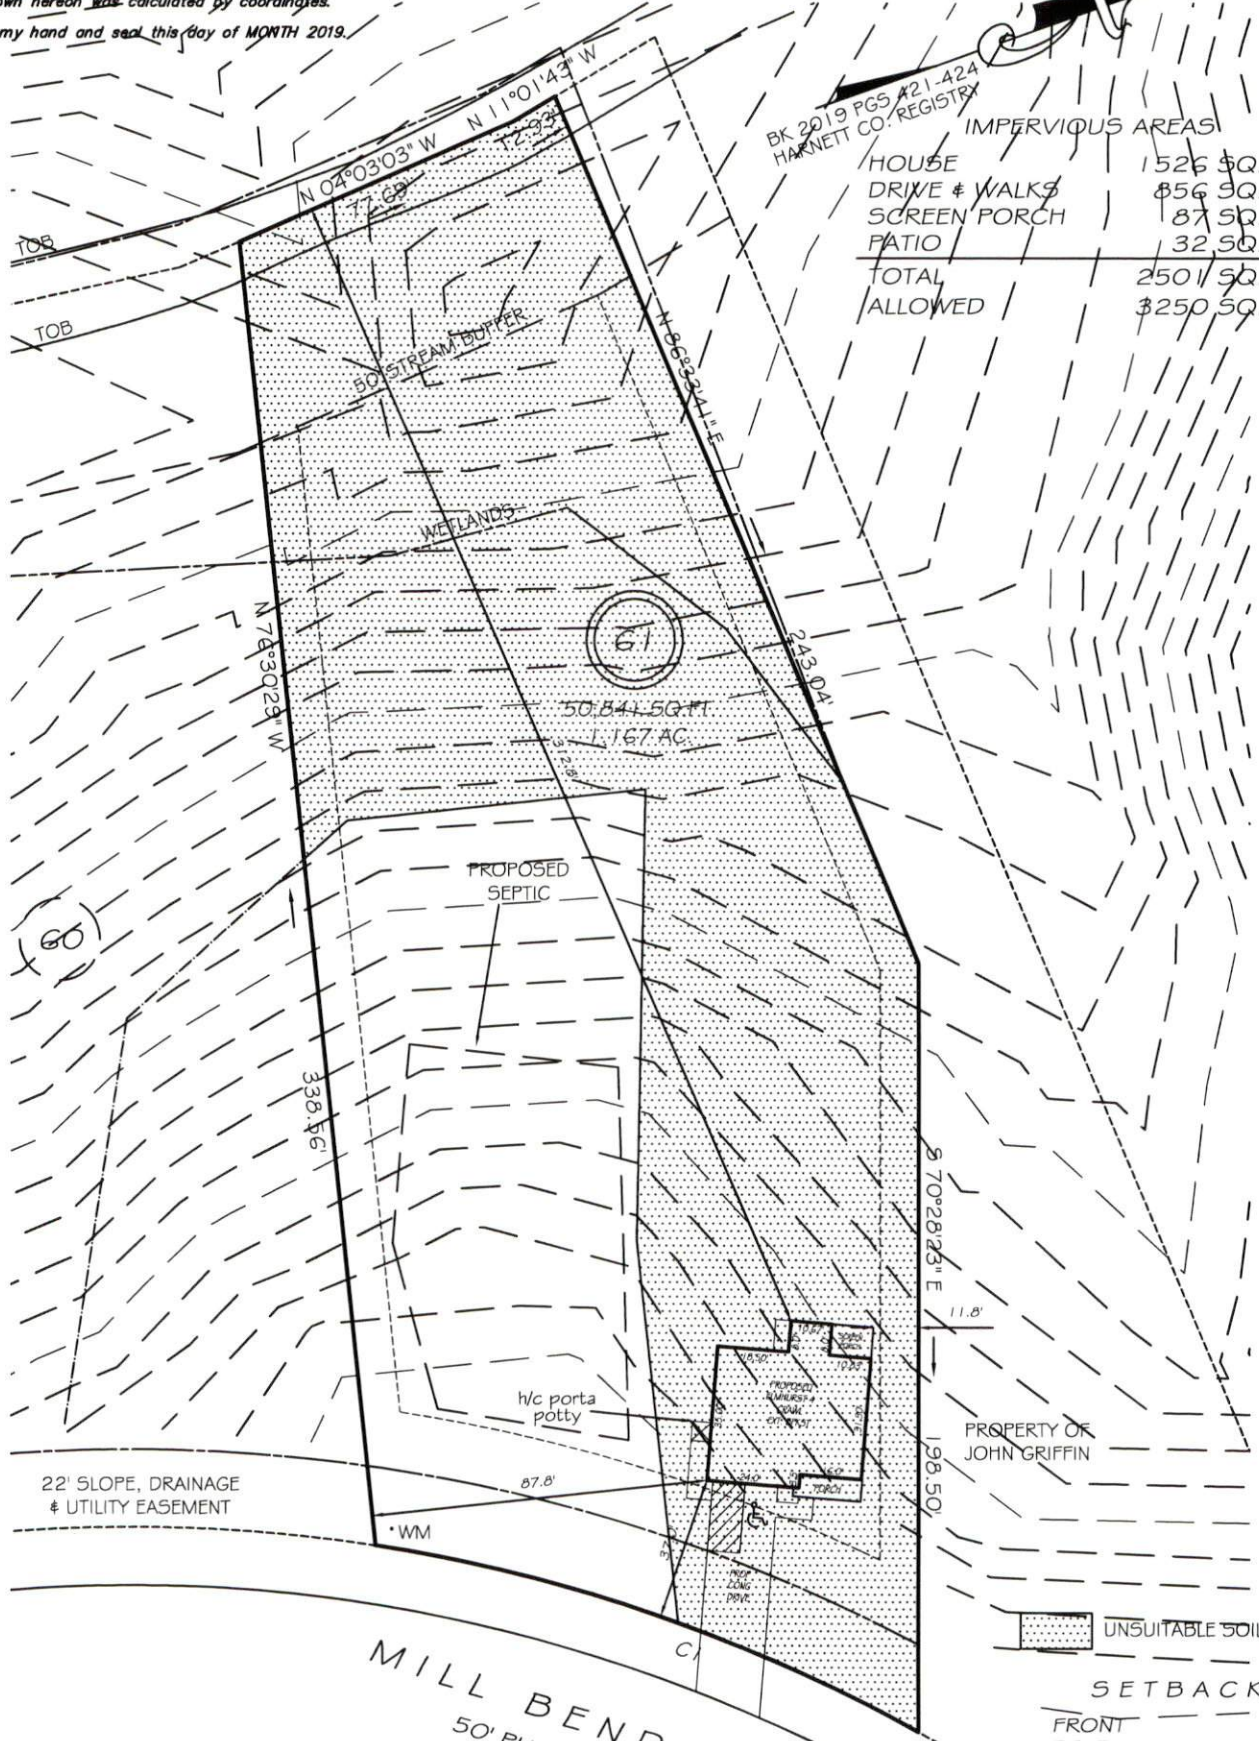

22' SLOPE, DRAINAGE & UTILITY EASEMENT

PROPERTY OF JOHN GRIFFIN

UNSUITABLE SOILS

SETBACKS

FRONT	35'
REAR	25'
SIDE	10'
CORNER SIDE	20'

REVISION: MOVE HOUSE TO UNSUITABLE SOILS AREA 1/28/20
REVISION: COMMENTS 1/20/20
REVISION: H/C 1/17/20
REVISION: MOVE & ROTATE 1/9/20


C | R=425.00' L=150.26' S38°14'00"W | 49.47'

PRELIMINARY


NOT FOR RECORDATION,
SALES OR CONVEYANCE

LEGEND

- EIP EXISTING IRON PIPE
- IPS IRON PIPE SET
- RW RIGHT OF WAY
- NF NOW OR FORMERLY
- FIS EXISTING IRON STAKE
- FES FLARED END SECTION
- WM WATER METER
- CO CLEAN OUT
- FH FIRE HYDRANT
- CS CLEAN SIDE

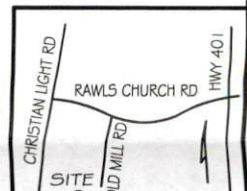

Olde Mill Village 3-Bedroom Layout Lot #61

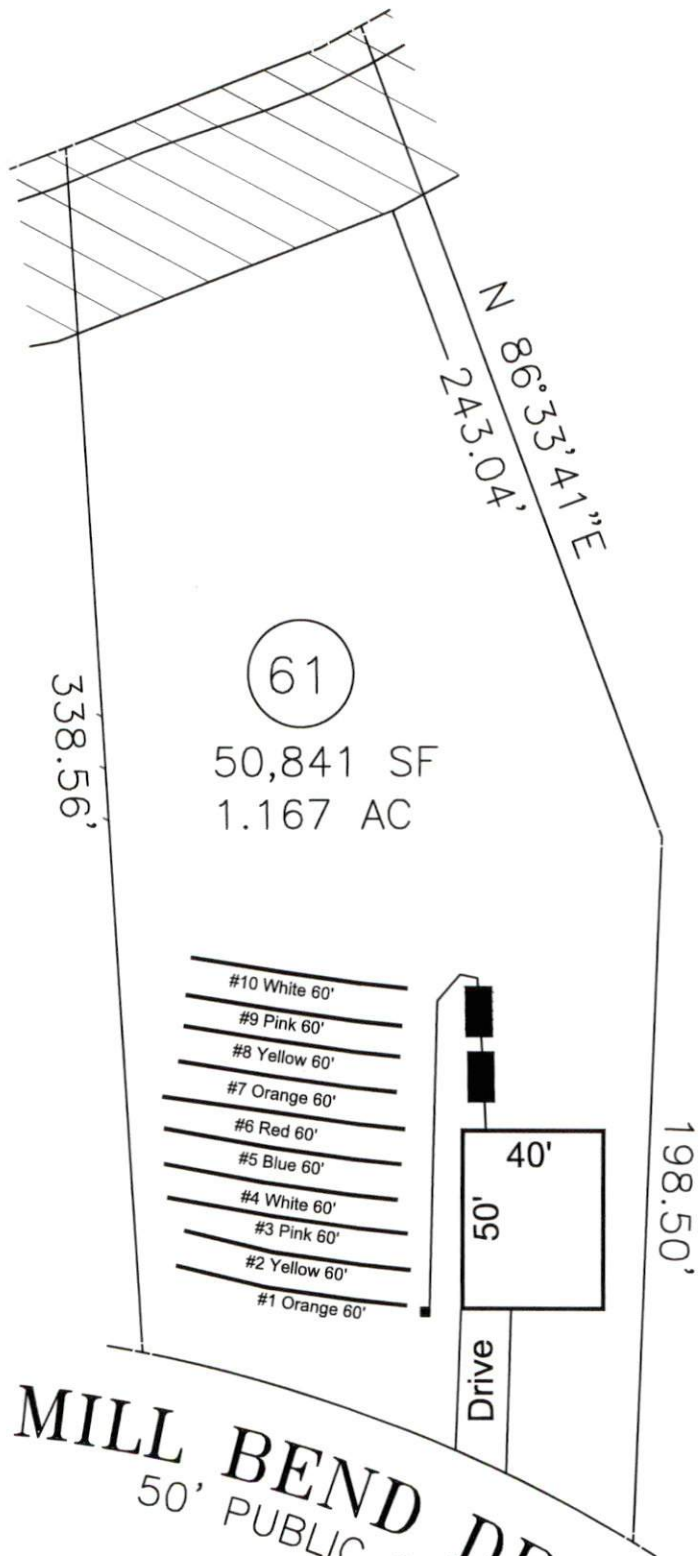

System: Pump to D-Box
 Lines: 1-5, (300')
 0.3 LTAR
 18" Trench Bottom
 Accepted Status System
 Repair: Pump to D-Box
 Lines: 6-10 (300')
 0.3 LTAR
 18" Trench Bottom
 Accepted Status System

MILL BEND DRIVE
 50' PUBLIC & UTILITY

GRAPHIC SCALE
 1" = 50'



Adams
 Soil Consulting
 919-414-6761
 Job #699