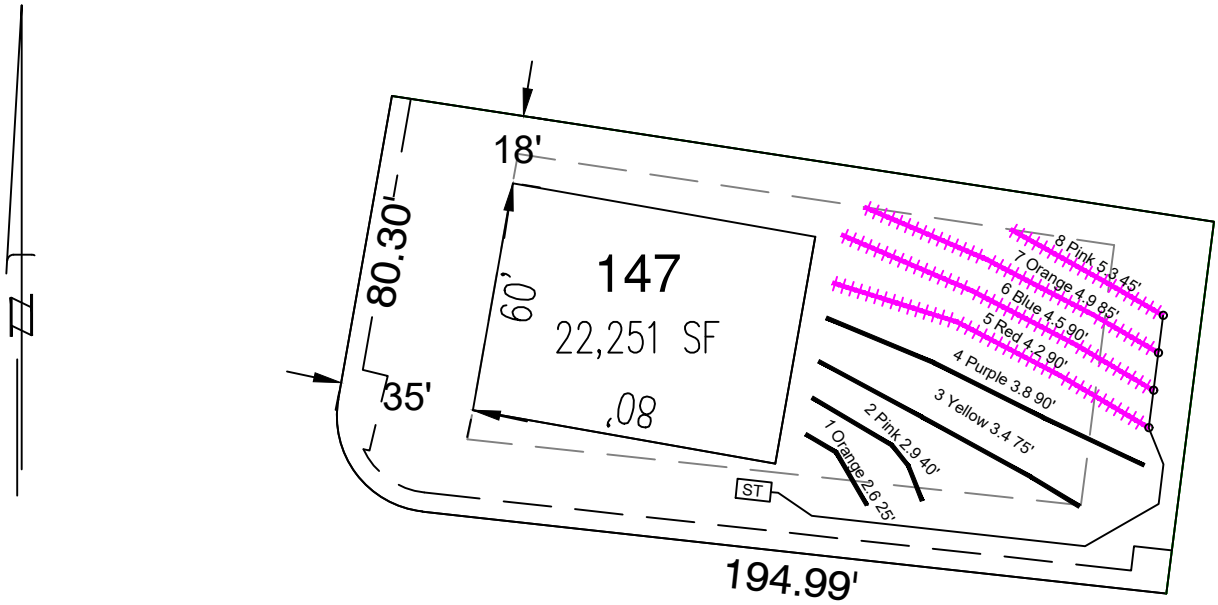


System:
Repair:

*Keep tanks and drain lines 10' from property lines.
*Not a survey.
*Not a guarantee of a septic permit.
*Keep supply lines >5' from property lines.
*Some lines are flagged longer in the field than lengths indicate.
*No grading septic area.

System: Gravity to Serial Dist.
Lines: 5–8, (310')
Accepted Status System
0.35 Soil LTAR
20" Trench Bottom

Repair: Pressure Manifold
Lines: 1–4, (230')
T&J Panel 50% Reduction
0.4 Soil LTAR
20" Trench Bottom

GRAPHIC SCALE
1" = 50'
50 0 50 100

Central Carolina Soil Consulting, PLLC
1900 South Main Street, Suite 110
Wake Forest, North Carolina 27587
Phone (919)569–6704 Fax (919)569–6703

3–Bedroom Septic Layout
Lot 147, Birchwood Grove Subdivision
Harnett County, North Carolina

Job# : 3753
Drawn By : LW
Date : 02/21/2024
Revision: