

SOUTHEASTERN SOIL & ENVIRONMENTAL ASSOC., INC.

PROPOSED SUBSURFACE WASTE DISPOSAL SYSTEM DETAIL SHEET

SUBDIVISION: Blake Pond

INITIAL SYSTEM: ^{Pump} Approved 25% Reduction

DISTRIBUTION: D-Box

BENCHMARK: 100.0

NO. BEDROOMS: 3

SEPTIC TANK SIZE 1,000 GAL

LOT 7

REPAIR: ^{Pump} Approved 25% Reduction

DISTRIBUTION D-Box

LOCATION No Bench

LTAR 0.3 gpd/ft²

PUMP TANK SIZE 1,000 GAL

LINE	FLAG COLOR	ELEVATION	LENGTH
I { 1	B	100.00	100
2	R	99.90	100
3	B	99.60	100
			300
R { 4	R	99.50	100
5	B	99.50	100
6	R	99.40	100
			300

BY B.C. Raynor

TYPICAL PROFILE

0-10 LS VFR GR

10-36 SCL Fi SBK (S, q)

CR2 ≥ 28"

DATE 08/07/2024

THERE SHALL BE NO GRADING,

CUTTING, LOGGING OR OTHER SOIL

DISTURBANCE IN SEPTIC AREA

HEALTH DEPARTMENT USE ONLY.

DESIGNS DO NOT GURANTEE FUNCTIONALITY

Blake Pond - Harnett County
08/03/2024


Southeastern Soil & Environmental Associates, Inc.

PO Box 9321

Fayetteville, NC 28311

ph: 910-822-4540

mike@southeasternsoil.com

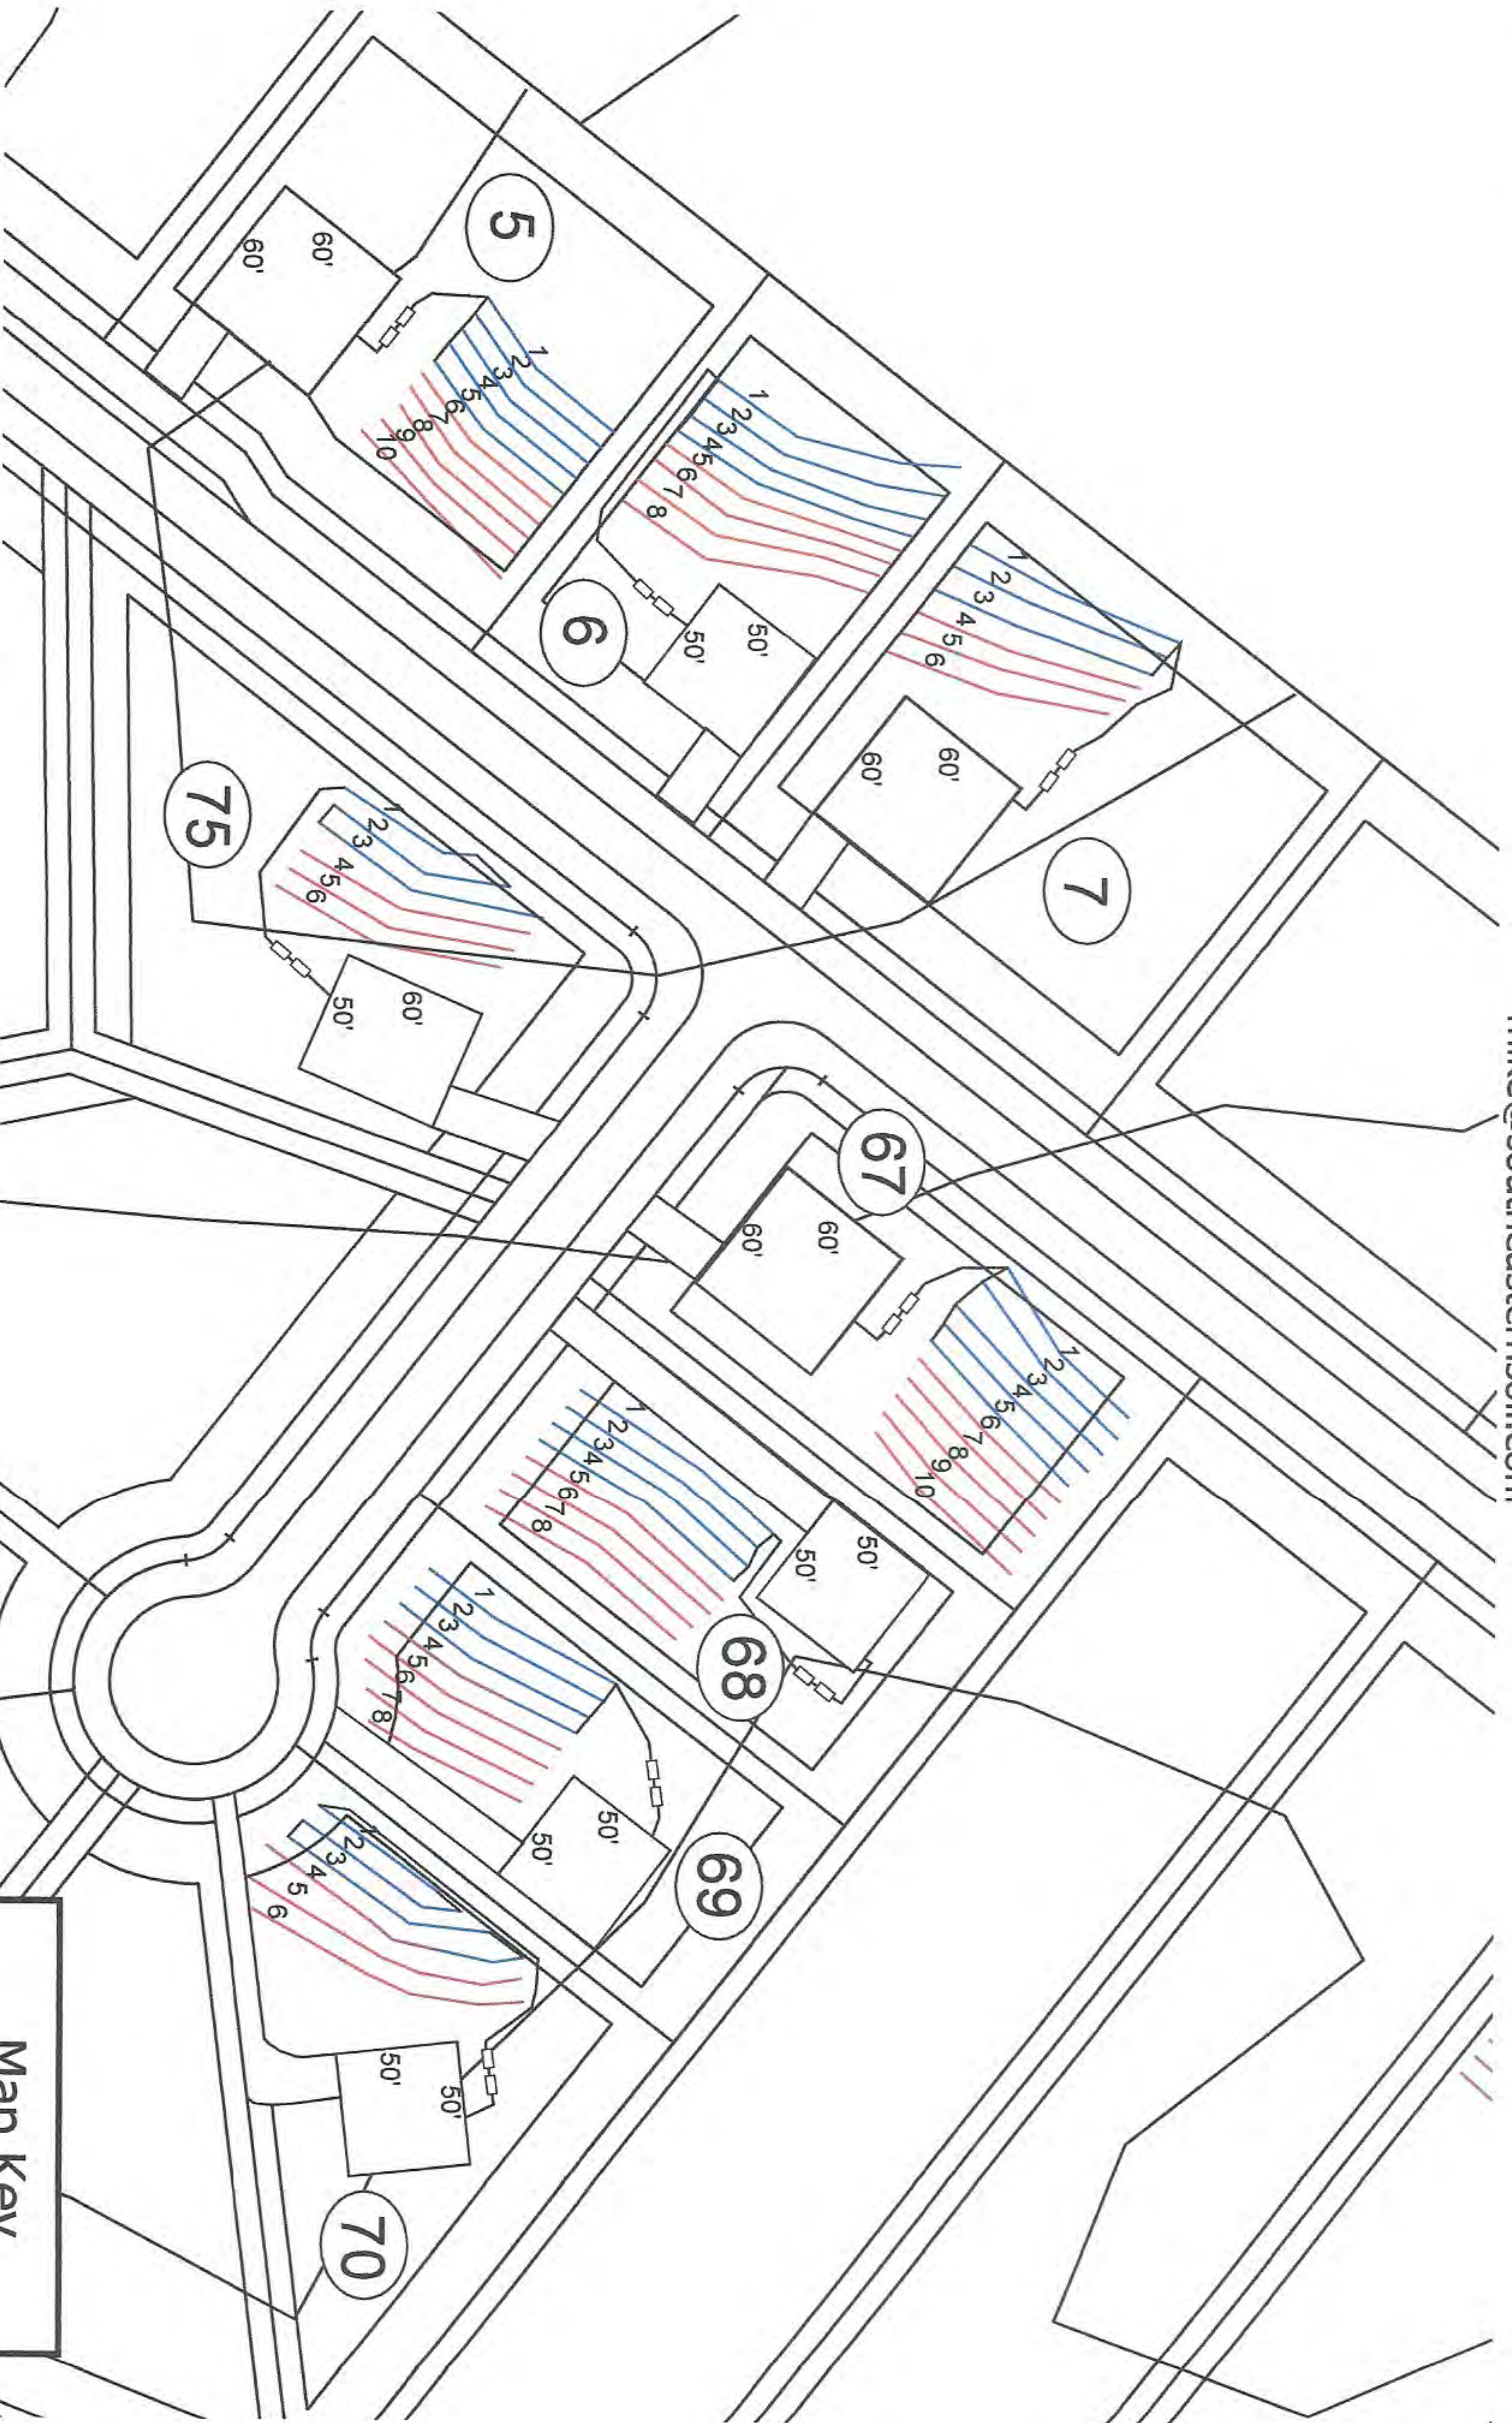

Map Key

— Initial Septic Lines
— Repair Septic Lines