

ADDRESS : 508 ANGEL OAK DR SUBDIV: FOREST OAKS PH5 SECT1 28LTS
 CONTRACTOR : CAVINESS LAND DEVELOPMENT PHONE : (919) 339-6330
 OWNER : WOODSHIRE PARTNERS LLC PHONE :
 PARCEL : 01-0536-09- -0028- -06-
 APPL NUMBER: 17-50042576 CP NEW RESIDENTIAL (SFD)
 DIRECTIONS : 508 ANGEL OAK DR - FOREST OAKS----
 FROM 87SOUTH MAKE A LEFT ONTO NURSERY
 RD CONTINUE TO THE LEFT ON NURSERY RD -
 MAKE RIGHT INTO FOREST OAKS SUBDIVISION
 T/S: 10/17/2017 03:27 PM LLUCAS ----

STRUCTURE: 000 000 58X39 5BDR 3.5BTH W/GAR MONO FNSH BON


FLOOD ZONE : FLOOD ZONE X
 # BATHS : 3.5 # BEDROOMS : 5.00
 PROPOSED USE : SFD SEPTIC - EXISTING? : SEWER
 WATER SUPPLY : COUNTY

PERMIT: CPSF 00 CP * SFD

TYP/SQ	REQUESTED COMPLETED	INSP RESULT	DESCRIPTION RESULTS/COMMENTS
P309 01	11/30/17	JH	R*PLUMB UNDER SLAB VRU #: 003059601
	11/30/17	AP	
A814 01	11/30/17	SB	ADDRESS CONFIRMATION TIME: 17:00 VRU #: 003059647
	11/30/17	AP	508 ANGEL OAK DR BUNNLEVEL 28323 T/S: 11/30/2017 11:54 AM SBENNETT
B111 01	12/06/17	JH	R*BLDG SLAB INSP/TEMP SVC POLE VRU #: 003061938
	12/06/17	DA	Need Engineer letter for fill
B111 02	12/15/17	TSG	R*BLDG SLAB INSP/TEMP SVC POLE VRU #: 003067255
	12/15/17	AP	
B104 01	1/02/18	DJ	R*FOUND & SETBACK VERIF SURVEY TIME: 17:00 VRU #: 003072436
	1/02/18	AP	T/S: 01/02/2018 09:23 AM DJOHNSON T/S: 01/02/2018 09:23 AM DJOHNSON
R425 01	2/01/18	JH	FOUR TRADE ROUGH IN VRU #: 003083530
	2/01/18	DP	1)Anchor all interior load bearing walls per code.2)Missing I joist hanger in garage closet.3)Missing anchor bolts on front wall in foyer & to right of front door.4)Pack out both sides of I joist when hanging from it per I joist instructions in foyer & at bottom of the stairs.5)Seal all holes in air barriers on garage wall.6)Missing nails in roof truss hangers on front porch.7)Install water cutoff bock in kitchen pantry.8)Add stud to left of window in sunroom over 16".9)Install I joist hangers at bottom of stiars correctly.10)Need repair letter for broken truss over master bathroom.11)Missing smoke detector outside master bedroom.12)Install Hurricane straps correctly not bending them.13)Missing air barrier in back left bedroom closet & fire block top of chase.14)Missing LU26 hangers in media room per layout for truss also missing correct hurricane straps for 3ply trussesses.15)Nail house wrap per installation instructions. DO NOT SIDE OR INSULATE
R425 02	2/06/18	JH	FOUR TRADE ROUGH IN TIME: 17:00 VRU #: 003085610
	2/06/18	DA	T/S: 02/05/2018 01:19 PM BPETRICH ITEMS # 1 & 10 Letter for truss repair is on wrong truss-
R425 03	2/07/18	JH	FOUR TRADE ROUGH IN VRU #: 003086314

ADDRESS . : 508 ANGEL OAK DR SUBDIV: FOREST OAKS PH5 SECT1 28LTS
CONTRACTOR : CAVINESS LAND DEVELOPMENT PHONE : (919) 339-6330
OWNER . . : WOODSHIRE PARTNERS LLC PHONE :
PARCEL . . : 01-0536-09- -0028- -06-
APPL NUMBER: 17-50042576 CP NEW RESIDENTIAL (SFD)

TYP/SQ	REQUESTED COMPLETED	INSP RESULT	DESCRIPTION RESULTS/COMMENTS
I129 01	2/07/18 2/09/18	AP JH	R*INSULATION INSPECTION VRU #: 003087420
M305 01	2/09/18 2/27/18	AP JH	R*PLUMB SEWER CONNECTION TIME: 17:00 VRU #: 003094752
E209 01	2/27/18 4/05/18	AP TSG	T/S: 02/26/2018 01:48 PM BPETRICH ----- R*ELEC TEMP POWER CERT VRU #: 003110644
R429 01	4/05/18 6/19/18	AP JH	T/S: 04/05/2018 03:32 PM DJOHNSON ----- FOUR TRADE FINAL VRU #: 003141601
R429 02	6/19/18 6/27/18	DA TI	1)Hole behind stove.2)Sewer cleanouts to grade.3)Protect slab insulation FOUR TRADE FINAL VRU #: 003144733

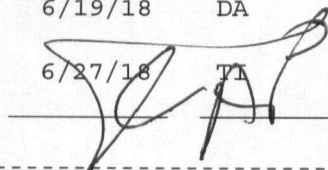

----- COMMENTS AND NOTES -----