SOUTHERN ENGINEERS

James Herman, PE - Owner

Consulting Structural Engineers

TO: Robert Barefoot Barefoot Building Company 910-890-3256

EMAIL:	wrbarefoot@yahoo.com
PROJECT #:	19-1870-A
PAGE:	1 of 1
DATE:	January 2, 2020
RE:	Framing Clarification
LOCATION:	Alan & Rachel Pope Residence by H2

I-Joist Hangers:


The first floor ceiling was framed using 11 7/8" I-joists as specified per the plans. According to the builder, ITS2.06/11.88 top-flange I-joist hangers were installed with (6) 0.148x1¹/₂" nails. Per the Simpson Wood Construction Connecters manual, the ITS2.06/11.88 I-joist top-flange hangers should be installed with (6) 0.148x3" nails.

Response: Please be advised that using (6) 0.148x1¹/₂" nails for the ITS2.06/11.88 top-flange I-joist hangers is acceptable to support the loads from above.

In closing, I trust this letter fulfills your requirements at this time. Should you have any further questions, please do not hesitate to call

Sincerely,

James H. Herman, P.E. Southern Engineers, P.A. (License: C-1287) Cc:sjk/jhh

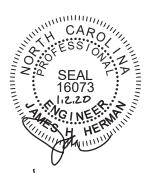

♦ www.southernengineers.com ♦ email: southern@southernengineers.com ♦