



June 15, 2020

Mr. David Carter
Dan Ryan Builders – North Carolina, LLC
3131 RDU Center Drive, Suite 120
Morrisville, North Carolina 27560

**Subject: Summary of Foundation Bearing Material Evaluation
Lot No. 8 – (256 Village Bend Drive)
Olde Mill Village Subdivision
Fuquay-Varina, North Carolina
Permit Number: 2002-0027
SUMMIT Project Number: 3241-14R (28355-00)
Order Number: 5243_001259**

Dear Mr. Carter:

On June 8, 2020, a representative of SUMMIT Engineering, Laboratory and Testing, P.C. (SUMMIT) visited the subject site for the purpose of observing and evaluating the near surface foundation bearing materials for the proposed residential structure including rear porch footings. The following is a summary of our onsite observations and evaluation.

Our work included testing and bearing grade evaluations of the in-place soil at the bottom of the foundation excavations. Hand auger borings were incrementally advanced by manually twisting a sharpened steel auger into the soil at selected locations along the footing excavation. The soil consistency in the bottom of the excavation and at selected intervals below the bearing grade was evaluated by Dynamic Cone Penetrometer (DCP) testing. The conical point of the DCP was first seated to penetrate any loose cuttings and then driven three additional 1-3/4 inch increments with blows from a 15-pound hammer falling 20 inches. The soil's strength characteristics and foundation support capability was determined based on the average blows per increment (bpi) over the last two increments to achieve this penetration. Additionally, the entire excavated foundation was evaluated by hand probing using a 1/2 inch diameter steel probe rod to check for soft areas at the surface intermediate of our hand auger boring locations.

The materials exposed at the bottom of excavations generally consisted of brown-tan, sandy-clay (fill soils) and were free of significant quantities of organics and debris. If additional testing for the purpose of estimating volumetric change (shrink/swell) potential or to estimate consolidation of the tested soils is desired, SUMMIT can provide these services.

SUMMIT tested the four exterior wall corners of the residential foundation and fill soils were encountered to a minimum approximate depth of 3 feet below the foundation bearing elevation. SUMMIT assumes that the fill placement was observed and tested to verify that the fill material


was placed and compacted properly. Based on the results of our DCP testing and the assumption that the fill placed throughout the building pad is similar or better than the properly compacted fill material encountered in the hand auger borings, the soils encountered are suitable for support of the residential structure utilizing a net allowable soil bearing pressure of **2,000 pounds-per-square-foot**. The foundation bearing soils are in accordance with HUD requirements.

If foundation bearing materials are exposed to inclement weather or adverse construction activities, **SUMMIT** should be contacted to re-evaluate the foundation bearing materials prior to concrete placement. If it is imminent that inclement weather is forecasted prior to concrete placement, then the footings can be over-excavated (deepened) approximately 2 to 4 inches and a mud-mat (lean concrete) can be placed up to the foundation bearing elevation to help protect the foundation bearing materials from softening.

We appreciate the opportunity to assist you during this phase of the project. If you need further assistance or additional information please do not hesitate to contact us.

Sincerely,
SUMMIT Engineering, Laboratory and Testing, P.C.

Jeff A. Taylor, P.E.
Geotechnical Engineer

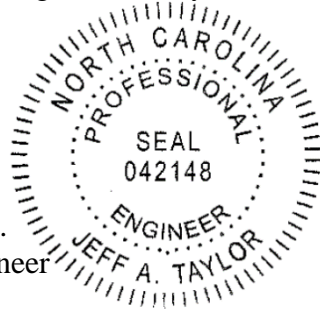

A handwritten signature in black ink, appearing to read "Adam D. Perry".

Adam D. Perry, E.I.
Staff Professional