| NC Registe | red Firm # F-1078 | | | | | | | | |
|---|--------------------|---------------|--|--|------|-------------|--------------|--|--|
| ECS Southeast, LLP 6151 Raeford Road, Suite A Fayetteville, NC 28304 9104013288 9103230539 | | | | LETTER OF TRANSMITTAL | | | | | |
| March 9, 2023 | | | | RE: Liberty Meadows Lot 38 | | | | | |
| Precision Custom Homes | | | | ECS Job # 33:6122-W | | | | | |
| Raeford, NC 28376 ATTN: Shaun Gardner | | | | Permits: Location: 56 Hancock Ct Cameron, NC 28326 | | | | | |
| | <u>X</u> | Field Reports | <u>X</u> | For your | ruse | <u>X</u> | As requested | | |
| CC: | Precision Custom H | | Precision Custom Homes - Lauren Ceruti | | | | | | |
| ENCL: | Field Report # 1 | 3/9/2023 | | | | | | | |
| | ALE ORTH CAROL | x. | | | 11 | $ \Lambda$ | | | |

Jack Cowsert; P.E.

Office Manager

Aaron Kyle Adair Team Leader

Disclaimer

^{1.} This report (and any attachments) shall not be reproduced except in full without prior written approval of ECS.

^{2.} The information in this report relates only to the activities performed on the report date.

^{3.} Where appropriate, this report includes statements as to compliance with applicable project drawings, and specifications for the activities, performed on this report date.

^{4.} Incomplete or non-conforming work will be reported for future resolution.

^{5.} The results of samples and/or specimens obtained or prepared for subsequent laboratory testing will be presented in separate reports/documents.


| ECS | ECS Southeast, LLP 6151 Raeford Road, Suite A Fayetteville, NC 28304 (910) 401-3288 [Phone] | | FIELD F | REPORT | - |
|----------------|--|----------|--|--|-----------|
| Project | (910) 323-0539 [Fax] Liberty Meadows Lot 38 | | Project No. Report No. Day & Date Weather | 33:6122-W 1 Thursday 3/ 60 °/ Sunny | |
| Location | Cameron, NC | | On-Site Time | 1.25 | |
| Client | Precision Custom Homes | | Lab Time Travel Time* | 0.00 <u>0.00</u> | |
| Contractor | Precision Custom Homes | | Total Re Obs Time | 1.25 0.00 | |
| Remarks | | | | | |
| Trip Charges* | Tolls/Parking* | Mileage* | Time of | Arrival | Departure |
| Chargeable Ite | ems | | | 9:00A | 10:15A |

ECS arrived on site, as requested, to check the bearing capacity of soils via hand auger/DCP method for monolithic slab foundation. Footings have not been excavated. Please see the attached sketch and data sheet for details.


A hand auger was used to advance the boreholes to different depths noted on the boring logs. Dynamic Cone Penetrometer (DCP) test were performed in the hand auger boreholes by a 1.5 inch diameter cone driven into the soil by a 15 pound ring weight with a free fall of 20 inches. The number of blows required to drive the cone into the soil a distance of 1.75 inches is termed the DCP Value and is indicated for each test on the hand auger.

A total of 4 hand auger/DCP evaluations were performed to a depth of approximately 3 feet below the current footing sub grade elevation. Test results indicated that the materials in place (at the locations and elevations tested) did appear to be suitable to support the design bearing capacity 2,000 psf.

ECS will return upon request to provide additional services.

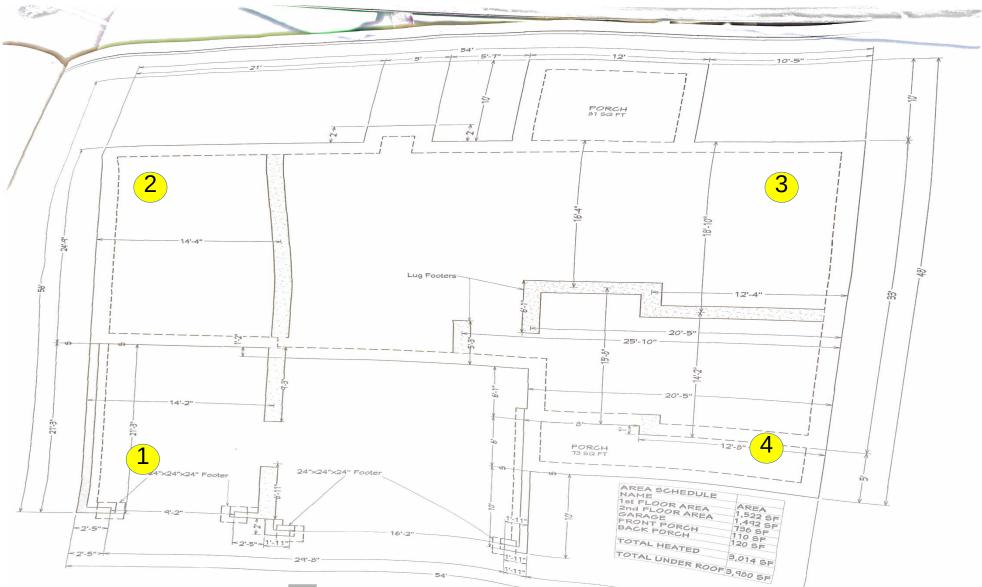

SI Created with ScanWritr. To remove this watermark please use the upgrade options.

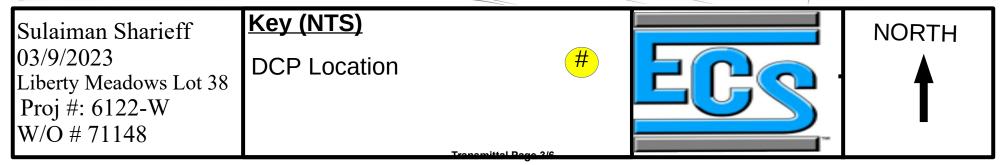

Attachments



IMG_0153[1]





Report of Spread Footing - Foundation Observations

Project: Liberty Meadows Lot 38

Location: 56 Hancock Ct

Cameron - Harnett - NC - 28326 Contractor: Precision Custom Homes

Project No.: 33:6122-W

Day/Date: 3/9/2023

| | | Size (W x H x L) | | Footing Bottom Elevation | | | Decerintian of | Required Blow Counts | Desim |
|-------------------|--------------|------------------|-----|--------------------------------|--|--------------------------------------|--|--|-------|
| Footing Number | Location | | | Description of Steel Placed | Description of Subgrade Material | # of Blows / Increment | Design Bearing Pressure | | |
| | 1 South West | n West x x x x | | | | (0) red sand (-1) brown sand (-2, | 8 | | |
| 1 | | | хх | N/A | 0,-1,-2,-3 | | -3) tan clavey | (0)6-5-5 (-1)8-7-7 (-2)10 -9-7 (-3)18-15-15 | 2000 |
| | | | | | | | (0) red sand (-1) | 6 | 2000 |
| 2 | North West | хх | хх | N/A | 0,-1,-2,-3 | | brown sand (-2, -3) tan clayey sand | (0)5-6-5 (-1)8-9-7 (-2)11 -18-21 (-3)25+ | |
| 3 Nor | North East | st x x x x | | | | | (0) red sand $(-1,$ | | 2000 |
| | | | N/A | 0,-1,-2,-3 | | | (0)6-6-7 (-1)8-8-8 (-2)12 -10-12 (-3)25+ | 2000 | |
| 4 | South East | East x x x x | ~ ~ | N/A | 0,-1,-2,-3 | | (0) red sand (-1) | | 2000 |
| | | | | 0,-1,-2,-0 | | tan clayey sand | (0)6-6-7 (-1)10-11-9 (-2) 11-10-13 (-3)16-16-13 | 2000 | |

** SGE: Subgrade Elevation to be determined by surveyor.

By: Sulaiman Sharieff

NC Registered Firm # F-1078



Report of Spread Footing - Foundation Observations

| Project: | Liberty Meadows Lot 38 |
|-------------|--------------------------------|
| Location: | 56 Hancock Ct |
| | Cameron - Harnett - NC - 28326 |
| Contractor: | Precision Custom Homes |

Project No.: 33:6122-W Day/Date: 3/9/2023

ECS Southeast, LLP

WO: 71148