

Job 72322861REP1	Truss FT2	Truss Type Truss	Qty 4	Ply 1	LGI HOMES\DAVIDSON 2ND FLR OW Job Reference (optional)
---------------------	--------------	---------------------	----------	----------	---

UFP Mid Atlantic LLC, 5631 S. NC 62, Burlington, NC, c/m

Run: 8.62 S Sep 22 2022 Print: 8.620 S Sep 22 2022 MiTek Industries, Inc. Wed Aug 09

Page: 1

ID:YQ0_qb8RxEAO8MVPb0ZJg5yLCZk-ISdqBr9zFxEgrszE9Gxu?Kod5QyJn8CIW4LKoTypeDM

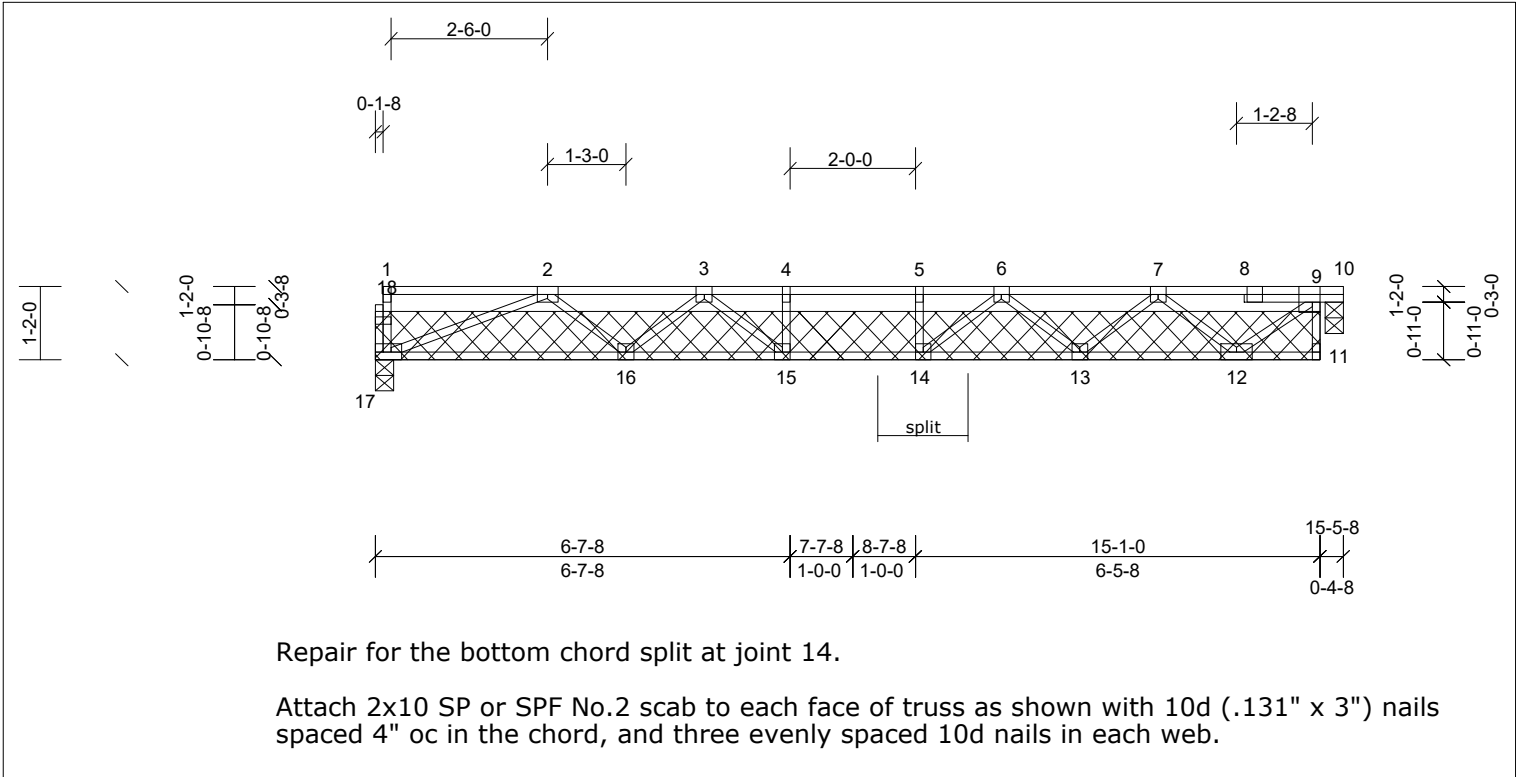


Plate Offsets (X, Y): [9:0-1-8.Edge], [17:0-2-0.Edge]

Loading	(psf)	Spacing	1-7-3	CSI	DEFL	in	(loc)	l/defl	L/d	PLATES	GRIP
TCLL	40.0	Plate Grip DOL	1.00	TC	Vert(LL)	-0.16	14	>999	480	MT20	244/190
TCDL	10.0	Lumber DOL	1.00	BC	Vert(CT)	-0.23	14	>814	360		
BCLL	0.0	Rep Stress Incr	YES	WB	Horz(CT)	0.01	10	n/a	n/a		
BCDL	5.0	Code	IRC2015/TPI2014	Matrix-SH						Weight: 76 lb	FT = 20%F, 11%E

LUMBER	BRACING
TOP CHORD 2x4 SP No.1(flat)	TOP CHORD Structural wood sheathing directly applied or 6-0-0 oc purlins, except end verticals.
BOT CHORD 2x4 SP No.2(flat)	BOT CHORD Rigid ceiling directly applied or 10-0-0 oc bracing.
WEBS 2x4 SP No.3(flat)	
OTHERS 2x4 SP No.3(flat)	
REACTIONS (lb/size) 10=671/0-3-8, (min. 0-1-8), 17=669/0-3-8, (min. 0-1-8)	
FORCES (lb) - Max. Comp./Max. Ten. - All forces 250 (lb) or less except when shown.	
TOP CHORD 2-3=-1849/0, 3-4=-2445/0, 4-5=-2445/0, 5-6=-2445/0, 6-7=-1963/0, 7-8=-857/0, 8-9=-854/0	
BOT CHORD 16-17=0/1445, 15-16=0/2221, 14-15=0/2445, 13-14=0/2271, 12-13=0/1628	
WEBS 6-14=-29/448, 6-13=400/0, 7-13=0/437, 7-12=-1004/0, 9-12=0/1081, 2-17=-1550/0, 2-16=0/526, 3-16=-484/0, 3-15=0/490	

- NOTES (6)**
- Unbalanced floor live loads have been considered for this design.
 - All plates are 3x3 MT20 unless otherwise indicated.
 - This truss is designed in accordance with the 2015 International Residential Code sections R502.11.1 and R802.10.2 and referenced standard ANSI/TPI 1.
 - Recommend 2x6 strongbacks, on edge, spaced at 10-00-00 oc and fastened to each truss with 3-10d (.131" X 3") nails. Strongbacks to be attached to walls at their outer ends or restrained by other means.
 - CAUTION, Do not erect truss backwards.
 - This repair has been prepared based on information and use conditions supplied by client. Designer has made a good faith effort to outline damage and repair conditions as reported by client. When actual field conditions do not approximate those indicated on this drawing, client shall immediately inform the engineer and refrain from applying the repair.



This design is based upon parameters shown, and is for an individual building component to be installed and loaded vertically. Applicability of design parameters and proper incorporation of component is responsibility of the Building Designer. Building Designer shall verify all design information on this sheet for conformance with conditions and requirements of the specific building and governing codes and ordinances. Building Designer accepts responsibility for the correctness or accuracy of the design information as it may relate to a specific building. Certification is valid only when truss is fabricated by a UFPI plant. Bracing shown is for lateral support of truss members only and does not replace erection and permanent bracing. Refer to Building Component Safety Information (BCSI) for general guidance regarding storage, erection and bracing available from SBCA and Truss Plate Institute.

