

Client:

McDonald Lumber Company

Project: Address:

Lot 84 South Creek, Lillington NC


Date: 6/16/2023


Project #:

Input by: Johnnie Baggett Job Name: Lot 84 South Creek J0623-3140

2-Ply - PASSED Kerto-S LVL 1.750" X 9.250" BM₁

Level: Level

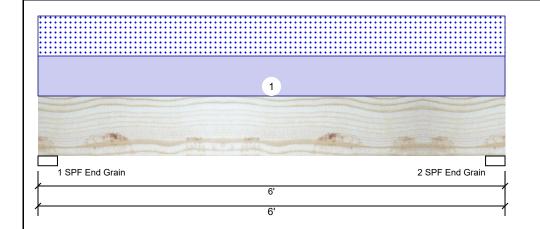

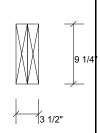

Page 1 of 2

Member Information

| Type: | Girder |
|---------------------|---------------|
| Plies: | 2 |
| Moisture Condition: | Dry |
| Deflection LL: | 480 |
| Deflection TL: | 240 |
| Importance: | Normal - II |
| Temperature: | Temp <= 100°F |

Application: Floor Design Method: ASD **Building Code: IBC/IRC 2015**

Load Sharing: No Deck: Not Checked

Reactions UNPATTERNED Ib (Uplift)

| Brg | Direction | Live | Dead | Snow | Wind | Const |
|-----|-----------|------|------|------|------|-------|
| 1 | Vertical | 0 | 1339 | 1317 | 0 | 0 |
| 2 | Vertical | 0 | 1339 | 1317 | 0 | 0 |

Rearing Length Dir

Analysis Results

| Analysis | Actual | Location | Allowed | Capacity | Comb. | Case |
|--------------|----------------|----------|---------------|-------------|-------|------|
| Moment | 3501 ft-lb | 3' | 14423 ft-lb | 0.243 (24%) | D+S | L |
| Unbraced | 3501 ft-lb | 3' | 10944 ft-lb | 0.320 (32%) | D+S | L |
| Shear | 1757 lb | 1' 1/4" | 7943 lb | 0.221 (22%) | D+S | L |
| LL Defl inch | 0.028 (L/2446) | 3' | 0.141 (L/480) | 0.196 (20%) | S | L |
| TL Defl inch | 0.056 (L/1213) | 3' | 0.281 (L/240) | 0.198 (20%) | D+S | L |

Bearings

| Bearing Length | Dir. | Cap. | React D/L lb | Total | Ld. Case | Ld. Comb. |
|--------------------------------|------|------|--------------|-------|----------|-----------|
| 1 - SPF 3.000" End Grain | Vert | 30% | 1339 / 1317 | 2656 | L | D+S |
| 2 - SPF 3.000" End Grain | Vert | 30% | 1339 / 1317 | 2656 | L | D+S |

Design Notes

- 1 Provide support to prevent lateral movement and rotation at the end bearings. Lateral support may also be required at the interior bearings by the building code.
- 2 Girders are designed to be supported on the bottom edge only.
- 3 Multiple plies must be fastened together as per manufacturer's details.
- 4 Top loads must be supported equally by all plies.
- 5 Top must be laterally braced at end bearings.
- 6 Bottom must be laterally braced at end bearings.
- 7 Lateral slenderness ratio based on single ply width.

ID Load Type Trib Width Side Dead 0.9 Location Live 1 Snow 1.15 Wind 1.6 Const. 1.25 Comments 1 Uniform Top 439 PLF 0 PLF 439 PLF 0 PLF 0 PLF

> Self Weight 7 PLF

Calculated Structured Designs is responsible only of the structural adequacy of this component based on the design criteria and loadings shown. It is the responsibility of the customer and/or the contractor to ensure the component suitability of the intended application, and to verify the dimensions and loads.

- Dry service conditions, unless noted otherwise
 LVL not to be treated with fire retardant or corrosive

Handling & Installation

LVL beams must not be cut or drilled Refer to manufacturer's product information regarding installation requirements, multi-ply fastening details, beam strength values, and code approvals Damaged Beams must not be used

Design assumes top edge is laterally restrained
Provide lateral support at bearing points to avoid
lateral displacement and rotation

6. For flat roofs provide proper drainage to prevent ponding

This design is valid until 11/3/2024

Manufacturer Info

Metsä Wood 301 Merritt 7 Building, 2nd Floor Norwalk, CT 06851 (800) 622-5850 www.metsawood.com/us

Comtech, Inc. 1001 S. Reilly Road, Suite #639 Fayetteville, NC USA 28314 910-864-TRUS







Client:

McDonald Lumber Company

Project: Address:

Lot 84 South Creek, Lillington NC


6/16/2023

Input by: Johnnie Baggett Job Name: Lot 84 South Creek Project #: J0623-3140

Page 2 of 2

Kerto-S LVL 2-Ply - PASSED 1.750" X 11.875" **GDH**

Level: Level

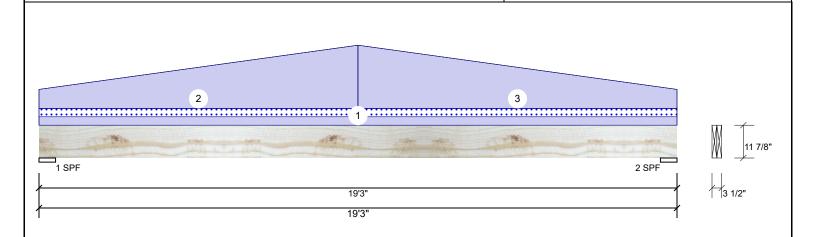

| Member Information | | | | | Reactions UNPATTERNED Ib (Uplift) | | | | | | | | |
|--------------------|---------------|----------------|--------------|-------|-----------------------------------|------|--------|--------------|-------|----------|-----------|--|--|
| Туре: | Girder | Application: | Floor | Brg | Direction | Live | [| Dead : | Snow | Wind | Const | | |
| Plies: | 2 | Design Method: | ASD | 1 | Vertical | 0 | | 1220 | 193 | 0 | 0 | | |
| Moisture Condition | : Dry | Building Code: | IBC/IRC 2015 | 2 | Vertical | 0 | | 1220 | 193 | 0 | 0 | | |
| Deflection LL: | 480 | Load Sharing: | No | | | | | | | | | | |
| Deflection TL: | 240 | Deck: | Not Checked | | | | | | | | | | |
| Importance: | Normal - II | | | | | | | | | | | | |
| Temperature: | Temp <= 100°F | | | | | | | | | | | | |
| | | | | Bear | rings | | | | | | | | |
| | | | | Bea | aring Length | Dir. | Cap. R | React D/L lb | Total | Ld. Case | Ld. Comb. | | |
| | | | | 1 - 3 | SPF 6.000" | Vert | 16% | 1220 / 193 | 1412 | L | D+S | | |
| | | | | 2 - 9 | SPF 6.000" | Vert | 16% | 1220 / 193 | 1412 | L | D+S | | |

Analysis Results

| Analysis | Actual | Location | Allowed | Capacity | Comb. | Case |
|--------------|----------------|-----------|---------------|-----------------|-------|---------|
| Moment | 6155 ft-lb | 9'7 1/2" | 17919 ft-lb | 0.343 (34%) | D | Uniform |
| Unbraced | 6999 ft-lb | 9'7 1/2" | 7003 ft-lb | 0.999 (100%) | D+S | L |
| Shear | 1106 lb | 17'9 1/8" | 7980 lb | 0.139 (14%) | D | Uniform |
| LL Defl inch | 0.055 (L/4020) | 9'7 9/16" | 0.459 (L/480) | 0.119 (12%) | S | L |
| TL Defl inch | 0.448 (L/492) | 9'7 9/16" | 0.919 (L/240) | 0.487 (49%) | D+S | L |

Design Notes

- 1 Provide support to prevent lateral movement and rotation at the end bearings. Lateral support may also be required at the interior bearings by the building code.
- 2 Girders are designed to be supported on the bottom edge only.
- 3 Multiple plies must be fastened together as per manufacturer's details.
- 4 Top loads must be supported equally by all plies.
- 5 Top must be laterally braced at a maximum of 14'2 1/8" o.c.
- 6 Bottom must be laterally braced at end bearings.
- 7 Lateral slenderness ratio based on single ply width.

| | | 9, | | | | | | | | |
|----|---------------|----------|------------|------|----------|--------|-----------|----------|-------------|----------|
| ID | Load Type | Location | Trib Width | Side | Dead 0.9 | Live 1 | Snow 1.15 | Wind 1.6 | Const. 1.25 | Comments |
| 1 | Uniform | | | Тор | 20 PLF | 0 PLF | 20 PLF | 0 PLF | 0 PLF | roof |
| 2 | Tapered Start | 0-0-0 | | Тор | 45 PLF | 0 PLF | 0 PLF | 0 PLF | 0 PLF | gable |
| | End | 9-7-8 | | | 150 PLF | 0 PLF | 0 PLF | 0 PLF | 0 PLF | |
| 3 | Tapered Start | 9-7-8 | | Тор | 150 PLF | 0 PLF | 0 PLF | 0 PLF | 0 PLF | gable |
| | End | 19-3-0 | | | 45 PLF | 0 PLF | 0 PLF | 0 PLF | 0 PLF | |
| | Self Weight | | | | 9 PLF | | | | | |

Notes

Calculated Structured Designs is responsible only of the structural adequacy of this component based on the design criteria and loadings shown. It is the responsibility of the customer and/or the contractor to ensure the component suitability of the intended application, and to verify the dimensions and loads.

- Dry service conditions, unless noted otherwise
 LVL not to be treated with fire retardant or corrosive

Handling & Installation

- LVL beams must not be cut or drilled
 Refer to manufacturer's product information regarding installation requirements, multi-ply fastening details, beam strength values, and code approvals

 2 Damaged Beams must not be used

- Design assumes top edge is laterally restrained
 Provide lateral support at bearing points to avoid
 lateral displacement and rotation
- 6. For flat roofs provide proper drainage to prevent ponding

This design is valid until 11/3/2024

Metsä Wood 301 Merritt 7 Building, 2nd Floor Norwalk, CT 06851 (800) 622-5850 www.metsawood.com/us

Manufacturer Info

Comtech, Inc. 1001 S. Reilly Road, Suite #639 Fayetteville, NC USA 28314 910-864-TRUS



