

Client: WEAVER

Project: Address: Date: 2/6/2024


Input by: LENNY NORRIS Job Name: HIGHLAND


Project #:

GDH 9' FL Kerto-S LVL

1.750" X 11.875" 2-Ply - PASSED

Level: Level

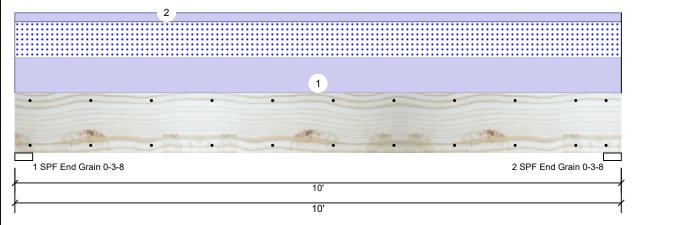

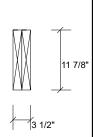

Page 1 of 2

Member Information

rype.	Giraei
Plies:	2
Moisture Condition:	Dry
Deflection LL:	480
Deflection TL:	360
Importance:	Normal

- 11 Temperature: Temp <= 100°F Application: Floor Design Method: ASD **Building Code:** IRC 2018 Load Sharing: No Deck:

Not Checked

Reactions UNPATTERNED Ib (Uplift)

Brg	Direction	Live	Dead	Snow	Wind	Const
1	Vertical	0	1511	1165	0	0
2	Vertical	0	1511	1165	0	0

Bearings

Grain

I	Bearing	Length	Dir.	Cap. F	React D/L lb	Total	Ld. Case	Ld. Comb.
		3.500"	Vert	26%	1511 / 1165	2676	L	D+S
7	End Grain							
	2 - SPF End	3.500"	Vert	26%	1511 / 1165	2676	L	D+S

Analysis Results

Analysis	Actual	Location	Allowed	Capacity	Comb.	Case
Moment	6091 ft-lb	5'	22897 ft-lb	0.266 (27%)	D+S	L
Unbraced	6091 ft-lb	5'	9721 ft-lb	0.627 (63%)	D+S	L
Shear	2000 lb	1'3 3/8"	10197 lb	0.196 (20%)	D+S	L
LL Defl inch	0.052 (L/2209)	5'	0.239 (L/480)	0.217 (22%)	S	L
TL Defl inch	0.119 (L/962)	5'	0.318 (L/360)	0.374 (37%)	D+S	L

Design Notes

- 1 Provide support to prevent lateral movement and rotation at the end bearings. Lateral support may also be required at the interior bearings by the building code.
- 2 Fasten all plies using 2 rows of 10d Box nails (.128x3") at 12" o.c. Maximum end distance not to exceed 6".
- 3 Refer to last page of calculations for fasteners required for specified loads.
- 4 Girders are designed to be supported on the bottom edge only.
- 5 Top loads must be supported equally by all plies.
- 6 Top must be laterally braced at end bearings.
- 7 Bottom must be laterally braced at end bearings.
- 8 Lateral slenderness ratio based on single ply width.

ID	Load Type	Location	Trib Width	Side	Dead 0.9	Live 1	Snow 1.15	Wind 1.6	Const. 1.25	Comments
1	Uniform			Тор	233 PLF	0 PLF	233 PLF	0 PLF	0 PLF	D1 TRUSS
2	Uniform			Тор	60 PLF	0 PLF	0 PLF	0 PLF	0 PLF	DEAD WALL
	Self Weight				9 PLF					

Notes


Calculated Structured Designs is responsible only of the structural adequacy of this component based on the design criteria and loadings shown, It is the responsibility of the customer and/or the contractor to ensure the component suitability of the intended application, and to verify the dimensions and loads.

- Dry service conditions, unless noted otherwise
 LVL not to be treated with fire retardant or corrosive
- Handling & Installation
- LVL beams must not be cut or drilled
 Refer to manufacturer's product information regarding installation requirements, multi-ply fastening details, beam strength values, and code approvals
 Damaged Beams must not be used.
- Design assumes top edge is laterally restrained
 Provide lateral support at bearing points to avoid
 lateral displacement and rotation
- 6. For flat roofs provide proper drainage to prevent ponding

This design is valid until 5/29/2026

Manufacturer Info Metsä Wood 301 Merritt 7 Building, 2nd Floor Norwalk, CT 06851 (800) 622-5850 www.metsawood.com/us

Client: WEAVER Date: 2/6/2024 Page 2 of 2 Project: Input by: LENNY NORRIS isDesign Address: Job Name: HIGHLAND Project #: 1.750" X 11.875" 2-Ply - PASSED Level: Level GDH 9' FL **Kerto-S LVL**

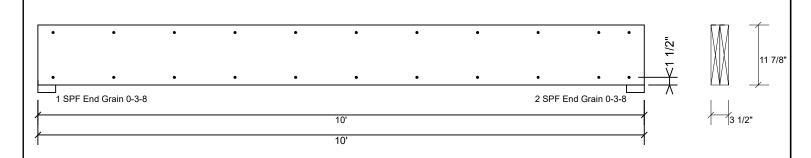

Multi-Ply Analysis

Fasten all plies using 2 rows of 10d Box nails (.128x3") at 12" o.c.. Maximum end distance not to exceed 6".

rasterrain pries asing 2	TOWS OF TOU BOX Halls (TEONS) at
Capacity	0.0 %
Load	0.0 PLF
Yield Limit per Foot	163.7 PLF
Yield Limit per Fastener	81.9 lb.
CM	1
Yield Mode	IV
Edge Distance	1 1/2"
Min. End Distance	3"
Load Combination	
Duration Factor	1.00

Notes

Calculated Structured Designs is responsible only of the structural adequacy of this component based on the design criteria and loadings shown. It is the responsibility of the customer and/or the contractor to ensure the component suitability of the intended application, and to verify the dimensions and loads.

Dry service conditions, unless noted otherwise
 LVL not to be treated with fire retardant or corrosive

Handling & Installation

Handling & Installation

1. IVI beams must not be cut or drilled

2. Refer to manufacturer's product information regarding installation requirements, multi-ply fastening details, beam strength values, and code approvals

3. Damaged Beams must not be used

4. Design assumes top edge is laterally restrained

5. Provide lateral support at bearing points to avoid lateral displacement and rotation

For flat roofs provide proper drainage to prevent ponding

This design is valid until 5/29/2026

Manufacturer Info

Metsä Wood 301 Merritt 7 Building, 2nd Floor Norwalk, CT 06851 (800) 622-5850 www.metsawood.com/us