		LHD Reference:					
PART 3:	Authorization to Opera	te (ATO)					
	Except for date rec	ceived, the Section below	is to be completed	by the Owner.			
LHD USE ONLY	: Initial submittal of request	for ATO received:		by			
	Date of Post-construction		Date	Initials			
†							
A. O'Bried and	tems are included in this su d sealed copy of the AOWE'	ibmittal for an Autho 's report that include	rization to Ope s the information	rate under an AOV on in	√E permit:		
G.S. 130A-	336.2(k)				Yes	∃ No	
 Operation Fee (as an 	and management program	I			₩Yes [No	
(as ab					Yes	No	
4. NOLANZEU	letter documenting Owner'	s acceptance of the s	system from the	e AOWE	☐ Yes [᠘	₹No	
5. On-site Wa	istewater Contractor name	: DAVIA BRANTUE	er & sons	License numbe	ar. 4608		
Mailing ad	astewater Contractor name dress: 37 Pine Pidge number: 919 673 2	Pd (City: Zebyla	State:	7in: 271		
Telephone	number: <u>919</u> 673 2	160 E-mail Add	ress: حمر	Dran Hames	Zip. <u>22</u>		
b. Proof of Er	rors and Omissions or othe nd includes the name of the	r appropriate liability	/ insurance for t	the On cita Macta	Hohor Cambre	tor Is	
Attestation by	the Owner for Authorizatio	on to Operate					
I, Keulli	Shortedge me of Owner	_hereby attest that:	all items indicat	ed above have be	en provided to	the	
1-tanett							
	es, and ordinances.	the system shall mee	et applicable fe	deral, State, and lo	cal laws,		
	25, and ordinances.		n 1	,			
ete	500		4/25/	(2025			
	Signature of Owner		Date				
		This section for LHD U	ise Only.				
LHD Review of	required information for th	ie ATO					
☐ INCOMPLE	Γ¢						
		nd in the Coeffee etc.		. .			
information red	iew of information submitt uired for an Authorization	to Operato for an AC	ive, the followin	ng items are missin	g from the		
	anda for all Mathorization	to Oberate for all AO	we permit:				
Copies of this si	gned form were sent to the	AOME and the O					
- 4 p . 20 01 c . 115 51	Price totti Mete zent to tile	: AOWE and the Own		via	 .		
			Date	Email, FAX, USP.	S, Hand-delivered		
Print name of aut	horized Agent of the LHD	Signature of auti	norized Agent of the	≥ LHD			
COMPLETE							
Based upon revi in accordance w	iew of information submitte rith G.S. 130A-336.2(m).	ed in the Section abo	ve, this Author	ization to Operate	is hereby issue	ed	
A copy of this co	omplete NOI/ATO with trac	king information was	sant to the Ste	to on			
		gorrination was	Jone to the Sta		l FAX, USPS, Hand-deli	 ivered	
Print name of aut	horized Agent of the LHD				,, rana den		
rmirmine of auti	ionzea Agent of the LHD	Signature of auth	orized Agent of the	: LHD	Date	_	

ISSUANCE OF CERTIFICATE OF OCCUPANCY: Once the LHD determines completeness based upon the ATO submission, the owner may apply to the local permitting agency for permanent electrical service to a residence, place of business or place of public assembly pursuant to G.S. 130A-339.

Date

ACORD"	

CERTIFICATE OF LIABILITY INSURANCE

DATE (MM/DD/YYYY)

THIS CERTIFICATE IS ISSUED AS A MATTER OF INFORMATION ONLY AND CONFERS NO RIGHTS UPON THE CERTIFICATE HOLDER, THIS 8/29/2025 CERTIFICATE DOES NOT AFFIRMATIVELY OR NEGATIVELY AMEND, EXTEND OR ALTER THE COVERAGE AFFORDED BY THE POLICIES BELOW. THIS CERTIFICATE OF INSURANCE DOES NOT CONSTITUTE A CONTRACT BETWEEN THE ISSUING INSURER(S), AUTHORIZED REPRESENTATIVE OR PRODUCER, AND THE CERTIFICATE HOLDER. IMPORTANT: If the certificate holder is an ADDITIONAL INSURED, the policy(les) must have ADDITIONAL INSURED provisions or be endorsed. If SUBROGATION IS WAIVED, subject to the terms and conditions of the policy, certain policies may require an endorsement. A statement on this certificate does not confer rights to the certificate holder in lieu of such endorsement(s). PRODUCER CONTACT NAME: Certificate Administrator SIA Group, Inc. PHONE (A/C, No, Ext): 910-455-7576 E-MAIL 827 Gum Branch Road FAX (A/C, No); 910-455-7481 Jacksonville NC 28540 ADDRESS: certs@siagroup.com INSURER(S) AFFORDING COVERAGE NAIC# insurer a: Owners Insurance Company 32700 INSURED DAVIBRA-02 INSURER B : Auto-Owners Insurance Company David Brantley & Sons, Inc. 18988 37 Pine Ridge Road INSURER c : FFVA Mutual Insurance Co. 10385 Zebulon NC 27597 INSURER D : INSURER E INSURER F: COVERAGES CERTIFICATE NUMBER: 1213285082 **REVISION NUMBER:** THIS IS TO CERTIFY THAT THE POLICIES OF INSURANCE LISTED BELOW HAVE BEEN ISSUED TO THE INSURED NAMED ABOVE FOR THE POLICY PERIOD INDICATED. NOTWITHSTANDING ANY REQUIREMENT, TERM OR CONDITION OF ANY CONTRACT OR OTHER DOCUMENT WITH RESPECT TO WHICH THIS CERTIFICATE MAY BE ISSUED OR MAY PERTAIN, THE INSURANCE AFFORDED BY THE POLICIES DESCRIBED HEREIN IS SUBJECT TO ALL THE TERMS, EXCLUSIONS AND CONDITIONS OF SUCH POLICIES. LIMITS SHOWN MAY HAVE BEEN REDUCED BY PAID CLAIMS. ADDL SUBR POLICY EFF POLICY EXP
(MM/DD/YYYY) (MM/DD/YYYY) TYPE OF INSURANCE POLICY NUMBER LIMITS Х COMMERCIAL GENERAL LIABILITY Α 35506165 7/2/2025 7/2/2026 EACH OCCURRENCE \$1,000,000 CLAIMS-MADE X OCCUR DAMAGE TO RENTED PREMISES (Ea occurrence) \$300,000 MED EXP (Any one person) \$ 10,000 PERSONAL & ADV INJURY \$ 1,000,000 GEN'L AGGREGATE LIMIT APPLIES PER: GENERAL AGGREGATE \$2,000,000 POLICY X PRO-LOC PRODUCTS - COMP/OP AGG \$2,000,000 OTHER: AUTOMOBILE LIABILITY COMBINED SINGLE LIMIT (Ea accident) 5391466100 7/2/2025 7/2/2026 \$1,000,000 X ANY AUTO BODILY INJURY (Per person) OWNED AUTOS ONLY HIRED AUTOS ONLY SCHEDULED AUTOS NON-OWNED AUTOS ONLY BODILY INJURY (Per accident) 3 Х Χ PROPERTY DAMAGE (Per accident) \$ X UMBRELLA LIAB X OCCUR 5391466101 7/2/2025 7/2/2026 EACH OCCURRENCE \$3,000,000 **EXCESS LIAB** CLAIMS-MADE AGGREGATE \$3,000,000 DED X RETENTION \$ 10,000 WORKERS COMPENSATION AND EMPLOYERS' LIABILITY С WC850-0050098-2025A 7/2/2025 7/2/2026 X PER STATUTE ANYPROPRIETOR/PARTNER/EXECUTIVE OFFICER/MEMBER EXCLUDED? (Mandatory in NH) NIA E.L. EACH ACCIDENT \$1,000,000 If yes, describe under DESCRIPTION OF OPERATIONS below E.L. DISEASE - EA EMPLOYEE \$1,000,000 E.L. DISEASE - POLICY LIMIT \$1,000,000 A Contractors Equipment 35506165 7/2/2025 7/2/2026 Leased/Rented \$50,000 DESCRIPTION OF OPERATIONS / LOCATIONS / VEHICLES (ACORD 101, Additional Remarks Schedule, may be attached if more space is required) CERTIFICATE HOLDER CANCELLATION SHOULD ANY OF THE ABOVE DESCRIBED POLICIES BE CANCELLED BEFORE THE EXPIRATION DATE THEREOF, NOTICE WILL BE DELIVERED IN ACCORDANCE WITH THE POLICY PROVISIONS. Southeastern Soil & Environmental Assoc., Inc. PO Box 9321 AUTHORIZED REPRESENTATIVE Favetteville NC 28311

© 1988-2015 ACORD CORPORATION. All rights reserved.

ACORD 25 (2016/03)

The ACORD name and logo are registered marks of ACORD

while

Understanding and Protecting Your Septic System

If you currently discharge wastewater to a septic system, if you are looking to purchase a place of residence, public assembly, or business, or to move to a place that is served by a septic system, this guidance document should be helpful. Contact your local health department for additional assistance and information.

Know Your Septic System

Not all septic systems are the same. It is important to know about your septic system, such as the components that make up the system and their location on the property, the system functioning and maintenance history, as well as what to do and what not to do. Traditional conventional septic systems have a septic tank and a drainfield with gravel-filled trenches or a gravel bed. Newer septic systems may have polypropylene or polyethylene "chambers" or polystyrene aggregate in place of the gravel.



Some systems use advanced technologies that require a higher level of maintenance than traditional conventional septic systems, and state rules have specific maintenance requirements for these systems. Sometimes owners will be required by state rules to hire a state-certified operator to regularly inspect and maintain the system. In addition, state rules require the local health department to inspect these systems on a periodic basis.

Some properties are legally required to have a "repair area or replacement area" in which a second drainfield could be installed if needed. This repair area should have been identified typically by the health department when the site was permitted and should be shown on your septic system permit ("Improvement Permit"). State rules also require you to protect this area from any soil disturbance activities such as excavation; building a house addition, garage, or other structure; swimming pool construction and installation; and grading.

If you are not sure what type of wastewater system you have, contact the local health department to request a copy of the septic system permit and soil evaluation sheet for your property. These forms should indicate the approved design daily flow, type of system, size of each of the system components (septic tank, any other tanks or pretreatment units, the drainfield, and the repair area), and approximate locations of those components. Also, ask the previous owner or the seller for information about the system (e.g., installations, repairs, maintenance).

Ask Questions

Ensure you have answers to the following questions:

- · What type of septic system do you have?
- How old is the system (i.e., when were the system components installed)?
- Where are all the system components located, including the drainfield and repair area? (Note: They may not be at the same location or even on the same lot.)
- How many gallons a day (e.g., number of bedrooms, occupants, seats in the restaurant) is the septic system designed to treat and dispose of?
- What is the volumetric (liquid) capacity of each tank in the septic system?
- Which drainfield option or product was used for your system?
- Is the septic system working properly?
- Does the system require a certified operator?
- What are the legal requirements for long-term maintenance?
- · Has the septic system been maintained in the past?

"Keep this information for future reference to help you properly maintain your septic system" "Let your Health Department know the problem"

Signs of Possible Septic System Failure

- Sewage backing up into your toilets, tubs, or sinks.
- Sewage backing up in the septic and/or pump tank
- Slowly draining plumbing fixtures, particularly during and after it has rained.
- The smell of raw sewage accompanied by soggy soil or sewage discharged over the ground or in nearby ditches or woods.
- Sewage comes to the ground surface when the pump turns on and then disappears after the pump turns off,
- An alarm flashing (red light) and/or blaring horn coming from the pump control panel.

Understanding and Protecting Your Septic System

DOs and DON'Ts



D0

- Do learn the location of the septic tank, drainfield and repair area. Keep a sketch of the system location and layout with your maintenance record for service visits.
- Do keep your septic tank cover accessible for inspections and pumping,
- Do keep suitable vegetation growing over the drainfield and repair area to stabilize the soil and prevent erosion.
- Do have a maintenance plan for your system.
- Do have your septic system inspected in accordance with state regulations.
- Do make sure you have an effluent filter installed on your septic tank to prevent solids from reaching the drainfield and to increase the life of your system.
- Do have solids pumped out of the septic tank by a State-permitted pumper every 3 to 5 years (typical primary residence) or as required per the permit. Do make sure both compartments of the septic tank are pumped out. If the septic system includes a pump tank have it pumped out too.
- Do periodically check to ensure the septic system, pumps and electrical components, continue working properly between scheduled maintenance visits.
- Do call the local health department or an onsite
 wastewater contractor certified by the North Carolina
 Onsite Wastewater Contractor Inspector Certification
 Board (NCOWCICB) whenever you experience problems
 with your system, or if there are any signs of system failure.
- Do keep a detailed record of installations, repairs, and tank pump outs.
- Do hire a state-certified subsurface system operator when required by the septic system permit.

DON'T

- Don't ignore problems with your septic system hoping they will just go away.
- Don't enter the septic tank.
- Don't wait until the tank overflows, the drainfield fails, or the system backs up to have the tank pumped.
- Don't expand the size of the place of residence, business, or public assembly without obtaining prior written approval to adjust the size of the septic system accordingly.
- Don't make or allow repairs to your septic system without obtaining required permits from the local health department.
- Don't direct downspouts, water softeners, sump pumps, water features, swimming pool, hot tubs, HVAC condensate drains or similar discharges into the septic system or toward the drainfield,
- Don't install sprinkler systems or wells in the septic system and repair areas.
- Don't perform construction of any type over the septic system and repair areas (e.g., decks, patios, sheds).
- Don't cover the septic tank, d-box, or drainfield with structures (e.g., planters, firepits, grills) or hardened surfaces (e.g., asphalt, concrete, stone, brick).
- Don't drive or park vehicles over the septic system.
- Don't put cigarette butts, paper towels, disposable wipes, sanitary napkins/tampons, condoms, cotton swabs, kitty litter, coffee grounds, disposable diapers, plastics or other non-biodegradables into the septic system.
- Don't pour grease or cooking oil down the drain or foul up the septic system with harmful chemicals (e.g., solvents, paint, medications, disinfectants, pesticides) and other hazardous substances.
- · Don't install garbage grinders at sinks.

State-Certified Septic System Installers and Inspectors

Contact the North Carolina Onsite Wastewater Contractor Inspector Certification Board (NCOWCICB)

Phone: (336) 202-3126 • Website: https://ncowcicb.info

State-Certified Subsurface System Operators

Contact the North Carolina Water Pollution Control System Certification Commission (WPCSOCC)
Phone: (919) 707-9089 • Website: https://deg.nc.gov/about/divisions/water-resources/operator-certification





NC Department of Health and Human Services • Division of Public Health • On-Site Water Protection • https://ehs.nc.publichealth.com/oswp • HCDHHS is an equal opportunity employer and provider. • 9/2020



North Carolina Onsite Wastewater Contractor Inspector Certification Board Authorized Onsite Wastewater Evaluator Permit Option for Non-Engineered Systems Notice of Intent (NOI) to Construct

V New Expansion Repair Relocation Relocation of Repair Area
Owner or Legal Representative Information:
Name: JSJ Builders, Inc.
Mailing address: 1135 Robeson St. City: Fayetteville State: NC Zip: 28305
Dhone, 040, 400, 0700
Authorized Onsite Wastewater Evaluator Information: Name: Mike Eaker Certification #: 10013E Mailing address: PO Box 9321 City: Fayetteville State: NC Zip: 28311 Phone: 910-822-4540 Email: Mike@southeasternsoil.com
Authorized Onsite Wastewater Evaluator Information:
Name: Mike Eaker Certification #: 10013E Certification Number Number
Mailing address: PO Box 9321 City: Fayetteville State: NC Zip: 28311
Phone: 910-822-4540 Email: Mike@southeasternsoil.com
Site Location Information:
Site address: 388 Black Duck Lane, Lillington, NC 27546
Tax parcel identification number or subdivision lot, block number of property: 0527-51-6340.000
Ducks Landing, Lot 80 County: Harnett
System Information: Wastewater System Type: Accepted (25% reduction) Daily Design Flow: 360 gpd Saprolite System: Yes No Subsurface Operator Required: Yes No Water Supply Type: Private Well Public Water Supply Spring Other: Facility Type: Residential 3 # Bedrooms 6 Maximum # of Occupants Business Type of Business and Basis for Flow: Public Assembly Type of Public Assembly and Basis for Flow: Required Attachments:
Plat or Site Plan Evaluation of Soil and Site Features by Licensed Soil Scientist
Attest: On this the 18 day of June , 2025 by signature below I hereby attest that the information required to be included with this NOI to Construct is accurate and complete to the best of my knowledge. Furthermore, I hereby attest that I have adhered to the laws and rules governing onsite wastewater systems in the state of North Carolina. This NOI shall expire on 18 day of June , 2030 Signature of Authorized Onsite Wastewater Evaluator:
Signature of Owner or Legal Representative:
Disclosure: The owner may apply for a building permit for the project upon submitting a complete NOI to Construct and the fee required (if any) to the local health department. An onsite wastewater system authorized by an authorized onsite wastewater evaluator shall be transferable to a new owner with the consent of the authorized onsite wastewater evaluator.
Local Health Department Receipt Acknowledgement: Signature of Local Health Department Representative: Date:

Southeastern Soil & Environmental Associates, Inc.

P.O. Box 9321 Fayetteville, NC 28311 Phone/Fax (910) 822-4540 Email mike@southeasternsoil.com

June 18, 2025

Mr. Kevin Shortridge JSJ Builders, Inc. 1135 Robeson St. Fayetteville, NC 28305

Re: Soil/site evaluation for subsurface waste disposal (GS 130A-336.2) AOWE, Ducks Landing, Lot 80, PIN 0527-51-6340.000, 388 Black Duck Lane, Lillington, Harnett County, North Carolina

Dear Mr. Shortridge,

A soil/site evaluation has been conducted on the aforementioned property at your request. The purpose of the investigation was to determine if soils were suitable or provisionally suitable for a subsurface waste disposal system (conventional, accepted and innovative) to serve a proposed single-family residence (3-bedroom home). All ratings and determinations were made in accordance with "Onsite Wastewater Rules, 15A NCAC 18E". This LSS evaluation is being submitted to meet the requirements of GS 130A-336.2 (AOWE).

The soil evaluation was completed on June 16, 2025. Hand auger borings were advanced under moist soil conditions. The site essentially lies on a linear slope landscape (4 - 6% slope). Soil borings conducted in most of this area consisted of 12 or more inches of loamy sand underlain by sandy loam, sandy clay loam, clay and/or sandy clay to 48 or more inches below the soil surface. Soil wetness and/or parent material (greater than 50%) was not observed shallower than 48 inches below the soil surface (initial system) and 48 inches (repair system). All other soil characteristics were suitable to at least 48 inches.

Based on soil borings and site conditions, the site would be designated suitable for a shallow accepted subsurface waste disposal drainfield (0.30 gal/day/ft2 LTAR; initial system). There is enough suitable soil area to allow for a shallow accepted subsurface septic system repair (0.30 gal/day/ft2). A map showing the approximate location of the site and proposed septic layout accompanies this report. [Note: No grading, rutting or other soil disturbance can occur in or near the proposed septic area. Any grading can alter the findings of this report and render the site unusable. As such, we recommend the builder protect the proposed septic areas with rope, flagging, fencing, etc.]

Design Summary

- Accepted product (300', see septic layout)
- 360 gal/day flow rate (3BR)
- 24" maximum trench depth
- 0.30 gpd/ft2 LTAR (initial and repair)
- 1000-gallon septic tank (certified watertight)
- No grading, rutting or filling in septic areas
- No vertical cuts (greater than 2') within 15' of septic lines/areas
- Keep tanks and drainlines 10' from property lines
- Keep supply line 5 or more feet from property lines
- Install in dry soil conditions
- Maintain natural contours when clearing the lots
- Direct gutter water away from septic system
- AOWE must preapprove Licensed installer
- Preconstruction conference required 2 weeks prior to installation of septic
- Contractor to provide 2 weeks' notice prior to installation

During site construction, it is important not to impact and suitable or provisionally suitable soil areas with activities such as excavation or filling. Only the vegetation should be removed in the areas of the proposed septic drainfields to prevent any disturbance of naturally occurring soil. We recommend all lot clearing activity be delayed until the local health department issues a permit.

To the extent possible, we have identified the soil types that will impact the flow of wastewater on this site and have provided a professional opinion as to the best septic system layout. This report does not guarantee that the proposed septic system will properly function for any specific length of time.

Sincerely,

Mike Eaker


NC Licensed Soil Scientist # 1030

NC Authorized Wastewater Evaluator 10013E

SOUTHEASTERN SOIL & ENVIRONMENTAL ASSOC., INC.

PROPOSED SUBSURFACE WASTE DISPOSAL SYSTEM DETAIL SHEET

•	SUBDI	VISION: D	ucks Landing	····	LOT 80
	INITIA	SYSTEM:	Accepted 25% Reduction		REPAIR: Accepted 25% Reduction
	DISTRI	BUTION: G	ravity Serial	··- <u></u>	DISTRIBUTION Gravity Serial
	BENCH	MARK:	100.0		LOCATION FC 79/80
	NO. BE	DROOMS:	3		LTAR 0.30 gpd/ft2
	SEPTIC	TANK SIZE	1000 Gallons		PUMP TANK SIZE N/A
	LINE	FLA	G COLOR	ELEVATION	LENGTH
	1	F	₹	96.90	60'
fmild ml	2	Y		96.40	60'
Initial	3	<u>F</u>	}	95.70	60'
	4	<u> </u>	/	95.80	60'
	5	F		95.20	60
					TOTAL 300'
Donois	6	Y		94,80	60'
Repair	7	F		94.10	60'
	8	Y	7	93.50	60'
	9	F	<u> </u>	92.80	60'
	10_	Y		92.00	60
					TOTAL 300'
	BA Wi	ke Eaker			DATE 6/16/25
	TYPICA	L PROFILE			THERE SHALL BE NO GRADING,
	0-12	LS/SL	VFr/Fr/Gr		CUTTING, LOGGING OR OTHER SOIL
Initial	12-48	C/SC	Fi/SBk		DISTURBANCE IN SEPTIC AREA
	CR2	>48"			HEALTH DEPARTMENT USE ONLY.
	0-12	LS/SL	VFr/Fr/Gr		DESIGNS DO NOT GURANTEE FUNCTIONALITY
Repair	12-48 CR2	SC/C >48"	Fi/SBk		Certification Till
					ALUATOR MILLIAM

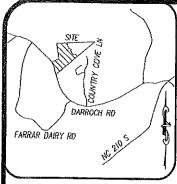

VICINITY MAP (NTS)

LEGEND:

LEGEND:

EP - EXISTING IRON PIPE
EIB - EXISTING IRON PIPE
EIB - EXISTING IRON PIPE
EIB - EENT IRON PIPE
EIB - BENT IRON PIPE
EIB - BENT IRON BAR
CM - CONCRETE MONUMENT
MIP - NEW IRON PIPE SET
CATV - CABLE TV BOX
EE - ELECTRIC BOX
TEL - TELECHONE PEDESTAL
PP - POWER POLE
OHL - OVERHEAD LINE
LP - LIGHT POLE
WM - WATER METER
WM - WOW OF FORMERLY
CO - PORCH
N/F - NOW OR FORMERLY
CVRD - COVERED
EB - CATCH BASIN
EOP - EDGE OF PAVEMENT
BOC - BACK OF CURB

1. ALL DISTANCES ARE HORIZONTAL GROUND DISTANCES IN U.S. SURVEY FEET UNLESS OTHERWISE NOTED.

2. AREAS SHOWN HEREON WERE COMPUTED USING THE COORDINATE METHOD.

3. LINES NOT SURVEYED ARE SHOWN AS DASHED LINES $\mathbb{P} \ \mathbb{R} \ \mathbb{E} \ \mathbb{L} \ \mathbb{I} \ \mathbb{M} \ \mathbb{I}$ FROM INFORMATION REFERENCED ON THE FACE OF THIS PLAT, NICHOLAS M. FRENCH, PLS L-4817

4. PROPERTY MAY BE SUBJECT TO ANY/ALL EASEMENTS AND RESTRICTIONS OF RECORD. THIS SURVEY IS A CORRECT REPRESENTATION OF THE LAND PLATTED AND OR DEEDED AND HAS BEEN PREPARED WITHOUT THE BENEFIT OF A TITLE REPORT. A NORTH CAROLINA LICENSED ATTORNEY—AT—LAW SHOULD BE CONSULTED REGARDING CORRECT OWNERSHIP, WIDTH AND LOCATION OF EASEMENTS, AND OTHER TITLE QUESTIONS REFORATED BY THE FXAMINATION REVEALED BY TITLE EXAMINATION.

5.THIS PARCEL IS NOT LOCATED WITHIN A FLOOD HAZARD ZONE AS INDICATED ON CID NO. 370328 PANEL 0526, SUFFIX J. HARNETT COUNTY WITH AN EFFECTIVE DATE OF

CERTIFICATE OF ACCURACY & MAPPING
I NICHOLAS M. FRENCH PLS CERTIFY THAT THIS MAP WAS
DRAWN UNDER MY SUPERVISION FROM AN ACTUAL FIELD
SURVEY BONE UNDER MY SUPERVISION, AND THAT THE
ERROR OF CLOSURE AS COMPUTED BY CO-ORDINATES IS LESS THAN 1:10,000.

PREL IMINARY DATE

THIS MAP IS ONLY INTENDED FOR THE PARTIES AND PURPOSES SHOWN, THIS MAP IS NOT FOR RECORDATION, NO TITLE REPORT PROVIDED. ANY VISIBLE ENCROACHMENTS ARE SHOWN HEREON.

THIS MAP MAY NOT BE A CERTIFIED SURVEY AND HAS NOT BEEN REVIEWED BY LOCAL GOVERNMENT AGENCY FOR COMPLIANCE WITH ANY APPLICABLE LAND DEVELOPMENT REGULATIONS AND HAS NOT BEEN REVIEWED FOR COMPLIANCE WITH RECORDING REQUIREMENTS FOR PLATS.

LINES 1-5

10/03/2025.	WITH RECORDING REQUIREMENTS FOR PLATS.
IMPERVIOUS SURFACE TABLE	SETBACKS: P.B. 2025, PG. 268 FRONT 35' SIDE 10' REAR 25' SIDE SIREET 20' ARRING I'' E OPEN
HOUSE 2,078 S.F.	FRONT 35'
DRIVEWAY 888 S.F.	SIDE 10' SESSIONESSION
PATIO 64 S.F. SIDEWALKS 69 S.F.	REAR 25
TOTAL IMPERVIOUS AREA 4,061 S.F.	SIDE STREET 20 E SEAL F. E
TOTAL THE ENTITION AND THE TABLE SA.	= ·r L-4817 œ· =
CURVE RADIUS ARC LENGTH CHORD LENGTH CHORD BE	= '7, 3' =
CURVE RADIUS ARC LENGTH CHORD LENGTH CHORD BE C1 260.00' 55.20' 55.10' \$ 27'30'18	ARING CUDYE X
LINE BEARING DISTANCE	
L1 S 33'35'14" E 24.75'	MAS M. FRANK
FUTURE	OPEN
PHASE 2	SPACE
82.4	3'
5 28'37'42" E 02."	
/	
	NOTED FROM P.D. 2025, PC. 265
	HOW P.B. 200
	Pic 250
i \(80)	
20,080 sq.ft	
0146246	
U.407 R	
	₹
(2)	68'34'38"
CO	12
	r r
	<u>ω</u>
73	1
in the second	ļσ
N	<u> </u>
	<u> </u>
(79)	(81)
21	
Ш	1 00
[n]	7.48.05
[5] 715 [18] and 8 [18]	IN ITIME SEPTIL
Q1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	

PARO B

PO


17.2 ْ

67

 \overline{z}

10' EASEMENT

REQUEST 07-14-2025 REMISION: HOUSE UPDATED

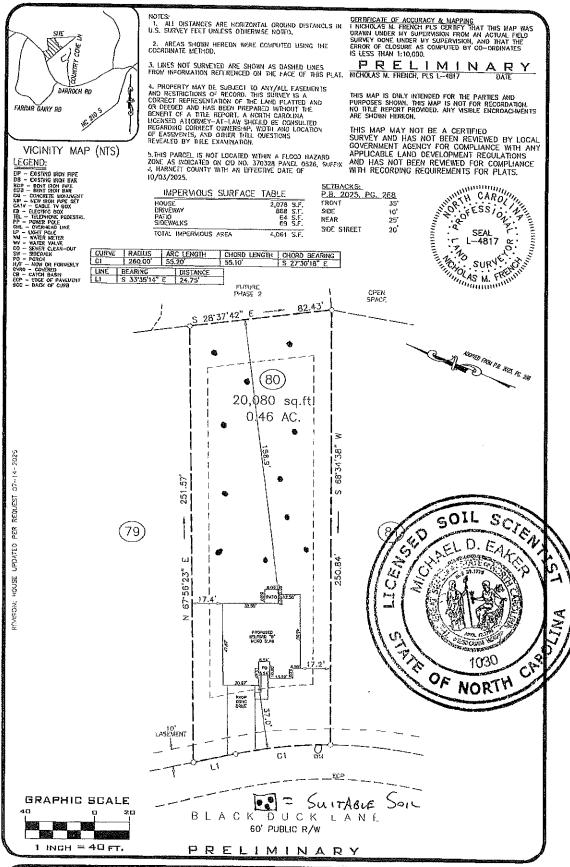



PLOT PLAN FOR

HUR

JSJ BUILDERS

BLACK DUCK LANE

LOT 80 DUCKS LANDING SUBDIVISION
ANDERSON GREEK TWP., HARNETT CO., NO
P.G. 2025, P.G. 269



	Page <u>1</u> of <u>2</u>
PROPERTY ID #.	Ducks Landing Lot 89
COUNTY:	Hamett

SOIL/SITE EVALUATION for ON-SITE WASTEWATER SYSTEM

(Complete all fields in full) OWNER: JSJ Builders, Inc. DATE EVALUATED: 6/16/25 ADDRESS: 1135 Robeson St., Fayetteville, NC 28305 PROPOSED FACILITY: SFD PROPOSED DESIGN FLOW (.0400): 360 GPD PROPERTY SIZE: 0.46 ac LOCATION OF SITE: 388 Black Duck Lane, Lillington, NC 27546 PROPERTY RECORDED: WATER SUPPLY: ☑ Public ☐ Single Family Well ☐ Shared Well ☐ Spring ☐ Other WATER SUPPLY SETBACK: N/A: No Sett EVALUATION METHOD: Auger Boring Pit Cut TYPE OF WASTEWATER: Domestic High Strength IPWW R SOIL MORPHOLOGY OTHER PROFILE FACTORS 0 \mathbf{F} I L .0502 .0504 .0509 .0502(d) LANDSCAPE HORIZON .0503 .0503 SOIL .0505 .0506 .0507 PROFILE SLOPÉ POSITION/ STRUCTURE/ DEPTH CONSISTENCE/ WETNESS/ # SOIL SAPRO RESTR CLASS CORRE SLOPE % (IN) TEXTURE MINERALOGY COLOR DEPTH CLASS HORIZ & LTAR* CTION 0-3 LS/GR >48" VFR/NEXP LS 4-6% NA NA NA Suitable 10YR 5/4 3-17 LS/GR VFR/NEXP 0.30 1 7.5YR 5/8 17-36 C/MM SBK FI/SEXP 7.5YR 5/8 2.5YR 4/8 mott 36-48 C/CL/WF SBK FR/SEXP 0-3 LS/GR >48° VFR/NEXP LS 4-6% NA NA NA Suitable 10YR 5/4 3-12 LS/GR VFR/NEXP 0.30 2 7.5YR 5/8 12-48 C/MM SBK FI/SEXP LS/GR >48° 0-6 VFR/NEXP LS 4-6% NA NA NA Suitable 10YR 7/3 6-27 LS/GR VFR/NEXP 0.30 3 10YR 5/8 27-40 C/MM SBK FI/SEXP 10YR 5/8 2.5YR 4/8 mott 40-48 C/CL/WF SBK FI/SEXP 0-6LS/GR VFR/NEXP >48" LS 4-6% NA NA NA Suitable 10YR 6/4 6-16 LS/GR VFR/NEXP 0.30 4 7.5YR 5/8 16-48 C/MM SBK FI/SEXP

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM	
Available Space (.0508)	YES	YES	SITE CLASSIFICATION (.0509): Suilable
System Type(s)	Accpeted	Accepted	EVALUATED BY: M. Eaker
Site LTAR	0.30 gpd/ft2	0.30 gpd/ft2	OTHER(S) PRESENT: D. Eaker
Maximum Trench Depth	24"	24"	
Comments:			

SOIL/SITE EVALUATION

(Continuation Sheet-Complete all field in full)

Page _ r of }

DEPARTMENT OF HEALTH AND HUMAN SERVICES DIVISION OF PUBLIC HEALTH ENVIRONMENTAL HEALTH SECTION ON-SITE WATER PROTECTION BRANCH

PROPERTY ID #: Ducks Landing Lot 80

DATE OF EVALUATION: 6/16/25

COUNTY: Hamett

P R O F			SOIL MORPHOLOGY		OTHER PROFILE FACTORS					
L E #	.0502 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	.0503 STRUCTURE/ TEXTURE	.0503 CONSISTENCE/ MINERALOGY	.0504 SOIL WETNESS/ COLOR	.0505 SOIL DEPTH	.0506 SAPRO CLASS	.0507 RESTR HORIZ	.0509 PROFILE CLASS & LTAR*	.0502(d) SLOPE CORRE CTION
5	LS 4-6%	0-6	LS/GR	VFR/NEXP	>48*	NA	NA	NA	Suitable	
		6-24	LS/GR	VFR/NEXP	10YR 7/3				0.30	
		24-38	C/MM SBK	FI/SEXP	10YR 5/8					
		38-48	C/CL/WF SBK	FI/SEXP	10YR 5/8 7.5YR 5/8 mott					
	·			·						
	!									
	ļ									
	-									
	-									
										Ĭ
	1ENTS:								ı	

NCDHHS/DPH/EHS/OSWP