20 PREPARED 5/06/08, 14:01:47 INSPECTION TICKET PAGE INSPECTOR: IVR DATE 5/07/08 Harnett County __________ ADDRESS . : 2685 WIRE RD SUBDIV: LINDEN HOLINESS CHURCH CONTRACTOR : BIM BUILDERS LLC PHONE: (919) 894-5741 PHONE: (910) 892-0089 OWNER . . : LINDEN HOLINESS CHURCH-ADD ON PARCEL . . : 12-0555- - -0061- -01-APPL NUMBER: 08-50019437 CP COMMERCIAL ADD & ALTER DIRECTIONS: 401 TO BUNNLEVEL RIGHT ON MCLEAN CHAPEL RD LEFT ON WIRE RD, 1.5 MILES ON LEFT GRACE CHRISTIAN MINISTRIES T/S: 02/18/2008 08:18 AM DJOHNSON --_____ STRUCTURE: 000 000 17'X16' CLASSROOM ADD ON/1/2 BATH ETC FLOOD ZONE . . . : FLOOD ZONE X PERMIT: CBCO 00 CP BUILDING COMMERCIAL

C151 01 5/07/08

APJU

REQUESTED INSP DESCRIPTION TYP/SQ COMPLETED RESULT RESULTS/COMMENTS ______

C*BLDG FOOTING VRU #: 001605070

per Engineer letter ----- COMMENTS AND NOTES -----



April 17, 2008 PN: 119-001

Mr. Danny Pollard BIM Builders, LLC 6187 NC 27 E Coats, NC 27521

RE: Foundation Investigation & Recommendations

Linden Holiness Church

2685 Wire Road

Harnett County, North Carolina Building Permit #: 08-50019437

Dear Mr. Pollard:

During our site visit on April 16, 2008, a subgrade inspection of the subgrade soils was performed on the proposed foundation location within the existing test pit locations.

The soils were probed with a No. 6 rebar to identify any soft soil conditions. Almost the entire footing for the two planned additions of the structure was found to be very soft.

The upper 18 to 24 inches of subgrade soil visually classifies as an Organic SILT (OH), damp, and is dark brown to grey in color. The subgrade soils from below the strata described above to approximately 36 inches below the surface visually classifies as Silty SAND, coarse in texture, wet, and is yellow/brown in color.

Within 30 minutes of performing several small borings to a depth of 36 inches, the ground water was recorded at 18 to 22 inches below the ground surface along both footing locations.

- Based on the observations above and the anticipated loading of the structure, in order to provide adequate support for the proposed additions to the existing structure we make the following recommendations:
 - 1. The footing location identified on the attached sketch should be undercut to a minimum 24" below the proposed base elevation of the concrete footing and a minimum width of 36".
 - Install one of the following woven geotextile fabrics per manufacturer's recommended installation procedures across the entire bottom of the footing excavation (min 36" wide).
 - a. Terratex GS
 - b. Mirafi 500x
 - c. TNS W200
 - This undercut shall then be backfilled with NCDOT #57 stone in 12" compacted lifts a minimum of 24 inches thick.

P.O. Box 578
46 W. Washington Street
Coats, NC 27521
Phone: 910-897-7070


Phone: 910-897-7070 Fax: 910-897-6767



4. In addition, the concrete footing shall be reinforced with three rows of No. 3 rebar centered beneath the foundation wall and 2 inches off the bottom of the footing.

**It is also recommended that a minimum 4" corrugated plastic pipe (CPP) drain be installed at the lowest corner of each footing to act as a foundation drain in conjunction with the #57 stone. The 4" CPP should be laid on adequate grade to facilitate drainage to a point at which the pipes can daylight.

This report has not been forwarded to the Building Inspector. Please send this in its entirety, to the Harnett County Inspections Department. If you should have any further questions, please feel free to contact me at (910) 897-7070.

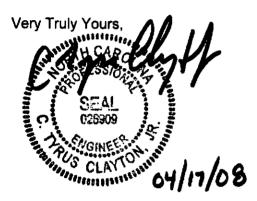

C. Tyrus Clayton Jr., P. E. Vice President

attachments:

Site Sketch


Inspection Photos

CC:

File



SITE SKETCH LINDEN HOLINESS CHURCH N.T.S.

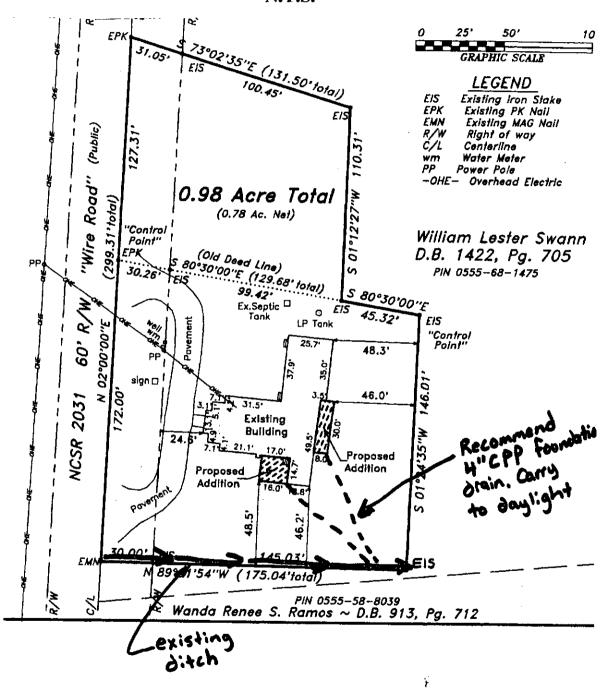

P.O. Box 578
46 W. Washington Street
Coats, NC 27521

Phone: 910-897-7070 Fax: 910-897-6767 PREPARED 5/29/08, 14:00:39 INSPECTION TICKET PAGE
Harnett County INSPECTOR: IVR DATE

Harnett County INSPECTOR: IVR DATE 5/30/08

21

ADDRESS . : 2685 WIRE RD SUBDIV: LINDEN HOLINESS CHURCH

CONTRACTOR: BIM BUILDERS LLC PHONE: (919) 894-5741
OWNER.: LINDEN HOLINESS CHURCH-ADD ON PHONE: (910) 892-0089

PARCEL . . : 12-0555- - -0061- -01-

APPL NUMBER: 08-50019437 CP COMMERCIAL ADD & ALTER DIRECTIONS: 401 TO BUNNLEVEL RIGHT ON MCLEAN CHAPEL RD LEFT ON WIRE RD, 1.5 MILES ON LEFT

GRACE CHRISTIAN MINISTRIES

T/S: 02/18/2008 08:18 AM DJOHNSON --

STRUCTURE: 000 000 17'X16' CLASSROOM ADD ON/1/2 BATH ETC

FLOOD ZONE . . . : FLOOD ZONE X

PERMIT: CBCO 00 CP BUILDING COMMERCIAL

C151 01 5/07/08 JH C*BLDG FOOTING VRU #: 001605070 5/07/08 AP per engineer letter.

C155 01 5/30/08 TI C*BLDG FOUNDATION VRU #: 001616932

----- COMMENTS AND NOTES -----

PREPARED 6/06/08, 14:02:04

INSPECTION TICKET

PAGE DATE

6/09/08

20

Harnett County INSPECTOR: IVR

ADDRESS . : 2685 WIRE RD

SUBDIV: LINDEN HOLINESS CHURCH

CONTRACTOR : BIM BUILDERS LLC

PHONE: (919) 894-5741 OWNER . . : LINDEN HOLINESS CHURCH-ADD ON . PHONE: (910) 892-0089

PARCEL . . : 12-0555- - -0061- -01-

APPL NUMBER: 08-50019437 CP COMMERCIAL ADD & ALTER DIRECTIONS: 401 TO BUNNLEVEL RIGHT ON MCLEAN CHAPEL

RD LEFT ON WIRE RD, 1.5 MILES ON LEFT

GRACE CHRISTIAN MINISTRIES

T/S: 02/18/2008 08:18 AM DJOHNSON --

STRUCTURE: 000 000 17'X16' CLASSROOM ADD ON/1/2 BATH ETC

FLOOD ZONE . . . : FLOOD ZONE X

PERMIT: CBCO 00 CP BUILDING COMMERCIAL REQUESTED INSP DESCRIPTION COMPLETED TYP/SQ RESULT RESULTS/COMMENTS

-------C151 01 5/07/08 5/07/08

5/30/08

5/30/08

C155 01

JΗ ΑP #K

DA

C*BLDG FOOTING VRU #: 001605070

per engineer letter.

C*BLDG FOUNDATION VRU #: 001616932

foundation wall on inside does not have a 2" projection & piers need to be checked also they are backfilled.

Please call I have questions on how floor system is going

to be supported on existing building.

Jimmy Hall (910) 984-4768

C155 02 6/09/08

C*BLDG FOUNDATION VRU #: 001621788

------ COMMENTS AND NOTES ------

PREPARED 6/27/08, 14:00:15

INSPECTION TICKET

PAGE

12

INSPECTOR: IVR DATE Harnett County 6/30/08

ADDRESS . : 2685 WIRE RD

SUBDIV: LINDEN HOLINESS CHURCH

CONTRACTOR : BIM BUILDERS LLC

PHONE: (919) 894-5741 PHONE: (910) 892-0089

OWNER . . : LINDEN HOLINESS CHURCH-ADD ON

PARCEL . . : 12-0555- - -0061- -01-

APPL NUMBER: 08-50019437 CP COMMERCIAL ADD & ALTER DIRECTIONS : 401 TO BUNNLEVEL RIGHT ON MCLEAN CHAPEL

RD LEFT ON WIRE RD, 1.5 MILES ON LEFT

GRACE CHRISTIAN MINISTRIES

T/S: 02/18/2008 08:18 AM DJOHNSON --

STRUCTURE: 000 000 17'X16' CLASSROOM ADD ON/1/2 BATH ETC

FLOOD ZONE . . . : FLOOD ZONE X

PERMIT: CBCO 00 CP BUILDING COMMERCIAL					
	REQUESTED	INSP	DESCRIPTION		
TYP/SQ	COMPLETED	RESULT	RESULTS/COMMENTS		
C151, 01	5/07/08	JH	C*BLDG FOOTING VRU #: 001605070		
	5/07/08	AP	per engineer letter.		
C155 01	5/30/08	JH	C*BLDG FOUNDATION VRU #: 001616932		
	5/30/08	DA	foundation wall on inside does not have a 2" projection & piers need to be checked also they are backfilled. Please call I have questions on how floor system is going to be supported on existing building. Jimmy Hall (910) 984-4768		
C155 02	6/09/08 6/09/08	JH AP	C*BLDG FOUNDATION VRU #: 001621788		
C163 01	6/27/08 6/27/08	TI CA	C*BLDG FLOOR FRAMING VRU #: 001633398		
C163 02	6/30/08	# It	C*BLDG FLOOR FRAMING TIME: 17:00 VRU #: 001633676		

PREPARED 7/17/08, 9:22:24 Harnett County

INSPECTION TICKET INSPECTOR: IVR

PAGE DATE

7/17/08

ADDRESS . : 2685 WIRE RD CONTRACTOR : BIM BUILDERS LLC

SUBDIV: LINDEN HOLINESS CHURCH

PHONE: (919) 894-5741 PHONE: (910) 892-0089

OWNER . .: LINDEN HOLINESS CHURCH-ADD ON PARCEL . .: 12-0555- - -0061- -01- APPL NUMBER: 08-50019437 CP COMMERCIAL ADD & ALTER

THE NOTICE CONTROL OF CONTROL	TENOTAL ADD & ALTEN
PERMIT: CBCO OO CP BUILDING COM	
REQUESTED INSP TYP/SQ COMPLETED RESULT	DESCRIPTION RESULTS/COMMENTS
C151 01 5/07/08 JH	C*BLDG FOOTING VRU #: 001605070
5/07/08 AP C155 01 5/30/08 JH	per engineer letter. C*BLDG FOUNDATION VRU #: 001616932
5/30/08 DA	foundation wall on inside does not have a 2" projection & piers need to be checked also they are backfilled.
	Please call I have questions on how floor system is going to be supported on existing building.
C155 02 6/09/08 JH	Jimmy Hall (910) 984-4768 C*BLDG FOUNDATION VRU #: 001621788
6/09/08 AP	· ·
C163 01 6/27/08 TI 6/27/08 CA	C*BLDG FLOOR FRAMING VRU #: 001633398
C163 02 6/30/08 JH 6/30/08 AP	C*BLDG FLOOR FRAMING TIME: 17:00 VRU #: 001633676
C153 01 7/17/08 TI 7/17/08 CA	C*BLDG ROUGH IN VRU #: 001643840
C153 02 7/17/08 TI 7-17:08 APRS	C*BLDG ROUGH IN TIME: 17:00 VRU #: 001644392
PERMIT: CPEC 00 CP ELECTRICAL CO	CMMEDATAI
REQU £ STED IN S P	DESCRIPTION
	RESULTS/COMMENTS
E251 01 7/17/08 TI	C*ELEC ROUGH IN TIME: 17:00 VRU #: 001644400
PERMIT: CPMC 00 CP MECHANICAL CO	DMMERCIAL
REQUESTED IN\$P	DESCRIPTION RESULTS/COMMENTS
	C*MECH ROUGH IN TIME: 17:00 VRU #: 001644418
	·
PERMIT: CPPC 00 CP PLUMBING COMM	MERCIAL
REQUESTED INSP TYP/SQ COMPLETED RESULT	DESCRIPTION RESULTS/COMMENTS
P351 01 7/17/08 TI /	C*PLUMB ROUGH IN TIME: 17:00 VRU #: 001644434
<i>\\</i>	COMMENTS AND NOTES

INSPECTION TICKET PREPARED 7/22/08, 13:59:34 Harnett County INSPECTOR: IVR

PAGE DATE 7/23/08

PHONE: (910) 892-0089

SUBDIV: LINDEN HOLINESS CHURCH

ADDRESS . : 2685 WIRE RD

CONTRACTOR : BIM BUILDERS LLC

PHONE: (919) 894-5741

OWNER . . : LINDEN HOLINESS CHURCH-ADD ON PARCEL . . : 12-0555- - -0061- -01-

APPL NUMBER: 08-50019437 CP COMMERCIAL ADD & ALTER DIRECTIONS: 401 TO BUNNLEVEL RIGHT ON MCLEAN CHAPEL

RD LEFT ON WIRE RD, 1.5 MILES ON LEFT

GRACE CHRISTIAN MINISTRIES

T/S: 02/18/2008 08:18 AM DJOHNSON --

STRUCTURE: 000 000 17'X16' CLASSROOM ADD ON/1/2 BATH ETC

FLOOD ZONE . . . : FLOOD ZONE X

PERMIT: CPIC 00 CP INSULATION COMMERCIAL

REQUESTED INSP DESCRIPTION

TYP/SQ COMPLETED RESULT RESULTS/COMMENTS

_______ I185 01 7/23/08

TI JH C*INSULATION INSPECTION VRU #: 001647196

PREPARED 8/25/08, 14:08:25

INSPECTION TICKET

PAGE

8/26/08

INSPECTOR: IVR Harnett County DATE

ADDRESS 🔍. : 2685 WIRE RD SUBDIV: LINDEN HOLINESS CHURCH

CONTRACTOR : BIM BUILDERS LLC

PHONE: (919) 894-5741 PHONE: (910) 892-0089

OWNER . . : LINDEN HOLINESS CHURCH-ADD ON

PARCEL . . : 12-0555- - -0061- -01-

APPL NUMBER: 08-50019437 CP COMMERCIAL ADD & ALTER DIRECTIONS: 401 TO BUNNLEVEL RIGHT ON MCLEAN CHAPEL

RD LEFT ON WIRE RD, 1.5 MILES ON LEFT

GRACE CHRISTIAN MINISTRIES

T/S: 02/18/2008 08:18 AM DJOHNSON --

STRUCTURE: 000 000 17'X16' CLASSROOM ADD ON/1/2 BATH ETC

FLOOD ZONE . . . : FLOOD ZONE X

PERMIT: CPLU 00 CP LAND USE PERMIT

REQUESTED INSP DESCRIPTION


TYP/SQ COMPLETED RESULT RESULTS/COMMENTS

Z820 01

8/26/08 TI 8/24/08 LB/AP

PZ*ZONING/FINAL INSPECTION TIME: 17:00 VRU #: 001668029

----- COMMENTS AND NOTES ------

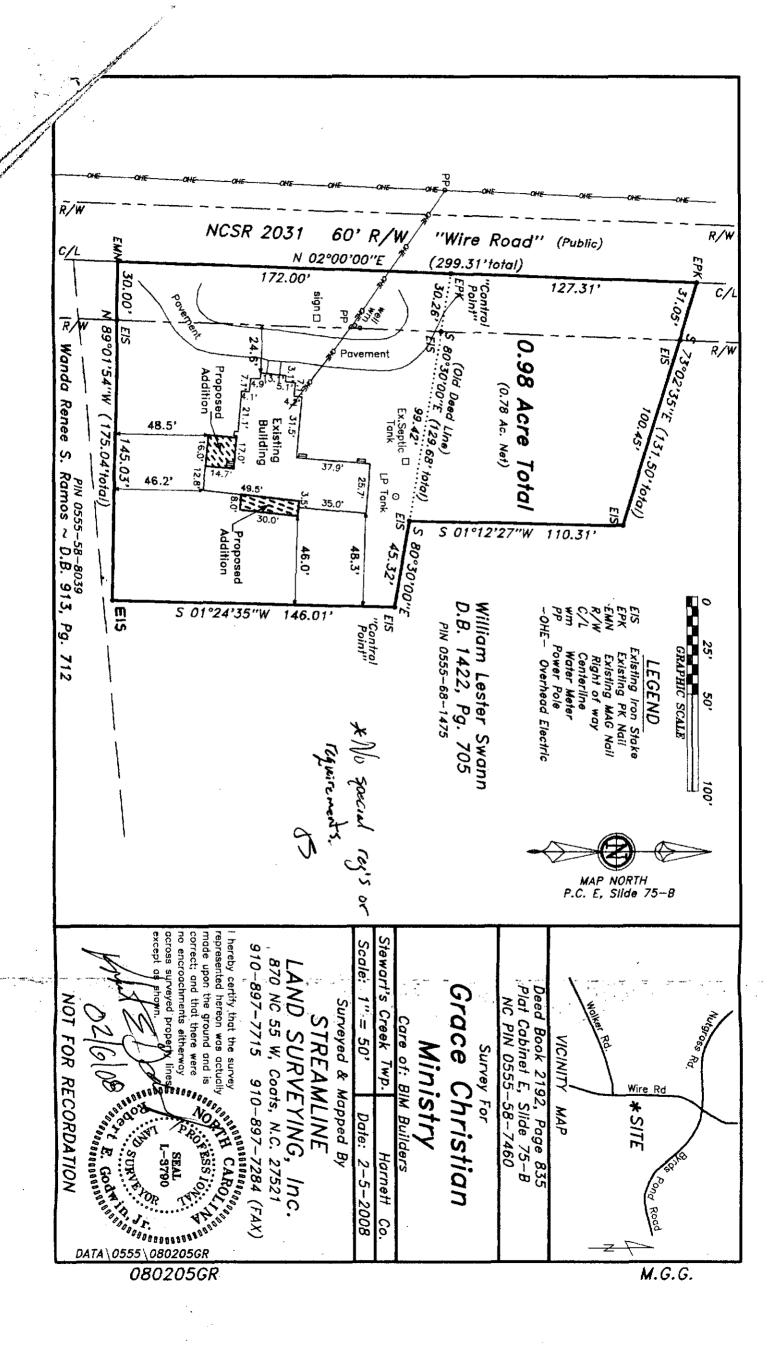

PREPARED 8/28/08, 14:00:08

INSPECTION TICKET

PAGE

DATE 8/29/08

Harnett County INSPECTOR: IVR

ADDRESS 🕟 : 2685 WIRE RD

SUBDIV: LINDEN HOLINESS CHURCH

CONTRACTOR : BIM BUILDERS LLC

PHONE: (919) 894-5741 PHONE: (910) 892-0089

OWNER . . : LINDEN HOLINESS CHURCH-ADD ON

PARCEL . . : 12-0555- - -0061- -01-

APPL NUMBER: 08-50019437 CP COMMERCIAL ADD & ALTER DIRECTIONS : 401 TO BUNNLEVEL RIGHT ON MCLEAN CHAPEL

RD LEFT ON WIRE RD, 1.5 MILES ON LEFT

GRACE CHRISTIAN MINISTRIES

T/S: 02/18/2008 08:18 AM DJOHNSON --

STRUCTURE: 000 000 17'X16' CLASSROOM ADD ON/1/2 BATH ETC

FLOOD ZONE . . . : FLOOD ZONE X

TYP/S	SQ.	REQUESTED COMPLETED	INSP RESULT	DESCRIPTION RESULTS/COMMENTS
C151	01	5/07/08	JH	C*BLDG FOOTING
		5/07/08	AP	per engineer letter.
C155	01	5/30/08	JH	C*BLDG FOUNDATION VRU #: 001616932
		5/30/08	DA	foundation wall on inside does not have a 2" projection & piers need to be checked also they are backfilled.
				Please call I have questions on how floor system is going
				to be supported on existing building.
				Jimmy Hall (910) 984-4768
C155	02	6/09/08	JH	C*BLDG FOUNDATION VRU #: 001621788
		6/09/08	AP	
C163	01	-,	TI	C*BLDG FLOOR FRAMING VRU #: 001633398
		6/27/08	CA	
C163	02	6/30/08	JH	C*BLDG FLOOR FRAMING TIME: 17:00 VRU #: 001633676
		6/30/08	AP	
2153	01	7/17/08	TI	C*BLDG ROUGH IN VRU #: 001643840
		7/17/08	CA	
C153	02	7/17/08	BS	C*BLDG ROUGH IN TIME: 17:00 VRU #: 001644392
		7/17/08	AP	
F854	01	8/28/08	TM	FM*FINAL INSPECTION TIME: 17:00 VRU #: 001669712
		8/28/08	AP	
2179	01	8/29/08	DA JU	C*BLDG FINAL VRY #: 001669720 Landing 44" Dark loss room O Grab bars a bark bark rooms

TYP/SQ	REQUESTED COMPLETED	INSP RESULT	DESCRIPTION RESULTS/COMMENTS
E251 01	7/17/08 7/17/08	BS AP	C*ELEC ROUGH IN TIME: 17:00 VRU #: 001644400
E265 01	8/29/08	DAJY	C*ELEC FINAL VRU #: 001669738

TYP/SQ	REQUESTED COMPLETED	INSP RESULT	DESCRIPTION RESULTS/COMMENTS
M459 01	7/17/08	BS	C*MECH ROUGH IN TIME: 17:00 VRU #: 001644418
	7/17/08	AP	
M465 01	8/29/08	TI	C*MECH FINAL VRU #: 001669746

PREPARED 8/28/08, 14:00:08 INSPECTION TICKET 7 PAGE INSPECTOR: IVR Harnett County DATE 8/29/08 ADDRESS , : 2685 WIRE RD SUBDIV: LINDEN HOLINESS CHURCH CONTRACTOR : BIM BUILDERS LLC PHONE: (919) 894-5741 PHONE: (910) 892-0089 OWNER : LINDEN HOLINESS CHURCH-ADD ON PARCEL . . : 12~0555- - -0061- -01-APPL NUMBER: 08-50019437 CP COMMERCIAL ADD & ALTER ______ REQUESTED INSP DESCRIPTION TYP/SQ COMPLETED RESULT RESULTS/COMMENTS ______ PERMIT: CPPC 00 CP PLUMBING COMMERCIAL REQUESTED INSP

C*PLUMB FINAL VRU #: 001669761

C*PLUMB ROUGH IN TIME: 17:00 VRU #: 001644434

DESCRIPTION

TYP/SQ COMPLETED RESULT RESULTS/COMMENTS

DA TH

TI

7/17/08 BS

8/29/08

7/17/08 AP

P351 01

P361 01

PREPARED 9/09/08, 7:58:34
Harnett County INSPECTION TICKET PAGE INSPECTOR: IVR DATE 9/09/08

ADDRESS . : 2685 WIRE RD SUBDIV: LINDEN HOLINESS CHURCH

CONTRACTOR : BIM BUILDERS LLC PHONE: (919) 894-5741 OWNER : LINDEN HOLINESS CHURCH-ADD ON PHONE: (910) 892-0089

PARCEL . . : 12-0555- - -0061- -01-

APPL NUMBER: 08-50019437 CP COMMERCIAL ADD & ALTER

DIRECTIONS : 401 TO BUNNLEVEL RIGHT ON MCLEAN CHAPEL

RD LEFT ON WIRE RD, 1.5 MILES ON LEFT

GRACE CHRISTIAN MINISTRIES

T/S: 02/18/2008 08:18 AM DJOHNSON --

STRUCTURE: 000 000 17'X16' CLASSROOM ADD ON/1/2 BATH ETC

FLOOD ZONE . . . : FLOOD ZONE X

PROPOSED USE : ADD SEPTIC - EXISTING? . . . : YES

PERMIT:	PERMIT: CBCO 00 CP BUILDING COMMERCIAL			
	REQUESTED	INSP	DESCRIPTION	
TYP/SQ	COMPLETED	RESULT	RESULTS/COMMENTS	
C151 01	5/07/08	JH	C*BLDG FOOTING VRU #: 001605070	
	5/07/08	AP	per engineer letter.	
C155 01	5/30/08	JH	C*BLDG FOUNDATION VRU #: 001616932	
	5/30/08	DA	foundation wall on inside does not have a 2" projection &	
			piers need to be checked also they are backfilled.	
	•		Please call I have questions on how floor system is going	
			to be supported on existing building.	
			Jimmy Hall (910) 984-4768	
C155 02	6/09/08	JH	C*BLDG FOUNDATION VRU #: 001621788	
	6/09/08	AP	•	
C163 01	-1 - 1 - +	TI	C*BLDG FLOOR FRAMING VRU #: 001633398	
	6/27/08	CA		
C163 02	-,,	JH	C*BLDG FLOOR FRAMING TIME: 17:00 VRU #: 001633676	
	6/30/08	AP		
C153 01	7/17/08	TI	C*BLDG ROUGH IN VRU #: 001643840	
	7/17/08	CA		
C153 02	7/17/08	BS	C*BLDG ROUGH IN TIME: 17:00 VRU #: 001644392	
	7/17/08	ΆP		
F854 01	8/28/08	TM	FM*FINAL INSPECTION TIME: 17:00 VRU #: 001669712	
	8/28/08	AP		
C179 01	8/29/08	JН	C*BLDG FINAL VRU #: 001669720	
	8/29/08	DA	1) Need landing @ door in new class room 44" from door and	
			the width of the steps.	
			2) Need grab bars per code in new bathrooms in back of	
			church.	
C179 02	9/09/08	AP. TH	C*BLDG FINAL TIME: 17:00 VRU #: 001674407	

PERMIT:	CPEC 00 CP REQUESTED COMPLETED	INSP	COMMERCIAL DESCRIPTION RESULTS/COMMENTS
E251 01	7/17/08 7/17/08	BS AP	C*ELEC ROUGH IN TIME: 17:00 VRU #: 001644400
E265 01	8/29/08 8/29/08	JH DA	C*ELEC FINAL VRU #: 001669738 1) Need landing @ door in new class room 44" from door and the width of the steps.

PREPARED 9/09/08, 7:58:34 INSPECTION TICKET PAGE
Harnett County INSPECTOR: IVR DATE 9/09/0

ADDRESS . : 2685 WIRE RD SUBDIV: LINDEN HOLINESS CHURCH

CONTRACTOR : BIM BUILDERS LLC PHONE : (919) 894-5741
OWNER . . : LINDEN HOLINESS CHURCH-ADD ON PHONE : (910) 892-0089

PARCEL 7 . : 12-0555- - -0061- -01-

APPL NUMBER: 08-50019437 CP COMMERCIAL ADD & ALTER

REQUESTED INSP DESCRIPTION
TYP/SQ COMPLETED RESULT RESULTS/COMMENTS

2) Need grab bars per code in new bathrooms in back of

church.

E265 02 9/09/08 TI C*ELEC FINAL VRU #: 001673380

PERMIT:	CPMC 00 CP M REQUESTED COMPLETED	ECHANICAL INSP RESULT	COMMERCIAL DESCRIPTION RESULTS/COMMENTS
M459 01	7/17/08	BS	C*MECH ROUGH IN TIME: 17:00 VRU #: 001644418
	7/17/08	AP	
M465 01	8/29/08	JH	C*MECH FINAL VRU #: 001669746
	8/29/08	DA	1) Need landing @ door in new class room 44" from door and
			the width of the steps.
			2) Need grab bars per code in new bathrooms in back of
			church.
M465 02	9/09/08	TI ,	C*MECH FINAL TIME: 17:00 VRU #: 001674415
	· ·	APTA	
		 	

PERMIT: (CPPC 00 CP PL		•
_	REQUESTED	INSP	DESCRIPTION
TYP/SQ	COMPLETED	RESULT	RESULTS/COMMENTS
P351 01	7/17/08	BS	C*PLUMB ROUGH IN TIME: 17:00 VRU #: 001644434
	7/17/08	AP	•
P361 01	8/29/08	JH	C*PLUMB FINAL
	8/29/08	DA	1) Need landing @ door in new class room 44" from door and
			the width of the steps.
			2) Need grab bars per code in new bathrooms in back of
			church.
P361 02	9/09/08	TIA TH	C*PLUMB FINAL TIME: 17:00 VRU #: 001674423
	•	HYJH	

COUNTY OF HARNETT DEPARTMENT OF BUILDING INSPECTION AND PLANNING/DEVELOPMENT CERTIFICATE OF OCCUPANCY

This certificate issued pursuant to the requirements of Section 105 of the North Carolina State Building Code and the Harnett County Zoning Ordinance certifies at the time of issuance this structure was in compliance with the various ordinances of the County of Harnett regulating development and building construction or use. For the following:

Use Classification: A 3 addition 1 Re	neuction PERMIT NUMBERS
Owner: Linden Holiness Church	Building Permit No.:
911 Address: 2685 Wire Rd	Electrical Permit No.:
	Insulation Permit No.:
	Plumbing Permit No.:
State: Zip Code:	Mech. Permit No.:
Date: 9-9-08	,MEG. Home:
James Thall	
Building Official	