


Structural Capacity, PC

STRUCTURAL CONSULTING GROUP

North Carolina Firm License Number – C3406

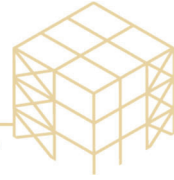

July 26, 2022

Titan Solar Power NC, Inc.
525. W. Baseline Road
Mesa, AZ 85210

Re: Hughes, Steven William – TSP134471 (SCPC Project No. – 2022.26.13670)
191 Scotland Drive
Spring Lake, NC 28390

Titan Solar Power NC:

At the request of Titan Solar Power NC, Structural Capacity, PC (SCPC) has evaluated the roof structure at the above noted site to determine its adequacy to support the attachment of roof mounted solar arrays. The roof structure is composed of wood sheathing supported by pre-engineered wood trusses spaced at 24" o.c.

Design Criteria:

- Ground Snow Load = 10psf
- Wind speed = 120mph
- Risk Category = II / Wind Exposure B
- PV module Dead Load = 3.5psf (max)
- PV Module Count = 27

Each panel will be supported by (2) mounting rails, (1) at each end. The mounting legs of the solar panel railing will be attached directly to the truss top chord with a 5/16" (min) diameter lag screw with 2½" embedment. The installer shall use best practice construction methods to locate the lag screw in the center of each truss top chord. All wood members supporting PV modules should consist of sound lumber without significant signs of deterioration.

The mounting legs of the solar panel racking system shall be located at 6'-0" o.c. maximum. The mounting legs should be staggered at the primary framing member spacing (2'-0") at adjacent solar panel rails. The maximum rail cantilever span should be limited to 1'-4".

The existing roof structure at the above referenced site is adequate to support the solar panel loadings, as noted above, per the 2018 North Carolina Residential Code, if installed in accordance with the above stated conditions. The adequacy of the solar panels and racking system are outside the scope of this letter and to be provided by solar panel and racking manufacturer, if required.


The roof conditions stated above should be field verified, by the installer, prior to construction. If any conditions are found in conflict with those stated above, SCPC should be made aware immediately for re-evaluation and report amendment, as applicable, before proceeding with solar panel installation.

Sincerely,

Structural Capacity, PC



Adrian S. Durham, PE, SE

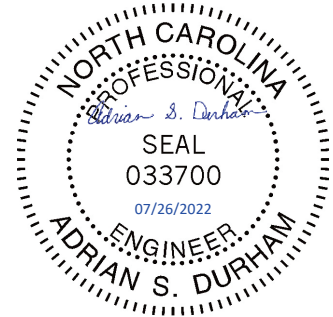

Adrian
Durham

Digitally signed
by Adrian
Durham
Date: 2022.07.26
12:24:29 -04'00'