


B4 2.0E Rigidlam LVL 1.750" X 9.250" 2-Ply - PASSED

Level: Level

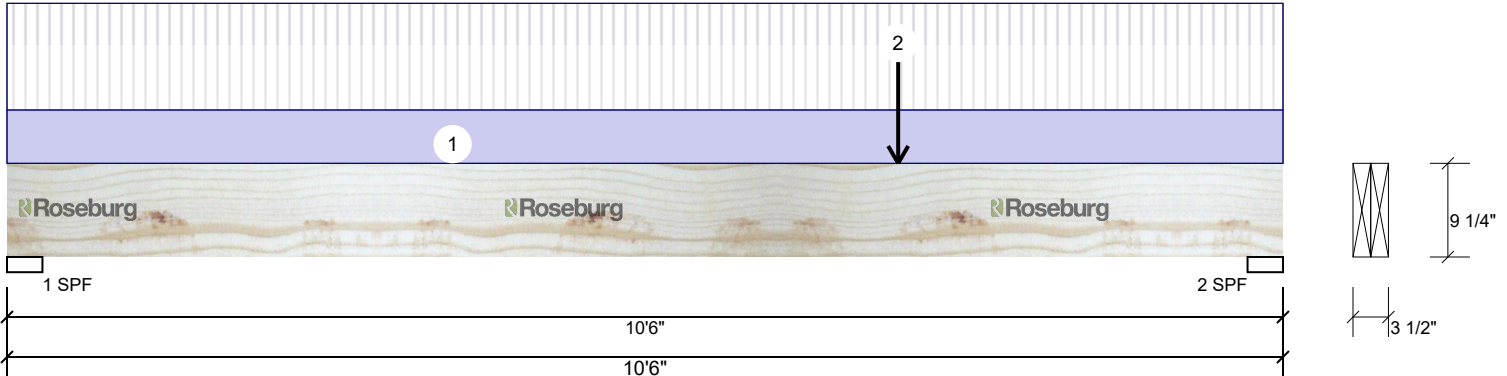

Member Information

Type:	Girder	Application:	Floor
Plies:	2	Design Method:	ASD
Moisture Condition:	Dry	Building Code:	IBC/IRC 2015
Deflection LL:	480	Load Sharing:	No
Deflection TL:	240	Deck:	Not Checked
Importance:	Normal - II		
Temperature:	Temp <= 100°F		

Reactions UNPATTERNED lb (Uplift)

Brg	Direction	Live	Dead	Snow	Wind	Const
1	Vertical	236	170	0	0	0
2	Vertical	421	274	0	0	0

Bearings

Bearing	Length	Dir.	Cap.	React D/L lb	Total	Ld. Case	Ld. Comb.
1 - SPF	3.500"	Vert	8%	170 / 236	406	L	D+L
2 - SPF	3.500"	Vert	13%	274 / 421	695	L	D+L

Analysis Results

Analysis	Actual	Location	Allowed	Capacity	Comb.	Case
Moment	1851 ft-lb	7'4"	13320 ft-lb	0.139 (14%)	D+L	L
Unbraced	1851 ft-lb	7'4"	7341 ft-lb	0.252 (25%)	D+L	L
Shear	661 lb	9'5 1/4"	6259 lb	0.106 (11%)	D+L	L
LL Defl inch	0.038 (L/3204)	5'7 5/8"	0.251 (L/480)	0.150 (15%)	L	L
TL Defl inch	0.062 (L/1935)	5'7 3/8"	0.502 (L/240)	0.124 (12%)	D+L	L

Design Notes

- 1 Provide support to prevent lateral movement and rotation at the end bearings. Lateral support may also be required at the interior bearings by the building code.
- 2 Girders are designed to be supported on the bottom edge only.
- 3 Multiple plies must be fastened together as per manufacturer's details.
- 4 Top loads must be supported equally by all plies.
- 5 Top must be laterally braced at end bearings.
- 6 Bottom must be laterally braced at end bearings.
- 7 Lateral slenderness ratio based on single ply width.

ID	Load Type	Location	Trib Width	Side	Dead 0.9	Live 1	Snow 1.15	Wind 1.6	Const. 1.25	Comments
1	Uniform			Top	10 PLF	20 PLF	0 PLF	0 PLF	0 PLF	C.J. Load
2	Point	7-4-0		Top	250 lb	447 lb	0 lb	0 lb	0 lb	LVL Pt Load
	Bearing Length	0-3-8								
	Self Weight				9 PLF					

Notes
Calculated Structured Designs is responsible only of the structural adequacy of this component based on the design criteria and loadings shown. It is the responsibility of the customer and/or the contractor to ensure the component suitability of the intended application, and to verify the dimensions and loads.

Lumber
1. Dry service conditions, unless noted otherwise
2. LVL not to be treated with fire retardant or corrosive chemicals

Handling & Installation
1. LVL beams must not be cut or drilled
2. Refer to manufacturer's product information regarding installation requirements, multi-ply fastening details, beam strength values, and code approvals
3. Damaged Beams must not be used
4. Design assumes top edge is laterally restrained
5. Provide lateral support at bearing points to avoid lateral displacement and rotation

6. For flat roofs provide proper drainage to prevent ponding

This design is valid until 5/24/2024

Manufacturer Info
Roseburg Forest Products
4500 Riddle By-pass Rd
Riddle, OR 97469
(541) 784-4005
www.roseburg.com
APA: PR-L289, PR-L270, ICC-ES: ESR-1210

Kempville Building Material
298 Harvey Faulk Road, N.C.
U.S.A
27332
919.775.1450