

Project: Address:

Weaver Homes

Gaston II (181035B)

Date: 1/17/2023

Input by: Marshall Naylor Job Name: Gaston II (181035B)


Project #:

Kerto-S LVL FB2

1.750" X 24.000"

3-Ply - PASSED

Level: Level

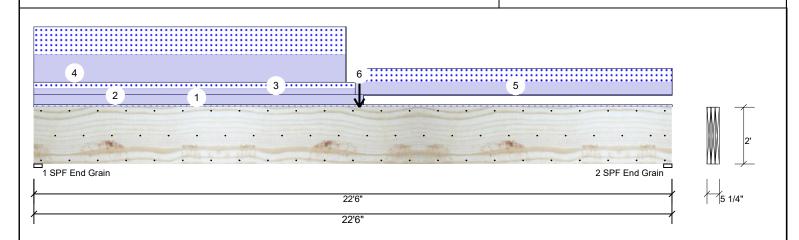

Member Information

Type: Girder Plies: 3 Moisture Condition: Dry Deflection LL: 480 Deflection TL: 360

Importance: Normal - II Temperature: Temp <= 100°F Application: Floor Design Method: ASD

Building Code: IBC 2012 Load Sharing: Yes

Deck:

Not Checked

Reactions UNPATTERNED lb (Uplift)

Brg	Direction	Live	Dead	Snow	Wind	Const
1	Vertical	225	6536	5095	0	0
2	Vertical	225	4429	3676	0	0

Page 1 of 3

Bearings

End Grain

Bearing Length Dir. Cap. React D/L lb Total Ld. Case Ld. Comb. 1 - SPF 3.500" Vert 6536 / 5095 11631 L End Grain 4429 / 3676 8104 L D+S 2 - SPF 3.500" Vert

Analysis Results

Analysis	Actual	Location	Allowed	Capacity	Comb.	Case
Moment	65477 ft-lb	11'5 3/4"	131295 ft-lb	0.499 (50%)	D+S	L
Unbraced	65477 ft-lb	11'5 3/4"	65512 ft-lb	0.999 (100%)	D+S	L
Shear	10076 lb	2'3 1/2"	30912 lb	0.326 (33%)	D+S	L
LL Defl inch	0.226 (L/1171)	11'1 11/16"	0.552 (L/480)	0.410 (41%)	S	L
TL Defl inch	0.501 (L/528)	11' 7/8"	0.735 (L/360)	0.682 (68%)	D+S	L

Design Notes

- 1 Provide support to prevent lateral movement and rotation at the end bearings. Lateral support may also be required at the interior bearings by the building code.
- 2 Fasten all plies using 3 rows of 10d Box nails (.128x3") at 12" o.c. Maximum end distance not to exceed 6".
- 3 Refer to last page of calculations for fasteners required for specified loads.
- 4 Girders are designed to be supported on the bottom edge only.
- 5 Top loads must be supported equally by all plies.
- 6 Top must be laterally braced at a maximum of 4' 3/8" o.c.
- 7 Bottom must be laterally braced at end bearings.
- 8 Lateral slenderness ratio based on single ply width.

ID	Load Type	Location	Trib Width	Side	Dead 0.9	Live 1	Snow 1.15	Wind 1.6	Const. 1.25	Comments	
1	Tie-In	0-0-0 to 22-6-0	0-6-0	Far Face	15 PSF	40 PSF	0 PSF	0 PSF	0 PSF	1' Floor	
2	Part. Uniform	0-0-0 to 11-7-8		Тор	120 PLF	0 PLF	0 PLF	0 PLF	0 PLF	Wall	
3	Part. Uniform	0-0-0 to 11-4-0		Near Face	79 PLF	0 PLF	79 PLF	0 PLF	0 PLF	M2	
4	Part. Uniform	0-0-0 to 11-0-0		Тор	341 PLF	0 PLF	341 PLF	0 PLF	0 PLF	A2	

Continued on page 2...

Notes

Calculated Structured Designs is responsible only of the structural adequacy of this component based on the design criteria and loadings shown. It is the responsibility of the customer and/or the contractor to ensure the component suitability of the intended application, and to verify the dimensions and loads.

- Dry service conditions, unless noted otherwise
 LVL not to be treated with fire retardant or corrosive
- Handling & Installation
- LVL beams must not be cut or drilled Refer to manufacturer's product information regarding installation requirements, multi-ply fastening details, beam strength values, and code approvals Damaged Beams must not be used

- Design assumes top edge is laterally restrained
 Provide lateral support at bearing points to avoid
 lateral displacement and rotation
- For flat roofs provide proper drainage to prevent ponding

This design is valid until 11/3/2024

Metsä Wood 301 Merritt 7 Building, 2nd Floor Norwalk, CT 06851 (800) 622-5850 www.metsawood.com/us

Manufacturer Info

Comtech, Inc. Comtech, Inc. 1001 S. Reilly Road, Suite #639 Fayetteville, NC USA 28314 910-864-TRUS







Project: Address:

Weaver Homes

Gaston II (181035B)

Date: 1/17/2023

Input by: Marshall Naylor Job Name: Gaston II (181035B) Page 2 of 3


Project #:

Kerto-S LVL FB₂

1.750" X 24.000"

3-Ply - PASSED

Level: Level

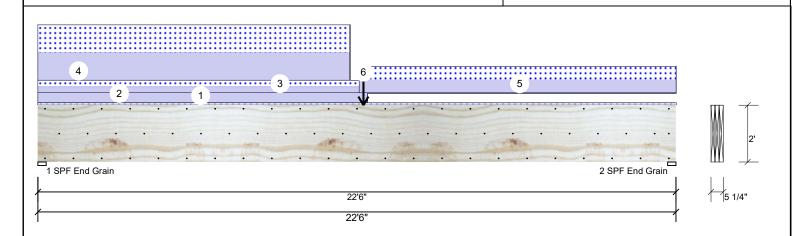

Continued fr	rom page 1									
ID	Load Type	Location	Trib Width	Side	Dead 0.9	Live 1	Snow 1.15	Wind 1.6	Const. 1.25	Comments
5	Part. Uniform	11-4-0 to 22-6-0		Near Face	164 PLF	0 PLF	164 PLF	0 PLF	0 PLF	M3
6	Point	11-5-12		Тор	2293 lb	0 lb	2293 lb	0 lb	0 lb	B2
	Bearing Length	0-3-8								
	Self Weight				28 PLF					

Notes

Calculated Structured Designs is responsible only of the structural adequacy of this component based on the design criteria and loadings shown. It is the responsibility of the customer and/or the contractor to ensure the component suitability of the intended application, and to verify the dimensions and loads.

Dry service conditions, unless noted otherwise
 LVL not to be treated with fire retardant or corrosive

Handling & Installation

Handling & Installation

1. IVI beams must not be cut or drilled

2. Refer to manufacturer's product information regarding installation requirements, multi-ply fastening details, beam strength values, and code approvals

3. Damaged Beams must not be used

4. Design assumes top edge is laterally restrained

5. Provide lateral support at bearing points to avoid lateral displacement and rotation

For flat roofs provide proper drainage to prevent ponding

This design is valid until 11/3/2024

Metsä Wood 301 Merritt 7 Building, 2nd Floor Norwalk, CT 06851 (800) 622-5850 www.metsawood.com/us

Manufacturer Info

Comtech, Inc. 1001 S. Reilly Road, Suite #639 Fayetteville, NC USA 28314 910-864-TRUS







Weaver Homes

Project:

Address: Gaston II (181035B) Date: 1/17/2023

Input by: Marshall Naylor Job Name: Gaston II (181035B) Page 3 of 3


Project #:

Kerto-S LVL FB₂

1.750" X 24.000"

3-Ply - PASSED

Level: Level

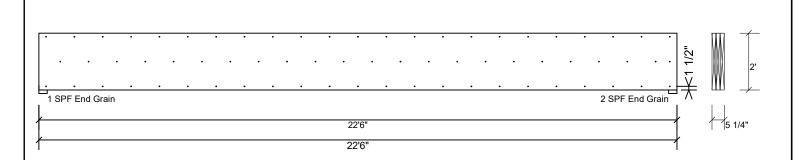

Multi-Ply Analysis

Fasten all plies using 3 rows of 10d Box nails (.128x3") at 12" o.c.. Nail from both sides. Maximum end distance not to exceed

Capacity	77.4 %	
Load	218.7 PLF	
Yield Limit per Foot	282.4 PLF	
Yield Limit per Fastener	94.1 lb.	
Yield Mode	IV	
Edge Distance	1 1/2"	
Min. End Distance	3"	
Load Combination	D+S	
Duration Factor	1 15	

Notes

Calculated Structured Designs is responsible only of the structural adequacy of this component based on the design criteria and loadings shown. It is the responsibility of the customer and/or the contractor to ensure the component suitability of the intended application, and to verify the dimensions and loads.

- Dry service conditions, unless noted otherwise
 LVL not to be treated with fire retardant or corrosive

Handling & Installation

- Handling & Installation

 1. IVI beams must not be cut or drilled

 2. Refer to manufacturer's product information regarding installation requirements, multi-ply fastening details, beam strength values, and code approvals

 3. Damaged Beams must not be used

 4. Design assumes top edge is laterally restrained

 5. Provide lateral support at bearing points to avoid lateral displacement and rotation

For flat roofs provide proper drainage to prevent ponding

Metsä Wood 301 Merritt 7 Building, 2nd Floor Norwalk, CT 06851 (800) 622-5850 www.metsawood.com/us

Manufacturer Info

Comtech, Inc. 1001 S. Reilly Road, Suite #639 Fayetteville, NC USA 28314 910-864-TRUS



This design is valid until 11/3/2024



Project: Address:

Weaver Homes

Gaston II (181035B)

Date: 1/17/2023


Input by: Marshall Naylor Job Name: Gaston II (181035B)


Project #:

Kerto-S LVL FB1

1.750" X 14.000" 2-Ply - PASSED

Level: Level

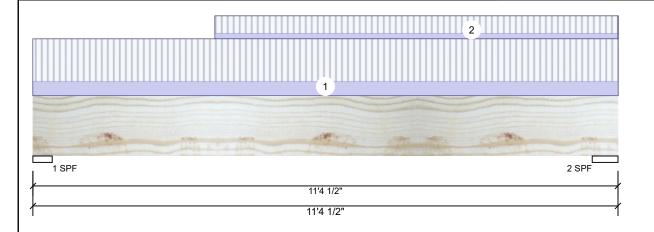

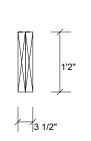

Page 1 of 1

Member Information

Type:	Giraer
Plies:	2
Moisture Condition:	Dry
Deflection LL:	480
Deflection TL:	360
Importance:	Normal - II
Temperature:	Temp <= 100°F

Application: Floor Design Method: ASD **Building Code:** IBC 2012 Load Sharing: No Deck: Not Checked Reactions UNPATTERNED Ib (Uplift) Brg Snow Wind Const Direction Live Dead Vertical 2129 771 0 0 0 1 0 2523 904 O 0 2 Vertical

Bearings

Bearing	Length	Dir.	Cap. R	teact D/L lb	Total	Ld. Case	Ld. Comb.
1 - SPF	4.500"	Vert	43%	771 / 2129	2899	L	D+L
2 - SPF	6.000"	Vert	38%	904 / 2523	3426	L	D+L

Analysis Results

Analysis	Actual	Location	Allowed	Capacity	Comb.	Case
Moment	8168 ft-lb	5'9 3/16"	26999 ft-lb	0.303 (30%)	D+L	L
Unbraced	8168 ft-lb	5'9 3/16"	10268 ft-lb	0.795 (80%)	D+L	L
Shear	2421 lb	9'8 1/2"	10453 lb	0.232 (23%)	D+L	L
LL Defl inch	0.090 (L/1419)	5'8 3/16"	0.266 (L/480)	0.338 (34%)	L	L
TL Defl inch	0.122 (L/1044)	5'8 3/16"	0.354 (L/360)	0.345 (34%)	D+L	L

Design Notes

- 1 Provide support to prevent lateral movement and rotation at the end bearings. Lateral support may also be required at the interior bearings by the building code.
- 2 Girders are designed to be supported on the bottom edge only.
- 3 Multiple plies must be fastened together as per manufacturer's details.
- 4 Top loads must be supported equally by all plies.
- 5 Top must be laterally braced at end bearings.
- 6 Bottom must be laterally braced at end bearings.
- 7 Lateral slenderness ratio based on single ply width.

ID	Load Type	Location	Trib Width	Side	Dead 0.9	Live 1	Snow 1.15	Wind 1.6	Const. 1.25	Comments	
1	Uniform			Тор	106 PLF	318 PLF	0 PLF	0 PLF	0 PLF	F5	
2	Part. Uniform	3-6-8 to 11-4-8		Тор	44 PLF	132 PLF	0 PLF	0 PLF	0 PLF	F9	
	Self Weight				11 PLF						

Notes

Calculated Structured Designs is responsible only of the structural adequacy of this component based on the design criteria and loadings shown, It is the responsibility of the customer and/or the contractor to ensure the component suitability of the intended application, and to verify the dimensions and loads.

- Dry service conditions, unless noted otherwise
 LVL not to be treated with fire retardant or corrosive
- LVL beams must not be out or drilled
 Refer to manufacturer's product information reguriding installation requirements, multi-ply fastening details, beam strength values, and code approvals
 Damaged Beams must not be used

Handling & Installation

- Design assumes top edge is laterally restrained
 Provide lateral support at bearing points to avoid
 lateral displacement and rotation
- 6. For flat roofs provide proper drainage to prevent ponding

Metsä Wood 301 Merritt 7 Building, 2nd Floor Norwalk, CT 06851 (800) 622-5850 www.metsawood.com/us

Manufacturer Info

Comtech, Inc. 1001 S. Reilly Road, Suite #639 Fayetteville, NC USA 28314 910-864-TRUS



This design is valid until 11/3/2024



Project: Address:

Weaver Homes

Gaston II (181035B)


Date: 1/17/2023


Input by: Marshall Naylor Job Name: Gaston II (181035B)

Project #:

Kerto-S LVL 1.750" X 9.250" 2-Ply - PASSED 6/0 SLIDER

Level: Level

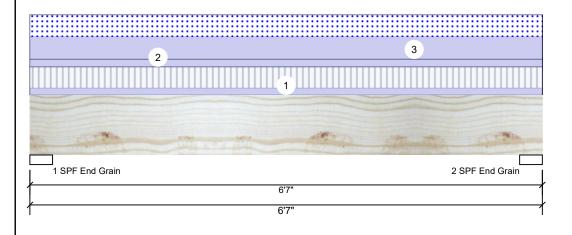

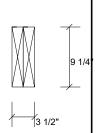

Page 1 of 1

Member Information

Girder Type Plies: 2 Moisture Condition: Dry Deflection LL: 480 Deflection TL: 360 Importance: Normal - II Temperature: Temp <= 100°F

Application: Floor Design Method: ASD **Building Code:** IBC 2012

Load Sharing: No

Deck: Not Checked

Reactions UNPATTERNED Ib (Uplift)

Brg	Direction	Live	Dead	Snow	Wind	Const
1	Vertical	1060	1887	1113	0	0
2	Vertical	1060	1887	1113	0	0

Analysis Results

Analysis Actual Location Allowed Comb. Case Capacity 5009 ft-lb 3'3 1/2" 14423 ft-lb 0.347 (35%) D+0.75(L+S) L Moment Unbraced 5009 ft-lb 3'3 1/2" 10451 ft-lb 0.479 (48%) D+0.75(L+S) L 0.300 (30%) D+0.75(L+S) L 2387 lb 1' 3/4" 7943 lb Shear LL Defl inch 0.042 (L/1741) 3'3 1/2" 0.153 (L/480) 0.276 (28%) 0.75(L+S) L TL Defl inch 0.091 (L/807) 3'3 1/2" 0.204 (L/360) 0.446 (45%) D+0.75(L+S) L

Bearings

Bearing Length Dir. Cap. React D/L lb Total Ld. Case Ld. Comb. D+0.75(L+S) 1 - SPF 3.500" Vert 1887 / 1629 3516 L End

Grain

Grain

3516 L D+0.75(L+S) 2 - SPF 3.500" Vert 1887 / 1629 End

Design Notes

- 2 Girders are designed to be supported on the bottom edge only.
- 3 Multiple plies must be fastened together as per manufacturer's details.
- 4 Top loads must be supported equally by all plies.
- 5 Top must be laterally braced at end bearings.

Uniform

- 6 Bottom must be laterally braced at end bearings.
- 7 Lateral slenderness ratio based on single ply width.

1 Provide support to prevent lateral movement and rotation at the end bearings.	Lateral support
may also be required at the interior bearings by the building code.	

ID	Load Type	Location	Trib Width	Side	Dead 0.9	Live 1	Snow 1.15	Wind 1.6	Const. 1.25	Comments
1	Uniform			Тор	108 PLF	322 PLF	0 PLF	0 PLF	0 PLF	F4
2	Uniform			Тор	120 PLF	0 PLF	0 PLF	0 PLF	0 PLF	WALL

Top

Self Weight 7 PLF

Notes

3

Calculated Structured Designs is responsible only of the structural adequacy of this component based on the design criteria and loadings shown. It is the responsibility of the customer and/or the contractor to ensure the component suitability of the intended application, and to verify the dimensions and loads.

Dry service conditions, unless noted otherwise
 LVL not to be treated with fire retardant or corrosive

Handling & Installation

- LVL beams must not be cut or drilled Refer to manufacturer's product information regarding installation requirements, multi-pli fastening details, beam strength values, and code Damaged Beams must not be used
- Design assumes top edge is laterally restrained
 Provide lateral support at bearing points to avoid
 lateral displacement and rotation
- For flat roofs provide proper drainage to prevent ponding

338 PLF

0 PLF

338 PLF

Metsä Wood 301 Merritt 7 Building, 2nd Floor Norwalk, CT 06851 (800) 622-5850 www.metsawood.com/us

0 PLF

0 PLF A4

Comtech, Inc. Comtech, Inc. 1001 S. Reilly Road, Suite #639 Fayetteville, NC USA 28314 910-864-TRUS



This design is valid until 11/3/2024 CSD DESIGN

Manufacturer Info



Project:


Address: Gaston II (181035B) Date: 1/17/2023

Marshall Naylor Job Name: Gaston II (181035B) Page 1 of 1

Project #:

Input by:

Kerto-S LVL 1.750" X 14.000" Front GDH 2-Ply - PASSED Level: Level

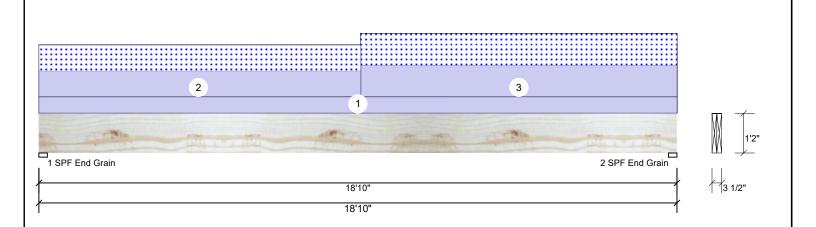

Member Information Reactions UNPATTERNED Ib (Uplift) Type: Girder Application: Floor Plies: Design Method: ASD Moisture Condition: Dry **Building Code:** IBC 2012 Deflection LL: 480 Load Sharing: No Deflection TL: 360 Deck: Not Checked Importance: Normal - II Temperature: Temp <= 100°F Rearings

Analysis Results

Analysis	Actual	Location	Allowed	Capacity	Comb.	Case
Moment	12090 ft-lb	9'8 7/8"	31049 ft-lb	0.389 (39%)	D+S	L
Unbraced	12090 ft-lb	9'8 7/8"	12128 ft-lb	0.997 (100%)	D+S	L
Shear	2353 lb	17'5"	12021 lb	0.196 (20%)	D+S	L
LL Defl inch	0.184 (L/1202)	9'6 3/16"	0.461 (L/480)	0.399 (40%)	S	L
TL Defl inch	0.491 (L/451)	9'5 13/16"	0.615 (L/360)	0.798 (80%)	D+S	L

Design Notes

- 1 Provide support to prevent lateral movement and rotation at the end bearings. Lateral support may also be required at the interior bearings by the building code.
- 2 Girders are designed to be supported on the bottom edge only.
- 3 Multiple plies must be fastened together as per manufacturer's details.
- 4 Top loads must be supported equally by all plies.
- 5 Top must be laterally braced at a maximum of 8'7 13/16" o.c.
- 6 Bottom must be laterally braced at end bearings.
- 7 Lateral slenderness ratio based on single ply width.

itcut	ctions out A	**	ib (opinic	,		
Brg	Direction	Live	Dead	Snow	Wind	С

Const	Wind	Snow	Dead	Live	Direction	Brg
0	0	952	1619	0	Vertical	1
0	0	1052	1720	0	Vertical	2
	0	1052	1720	0	Vertical	2

I	Dearings	•						
I	Bearing	Length	Dir.	Сар.	React D/L lb	Total	Ld. Case	Ld. Comb.
	1 - SPF End Grain	3.000"	Vert	29%	1619 / 952	2571	L	D+S
	2 - SPF End Grain	3.000"	Vert	31%	1720 / 1052	2772	L	D+S

ID	Load Type	Location	Trib Width	Side	Dead 0.9	Live 1	Snow 1.15	Wind 1.6	Const. 1.25	Comments
1	Uniform			Тор	60 PLF	0 PLF	0 PLF	0 PLF	0 PLF	wall
2	Part. Uniform	0-0-0 to 9-6-0		Тор	96 PLF	0 PLF	96 PLF	0 PLF	0 PLF	M2
3	Part. Uniform	9-6-0 to 18-10-0		Тор	117 PLF	0 PLF	117 PLF	0 PLF	0 PLF	M3
	Self Weight				11 PLF					

Notes

Calculated Structured Designs is responsible only of the structural adequacy of this component based on the design criteria and loadings shown, It is the responsibility of the customer and/or the contractor to ensure the component suitability of the intended application, and to verify the dimensions and loads.

- Dry service conditions, unless noted otherwise
 LVL not to be treated with fire retardant or corrosive
- Handling & Installation
- andling & Installation

 LVL beams must not be out or drilled
 Refer to manufacturer's product information regarding installation requirements, multi-ply fastening details, beam strength values, and code approvals
 Damaged Beams must not be used
 Design assumes top edge is laterally restrained.
 Provide lateral support at bearing points to avoid lateral displacement and rotation

For flat roofs provide proper drainage to prevent ponding

This design is valid until 11/3/2024

Metsä Wood 301 Merritt 7 Building, 2nd Floor Norwalk, CT 06851 (800) 622-5850 www.metsawood.com/us

Manufacturer Info

Comtech, Inc. 1001 S. Reilly Road, Suite #639 Fayetteville, NC USA 28314 910-864-TRUS







Project:


Address: Gaston II (181035B) Date: 1/17/2023


Input by: Marshall Naylor Job Name: Gaston II (181035B)

Project #:

Window Hdr. Kerto-S LVL 1.750" X 14.000" 2-Ply - PASSED

Level: Level

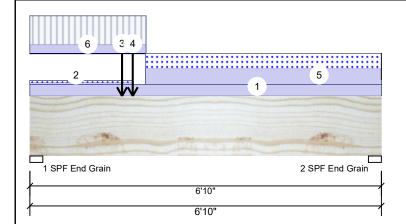

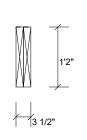

Page 1 of 2

Member Information

Type: Girder Plies: 2 Moisture Condition: Dry Deflection LL: 480 Deflection TL: 360 Importance: Normal - II Temperature: Temp <= 100°F Application: Floor Design Method: ASD **Building Code:** IBC 2012 Load Sharing: No Deck: Not Checked

Reactions UNPATTERNED Ib (Uplift)

Brg	Direction	Live	Dead	Snow	Wind	Const
1	Vertical	2861	3387	1990	0	0
2	Vertical	873	1906	1168	0	0

Analysis Results

Analysis	Actual	Location	Allowed	Capacity	Comb.	Case
Moment	11172 ft-lb	2'	31049 ft-lb	0.360 (36%)	D+0.75(L+S)	L
Unbraced	11172 ft-lb	2'	15767 ft-lb	0.709 (71%)	D+0.75(L+S)	L
Shear	6407 lb	1'5"	12021 lb	0.533 (53%)	D+0.75(L+S)	L
LL Defl inch	0.033 (L/2343)	2'7 5/8"	0.161 (L/480)	0.205 (20%)	0.75(L+S)	L
TL Defl inch	0.067 (L/1165)	2'8 7/8"	0.215 (L/360)	0.309 (31%)	D+0.75(L+S)	L

Bearings

Bearing Length Dir. Cap. React D/L lb Total Ld. Case Ld. Comb. 3387 / 3638 7025 L D+0.75(L+S) 1 - SPF 3.000" Vert End

Grain

2 - SPF 3.000" 1906 / 1531 3437 L D+0.75(L+S) Vert End Grain

Design Notes

- 1 Provide support to prevent lateral movement and rotation at the end bearings. Lateral support may also be required at the interior bearings by the building code.
- 2 Girders are designed to be supported on the bottom edge only.
- 3 Multiple plies must be fastened together as per manufacturer's details.
- 4 Top loads must be supported equally by all plies.
- 5 Top must be laterally braced at end bearings.
- 6 Bottom must be laterally braced at end bearings.

/ Lateral slende	erness ratio based on si	ngle ply width.									
ID	Load Type	Location	Trib Width	Side	Dead 0.9	Live 1	Snow 1.15	Wind 1.6	Const. 1.25	Comments	
1	Uniform			Тор	120 PLF	0 PLF	0 PLF	0 PLF	0 PLF	WALL	
2	Tie-In	0-0-0 to 2-0-0	1-0-0	Тор	20 PSF	0 PSF	20 PSF	0 PSF	0 PSF	2' ROOF	
3	Point	1-9-8		Тор	1040 lb	3115 lb	0 lb	0 lb	0 lb	F08	
	Bearing Length	0-3-8									

Top

Bearing Length 0-3-8

Point

Continued on page 2...

Handling & Installation

2-0-0

- LVI beams must not be cut or drilled
 Refer to manufacturer's product information
 regarding installation requirements, multi-ply
 fastening details, beam strength values, and code
 approvals
- Damaged Beams must not be used
- Design assumes top edge is laterally restrained
 Provide lateral support at bearing points to avoid
 lateral displacement and rotation

For flat roofs provide proper drainage to prevent ponding

0 lb

2385 lb

2385 lb

Metsä Wood 301 Merritt 7 Building, 2nd Floor Norwalk, CT 06851 (800) 622-5850 www.metsawood.com/us

Manufacturer Info

0 lb

Comtech, Inc. 1001 S. Reilly Road, Suite #639 Fayetteville, NC USA 28314 910-864-TRUS

0 lb C3





Calculated Structured Designs is responsible only of the structural adequacy of this component based on the design criteria and loadings shown. It is the responsibility of the customer and/or the contractor to ensure the component suitability of the intended application, and to verify the dimensions and loads.

Notes

4

- Dry service conditions, unless noted otherwise
 LVL not to be treated with fire retardant or corrosive
- This design is valid until 11/3/2024



Project:


Address: Gaston II (181035B) Date: 1/17/2023


Input by: Marshall Naylor Job Name: Gaston II (181035B)

Project #:

Window Hdr. **Kerto-S LVL** 1.750" X 14.000" 2-Ply - PASSED

Level: Level

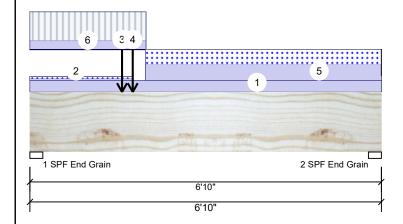

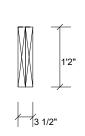

Page 2 of 2

Continued	from	nage	1
Conunuea	110111	paue	- 1

ID	Load Type	Location	Trib Width	Side	Dead 0.9	Live 1	Snow 1.15	Wind 1.6	Const. 1.25	Comments
5	Part. Uniform	2-3-0 to 6-10-0		Тор	160 PLF	0 PLF	160 PLF	0 PLF	0 PLF	C2
6	Part. Uniform	2-3-0 to 0-0-0		Тор	97 PLF	300 PLF	0 PLF	0 PLF	0 PLF	F07
	Self Weight				11 PLF					

Notes

Calculated Structured Designs is responsible only of the structural adequacy of this component based on the design criteria and loadings shown. It is the responsibility of the customer and/or the contractor to ensure the component suitability of the intended application, and to verify the dimensions and loads.

Dry service conditions, unless noted otherwise
 LVL not to be treated with fire retardant or corrosive

Handling & Installation

Handling & Installation

1. IVI. beams must not be cut or drilled

2. Refer to manufacturer's product information regarding installation requirements, multi-ply fastening details, beam strength values, and code approvals

3. Damaged Beams must not be used

4. Design assumes top edge is laterally restrained

5. Provide lateral support at bearing points to avoid lateral displacement and rotation

For flat roofs provide proper drainage to prevent ponding

Metsä Wood 301 Merritt 7 Building, 2nd Floor Norwalk, CT 06851 (800) 622-5850 www.metsawood.com/us

Manufacturer Info

Comtech, Inc. 1001 S. Reilly Road, Suite #639 Fayetteville, NC USA 28314 910-864-TRUS



This design is valid until 11/3/2024





Project:


Address: Gaston II (181035B) Date: 1/17/2023


Input by: Marshall Naylor Job Name: Gaston II (181035B)

Project #:

1.750" X 11.875" GDH-3 **Kerto-S LVL** 2-Ply - PASSED

Level: Level

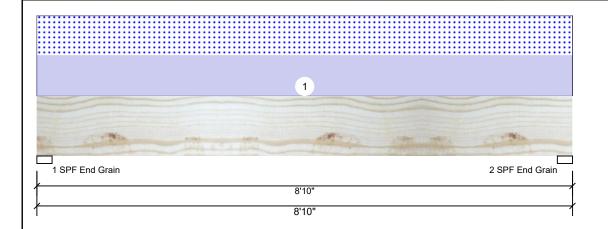

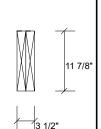

Page 1 of 1

m /	 	Info	 :-	

Type: Girder Plies: 2 Moisture Condition: Dry Deflection LL: 480 Deflection TL: 360 Importance: Normal - II Temperature: Temp <= 100°F Application: Floor Design Method: ASD **Building Code:** IBC 2012 Load Sharing: No

Deck: Not Checked

Reactions UNPATTERNED Ib (Uplift)

Brg	Direction	Live	Dead	Snow	Wind	Const
1	Vertical	0	1145	1104	0	0
2	Vertical	0	1145	1104	0	0

Analysis Results

Analysis	Actual	Location	Allowed	Capacity	Comb.	Case
Moment	4554 ft-lb	4'5"	22897 ft-lb	0.199 (20%)	D+S	L
Unbraced	4554 ft-lb	4'5"	10675 ft-lb	0.427 (43%)	D+S	L
Shear	1627 lb	1'2 7/8"	10197 lb	0.160 (16%)	D+S	L
LL Defl inch	0.036 (L/2845)	4'5 1/16"	0.211 (L/480)	0.169 (17%)	S	L
TL Defl inch	0.073 (L/1397)	4'5 1/16"	0.282 (L/360)	0.258 (26%)	D+S	L

Bearings

Bearing	Length	Dir.	Сар.	React D/L lb	Total	Ld. Case	Ld. Comb.
1 - SPF End Grain	3.000"	Vert	26%	1145 / 1104	2249	L	D+S
2 - SPF End Grain	3.000"	Vert	26%	1145 / 1104	2249	L	D+S

Design Notes

- 1 Provide support to prevent lateral movement and rotation at the end bearings. Lateral support may also be required at the interior bearings by the building code.
- 2 Girders are designed to be supported on the bottom edge only.
- 3 Multiple plies must be fastened together as per manufacturer's details.
- 4 Top loads must be supported equally by all plies.
- 5 Top must be laterally braced at end bearings.
- 6 Bottom must be laterally braced at end bearings.
- 7 Lateral slenderness ratio based on single ply width.

ID Load Type Trib Width Side Dead 0.9 Comments Location Live 1 Snow 1.15 Wind 1.6 Const. 1.25 1 Uniform Top 250 PLF 0 PLF 250 PLF 0 PLF 0 PLF

> Self Weight 9 PLF

Notes

Calculated Structured Designs is responsible only of the structural adequacy of this component based on the design criteria and loadings shown, It is the responsibility of the customer and/or the contractor to ensure the component suitability of the intended application, and to verify the dimensions and loads.

- Dry service conditions, unless noted otherwise
 LVL not to be treated with fire retardant or corrosive

Handling & Installation

LVL beams must not be cut or drilled Refer to manufacturer's product information regarding installation requirements, multi-ply fastening details, beam strength values, and code approvals Damaged Beams must not be used

Design assumes top edge is laterally restrained
Provide lateral support at bearing points to avoid
lateral displacement and rotation

For flat roofs provide proper drainage to prevent ponding

This design is valid until 11/3/2024

Metsä Wood 301 Merritt 7 Building, 2nd Floor Norwalk, CT 06851 (800) 622-5850 www.metsawood.com/us

Manufacturer Info

Comtech, Inc. 1001 S. Reilly Road, Suite #639 Fayetteville, NC USA 28314 910-864-TRUS



