

Trenco 818 Soundside Rd Edenton, NC 27932

Re: 4008688

GREAT SOUTHERN HOMES - SONOMA II B - A2 @ JOINT 4 PLATE REPAIR

The truss drawing(s) referenced below have been prepared by Truss Engineering Co. under my direct supervision based on the parameters provided by Stock Building Supply.

Pages or sheets covered by this seal: T34288905 thru T34288905

My license renewal date for the state of North Carolina is December 31, 2024.

North Carolina COA: C-0844



June 26,2024

ORegan, Philip

IMPORTANT NOTE: The seal on these truss component designs is a certification that the engineer named is licensed in the jurisdiction(s) identified and that the designs comply with ANSI/TPI 1. These designs are based upon parameters shown (e.g., loads, supports, dimensions, shapes and design codes), which were given to MiTek or TRENCO. Any project specific information included is for MiTek's or TRENCO's customers file reference purpose only, and was not taken into account in the preparation of these designs. MiTek or TRENCO has not independently verified the applicability of the design parameters or the designs for any particular building. Before use, the building designer should verify applicability of design parameters and properly incorporate these designs into the overall building design per ANSI/TPI 1, Chapter 2.

Job	Truss	Truss Type	Qty	Ply	GREAT SOUTHERN HOMES - SONOMA II B - A2 @
4008688	A2	Attic	6	1	T34288905 Job Reference (optional)

Builders FirstSource (Middlesex, NC), Middlesex, NC - 27557,

Run: 8 98 S 8 63 Jun 17 2024 Print: 8 630 S Jun 17 2024 MiTek Industries, Inc. Wed Jun 26 13:08:36

Page: 1 ID:NnN70zjCSnDjOgimb8ju_dyS8Hu-RfC?PsB70Hq3NSgPqnL8w3ulTXbGKWrCDoi7J4zJC?f

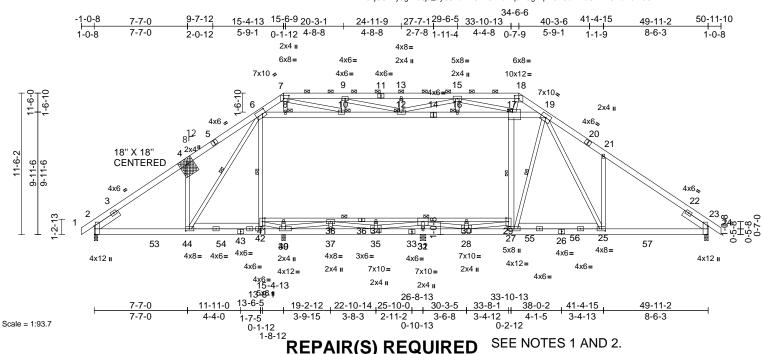


Plate Offsets (X, Y): [2:0-8-3,Edge], [6:0-3-8,0-4-0], [7:0-5-4,0-3-0], [17:0-3-12,0-2-8], [18:0-4-0,0-2-13], [23:0-8-3,Edge], [25:0-3-8,0-2-0], [29:Edge,0-2-4], [44:0-3-8,0-2-0]

Loading	(psf)	Spacing	2-0-0	CSI		DEFL	in	(loc)	l/defl	L/d	PLATES	GRIP
TCLL (roof)	20.0	Plate Grip DOL	1.00	TC	0.62	Vert(LL)	-0.15	25-27	>999	240	MT20	244/190
Snow (Ps/Pf)	12.1/20.0	Lumber DOL	1.15	BC	0.99	Vert(CT)	-0.28	25-27	>978	180		
TCDL	10.0	Rep Stress Incr	YES	WB	0.91	Horz(CT)	0.06	23	n/a	n/a		
BCLL	0.0*	Code	IRC2015/TPI2014	Matrix-MS		Attic	0.08	29-41	>999	360		
BCDL	10.0										Weight: 542 lb	FT = 20%

LUMBER TOP CHORD 2x6 SP No.2

BOT CHORD 2x6 SP No.2 *Except* 41-36,36-29:2x4 SP

No.2

WEBS 2x4 SP No.3 *Except*

6-42,39-38,35-31,31-28,28-29:2x4 SP No.2,

17-27:2x6 SP No.2

SLIDER Left 2x6 SP No.2 -- 2-5-0, Right 2x6 SP No.2

-- 2-5-0 **BRACING**

TOP CHORD Structural wood sheathing directly applied or

3-7-7 oc purlins, except

2-0-0 oc purlins (4-6-12 max.): 7-18, 6-19. **BOT CHORD** Rigid ceiling directly applied or 10-0-0 oc

bracing, Except:

5-2-3 oc bracing: 32-35

5-1-3 oc bracing: 28-32.

10-0-0 oc bracing: 29-41

WEBS 6-41, 17-29, 19-27, 6-44 1 Row at midpt

1 Brace at Jt(s): 8, **JOINTS**

12, 10, 16, 17

REACTIONS (size) 2=0-3-8, 23=0-3-8, 32=0-5-8,

39=0-3-8

Max Horiz 2=382 (LC 13)

Max Uplift 2=-474 (LC 15), 23=-585 (LC 15),

39=-137 (LC 14)

2=1653 (LC 2), 23=1747 (LC 3), Max Grav

32=1969 (LC 21), 39=1192 (LC 27) (lb) - Maximum Compression/Maximum

Tension

TOP CHORD 1-2=0/58, 2-4=-2149/890, 4-6=-2083/1132,

> 6-7=-1108/686, 7-9=-2074/1328, 9-13=-2436/1462, 13-15=-2436/1462, 15-18=-1196/241, 18-19=-1231/255,

19-21=-2240/1130, 21-23=-2327/875, 23-24=0/58, 6-8=-932/438, 8-10=-920/432,

10-12=-879/713, 12-16=-475/646, 16-17=-475/646, 17-19=-816/832

2-44=-536/1688, 42-44=-372/1532,

39-42=-385/1471, 37-39=0/1574, 35-37=0/1574, 32-35=-1661/91, 28-32=-1661/91, 27-28=-510/1733

25-27=-343/1574, 23-25=-510/1828, 40-41=-330/788, 38-40=-330/789,

34-38=-621/1147, 31-34=-621/1147, 30-31=-153/717, 29-30=-153/717

4-44=-429/443, 21-25=-487/450, 41-42=-129/355, 6-41=-378/485,

27-29=-333/623, 17-29=-435/752 19-27=-564/312, 19-25=-436/796,

6-44=-486/641, 7-8=-53/97, 12-13=-245/179,

9-10=-419/262. 15-16=-13/29.

7-10=-794/1278, 9-12=-242/409, 12-15=-525/436. 39-41=-870/439.

39-40=-439/0, 31-32=-1672/0, 38-39=-939/136, 37-38=-36/87

35-38=-920/209, 34-35=-425/0, 31-35=0/2417. 28-31=-146/2529.

28-30=-419/0, 28-29=-948/299, 15-17=-1344/1079, 17-18=-3/625

NOTES

BOT CHORD

WEBS

Repair Condition: Missing or damaged plate(s) on one side(s) of truss at joint(s) 4.

- Attach 18"H X 18"W X 1/2" Plywood or OSB (15/32) APA Rated Sheathing 32/16 Exposure 1) gusset to both sides of truss at joint 4 with 8d (0.131"x2.5") nails from each face, driven through both sheets of plywood. Connected together as follows: 2x6 - 4 rows 0-4-0 o.c., 2x4 - 3 rows 0-4-0 o.c. Minimum 0-3-0 end distance.
- 3) N/A
- Unbalanced roof live loads have been considered for 4) this design.
- Wind: ASCE 7-10; Vult=130mph (3-second gust) Vasd=103mph; TCDL=6.0psf; BCDL=6.0psf; h=30ft; Cat. II; Exp C; Enclosed; MWFRS (envelope) exterior zone and C-C Exterior (2) zone; cantilever left and right exposed; end vertical left and right exposed; C-C for members and forces & MWFRS for reactions shown; Lumber DOL=1.60 plate grip DOL=1.33



ontinued on page 2

FORCES

Verify design parameters and READ NOTES ON THIS AND INCLUDED MITEK REFERENCE PAGE MII-7473 rev. 1/2/2023 BEFORE USE Design valid for use only with MiTek@ connectors. This design is based only upon parameters shown, and is for an individual building component, not

a truss system. Before use, the building designer must verify the applicability of design parameters and properly incorporate this design into the overal building design. Bracing indicated is to prevent buckling of individual truss web and/or chord members only. Additional temporary and permanent bracing is always required for stability and to prevent collapse with possible personal injury and property damage. For general guidance regarding the fabrication, storage, delivery, erection and bracing of trusses and truss systems, see ANSI/TP11 Quality Criteria and DSB-22 available from Truss Plate Institute (www.tpinst.org) and BCSI Building Component Safety Information available from the Structural Building Component Association (www.sbcacomponents.com)



Edenton, NC 27932

Ī	Job	Truss	Truss Type	Qty	Ply	GREAT SOUTHERN HOMES - SONOMA II B - A2 @
	4008688	A2	Attic	6	1	T34288905 Job Reference (optional)

Builders FirstSource (Middlesex, NC), Middlesex, NC - 27557.

Run: 8 98 S 8 63 Jun 17 2024 Print: 8 630 S Jun 17 2024 MiTek Industries Inc. Wed Jun 26 13:08:36 ID:NnN70zjCSnDjOgimb8ju_dyS8Hu-RfC?PsB70Hq3NSgPqnL8w3ulTXbGKWrCDoi7J4zJC?f

Page: 2

- ** TCLL: ASCE 7-10: Pr=20.0 psf (roof live load: Lumber DOL=1.15 Plate DOL=1.00); Pf=20.0 psf (flat roof snow); Ps= varies (min. roof snow=12.1 psf Lumber DOL=1.15 Plate DOL=1.00) see load cases; Category II; Exp C; Fully Exp.; Ct=1.10; Unobstructed slippery surface
- Roof design snow load has been reduced to account for slope.
- 8) This truss has been designed for greater of min roof live load of 12.0 psf or 2.00 times flat roof load of 20.0 psf on overhangs non-concurrent with other live loads.
- Provide adequate drainage to prevent water ponding.
- 10) This truss has been designed for a 10.0 psf bottom chord live load nonconcurrent with any other live loads.
- * This truss has been designed for a live load of 20.0psf on the bottom chord in all areas where a rectangle 3-06-00 tall by 2-00-00 wide will fit between the bottom chord and any other members, with BCDL = 10.0psf.
- 12) Ceiling dead load (5.0 psf) on member(s). 6-7; Wall dead load (5.0psf) on member(s).6-41, 17-29
- 13) Bottom chord live load (40.0 psf) and additional bottom chord dead load (10.0 psf) applied only to room. 40-41, 38-40, 34-38, 31-34, 30-31, 29-30
- 14) All bearings are assumed to be SP No.2 crushing capacity of 565 psi.
- 15) Provide mechanical connection (by others) of truss to bearing plate capable of withstanding 474 lb uplift at joint 2, 137 lb uplift at joint 39 and 585 lb uplift at joint
- 16) This truss is designed in accordance with the 2015 International Residential Code sections R502.11.1 and R802.10.2 and referenced standard ANSI/TPI 1.
- 17) Graphical purlin representation does not depict the size or the orientation of the purlin along the top and/or bottom chord.
- 18) Attic room checked for L/360 deflection.

LOAD CASE(S) Standard

Dead + Snow (balanced): Lumber Increase=1.15, Plate Increase=1.00

Uniform Loads (lb/ft)

Vert: 1-6=-44, 6-7=-54, 7-18=-60, 18-19=-44, 19-24=-44, 45-49=-20, 29-41=-40 Drag: 6-41=-10. 17-29=-10

Symbols

PLATE LOCATION AND ORIENTATION



Center plate on joint unless x, y offsets are indicated.
Dimensions are in ft-in-sixteenths.
Apply plates to both sides of truss and fully embed teeth.



For 4 x 2 orientation, locate plates 0- ¹/16" from outside edge of truss.

₹

This symbol indicates the required direction of slots in connector plates.

* Plate location details available in MiTek software or upon request.

PLATE SIZE

4 × 4


The first dimension is the plate width measured perpendicular to slots. Second dimension is the length parallel to slots.

LATERAL BRACING LOCATION



Indicated by symbol shown and/or by text in the bracing section of the output. Use T or I bracing if indicated.

BEARING

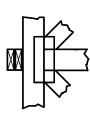

Indicates location where bearings (supports) occur. Icons vary but reaction section indicates joint number/letter where bearings occur. Min size shown is for crushing only.


Industry Standards:

National Design Specification for Metal Plate Connected Wood Truss Construction Design Standard for Bracing.

Building Component Safety Information, Guide to Good Practice for Handling, Installing, Restraining & Bracing of Metal Plate Connected Wood Trusses.

ANSI/TPI1: DSB-22:

Numbering System

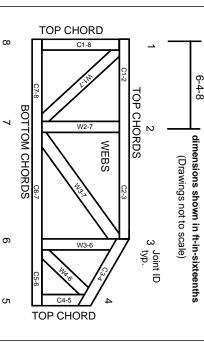

JOINTS ARE GENERALLY NUMBERED/LETTERED CLOCKWISE AROUND THE TRUSS STARTING AT THE JOINT FARTHEST TO THE LEFT.

CHORDS AND WEBS ARE IDENTIFIED BY END JOINT NUMBERS/LETTERS.

Product Code Approvals

ICC-ES Reports:

ESR-1988, ESR-2362, ESR-2685, ESR-3282 ESR-4722, ESL-1388

Design General Notes

Trusses are designed for wind loads in the plane of the truss unless otherwise shown.

Lumber design values are in accordance with ANSI/TPI 1 section 6.3 These truss designs rely on lumber values established by others.

© 2023 MiTek® All Rights Reserved

MiTek



MiTek Engineering Reference Sheet: MII-7473 rev. 1/2/2023

▲ General Safety Notes

Failure to Follow Could Cause Property Damage or Personal Injury

- Additional stability bracing for truss system, e.g. diagonal or X-bracing, is always required. See BCSI
- Truss bracing must be designed by an engineer. For wide truss spacing, individual lateral braces themselves may require bracing, or alternative Tor I bracing should be considered.
- Never exceed the design loading shown and never stack materials on inadequately braced trusses.

ω

- Provide copies of this truss design to the building designer, erection supervisor, property owner and all other interested parties.
- Cut members to bear tightly against each other.

'n

- Place plates on each face of truss at each joint and embed fully. Knots and wane at joint locations are regulated by ANSI/TPI 1.
- Design assumes trusses will be suitably protected from the environment in accord with ANSI/TPI 1.
- Unless otherwise noted, moisture content of lumber shall not exceed 19% at time of fabrication.

œ

Unless expressly noted, this design is not applicable for use with fire retardant, preservative treated, or green lumber.

9

- Camber is a non-structural consideration and is the responsibility of truss fabricator. General practice is to camber for dead load deflection.
- Plate type, size, orientation and location dimensions indicated are minimum plating requirements.
- Lumber used shall be of the species and size, and in all respects, equal to or better than that specified.
- Top chords must be sheathed or purlins provided at spacing indicated on design.
- Bottom chords require lateral bracing at 10 ft. spacing, or less, if no ceiling is installed, unless otherwise noted.
- 15. Connections not shown are the responsibility of others.
- Do not cut or alter truss member or plate without prior approval of an engineer.
- Install and load vertically unless indicated otherwise.
- Use of green or treated lumber may pose unacceptable environmental, health or performance risks. Consult with project engineer before use.
- Review all portions of this design (front, back, words and pictures) before use. Reviewing pictures alone is not sufficient.
- Design assumes manufacture in accordance with ANSI/TPI 1 Quality Criteria.
- 21. The design does not take into account any dynamic or other loads other than those expressly stated.