

Client: Project:

WEAVER DEVELOPMENT

Date: 8/17/2025 Input by:

LENNY NORRIS Job Name: BELLHAVEN

Project #:

GDH 12' FL Kerto-S LVL 1.750" X 11.875" 2-Ply - PASSED

Application:

Design Method:


Building Code:

Load Sharing:

Deck:

Address:

Level: Level

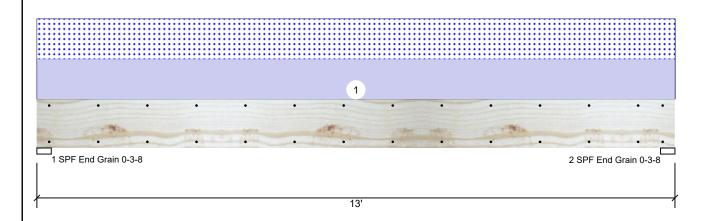

Floor

ASD

No

IRC 2018

Not Checked



Page 1 of 2

Member Information

Type: Girder Plies: 2 Moisture Condition: Dry Deflection LL: 480 Deflection TL: 360 Importance: Normal - II

Temperature: Temp <= 100°F

Reactions UNPATTERNED Ib (Uplift)

Brg	Direction	Live	Dead	Snow	Wind	Const
1	Vertical	0	1445	1385	0	0
2	Vertical	0	1445	1385	0	0

Bearings

Bearing Length Dir. Cap. React D/L lb Total Ld. Case Ld. Comb. 1 - SPF 3.500" 1445 / 1385 D+S Vert End Grain 2 - SPF 3.500" 1445 / 1385 2829 L D+S Vert End Grain

Analysis Results

Analysis	Actual	Location	Allowed	Capacity	Comb.	Case
Moment	8557 ft-lb	6'6"	22897 ft-lb	37%	D+S	L
Unbraced	8557 ft-lb	6'6"	8560 ft-lb	100%	D+S	L
Shear	2271 lb	1'3 3/8"	10197 lb	22%	D+S	L
LL Defl inch	0.133 (L/1132)	6'6"	0.314 (L/480)	42%	S	L
TL Defl inch	0.272 (L/554)	6'6"	0.418 (L/360)	65%	D+S	L

Design Notes

- 1 Provide support to prevent lateral movement and rotation at the end bearings.
- 2 Fasten all plies using 2 rows of 10d Box nails (.128x3") at 12" o.c. Maximum end distance not
- 3 Refer to last page of calculations for fasteners required for specified loads.
- 4 Girders are designed to be supported on bottom edge only and across their full width.
- 5 Top loads must be supported equally by all plies.
- 6 Top must be laterally braced at a maximum of 11'2 1/16" o.c.
- 7 Bottom must be laterally braced at end bearings.
- 8 Lateral slenderness ratio based on single ply width.

ID	Load Type	Location	Trib Width	Side	Dead 0.9	Live 1	Snow 1.15	Wind 1.6	Const. 1.25	Comments
1	Uniform			Тор	213 PLF	0 PLF	213 PLF	0 PLF	0 PLF	G1 TRUSS
	Self Weight				9 PLF					

Notes

Calculated Structured Designs is responsible only of the structural adequacy of this component based on the design criteria and loadings shown. It is the responsibility of the customer and/or the contractor to ensure the component suitability of the intended application, and to verify the dimensions and loads.

- Dry service conditions, unless noted otherwise
 LVL not to be treated with fire retardant or corrosive

- Handling & Installation
- LVL beams must not be cut or drilled Refer to manufacturer's product information regarding installation requirements, multi-ply fastening details, beam strength values, and code approvals Damaged Beams must not be used
- Design assumes top edge is laterally restrained
 Provide lateral support at bearing points to avoid
 lateral displacement and rotation

For flat roofs provide proper drainage to prevent ponding

Metsä Wood 301 Merritt 7 Building, 2nd Floor Norwalk, CT 06851 (800) 622-5850 www.metsawood.com/us

Manufacturer Info



This design is valid until 2/28/2028

isDesign

WEAVER DEVELOPMENT Client:


Project: Address: Date: 8/17/2025

Input by: LENNY NORRIS Job Name: BELLHAVEN

Page 2 of 2

Project #:

Kerto-S LVL GDH 12' FL 1.750" X 11.875" 2-Ply - PASSED Level: Level

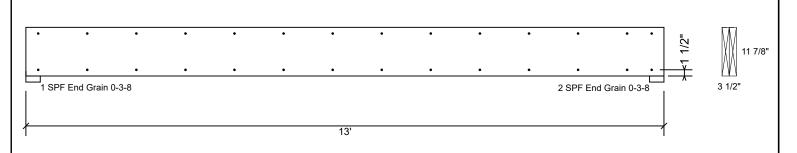

Multi-Ply Analysis

Fasten all plies using 2 rows of 10d Box nails (.128x3") at 12" o.c.. Maximum end distance not to exceed 6".

Capacity	0.0 %
Load	0.0 PLF
Yield Limit per Foot	163.7 PLF
Yield Limit per Fastener	81.9 lb.
См	1
Yield Mode	IV
Edge Distance	1 1/2"
Min. End Distance	3"
Load Combination	
Duration Factor	1.00

Notes

Calculated Structured Designs is responsible only of the structural adequacy of this component based on the design criteria and loadings shown. It is the responsibility of the customer and/or the contractor to ensure the component suitability of the intended application, and to verify the dimensions and loads.

- Dry service conditions, unless noted otherwise
 LVL not to be treated with fire retardant or corrosive

Handling & Installation

- Handling & Installation

 1. IVI beams must not be cut or drilled

 2. Refer to manufacturer's product information regarding installation requirements, multi-ply fastening details, beam strength values, and code approvals

 3. Damaged Beams must not be used

 4. Design assumes top edge is laterally restrained

 5. Provide lateral support at bearing points to avoid lateral displacement and rotation
- For flat roofs provide proper drainage to prevent ponding

Metsä Wood 301 Merritt 7 Building, 2nd Floor Norwalk, CT 06851 (800) 622-5850 www.metsawood.com/us

Manufacturer Info



This design is valid until 2/28/2028