

FIELD REPORT

Project: Lakeside Storage Building B & G Client: The Imperial Group Date: 08/19/26
City: Angier Forman: Macon Contractor: The Imperial Group
Temperature: 74 Weather Conditions: Sunny Number of Trips: 1
Personnel: Ken P Notified Macon of The Imperial Group of results
1st Trip Arrived: 4:30 pm Left: 6:30 am 2nd Trip Arrived: _____ Left: _____

REMARKS


TME personnel arrived onsite as requested by The Imperial Group contractor. Contractor was onsite. Tech performed concrete testing for footing and slab of Building G. Tech made concrete sample cylinders for compression strength testing. Samples were stored onsite for overnight curing. Tech will return tomorrow to retrieve concrete samples and deliver to lab for additional testing. Results will be shared with the client.



Signature: _____

A handwritten signature in black ink, appearing to be 'Ken P', written over a horizontal line.

TME's presence on site is to perform specific services limited to that scheduled by others based on the understanding of our agreement with our client. This report is not an acceptance or approval of site activities. Test results and inspections are representative of our observations only while onsite at that specific time and location and may vary at other locations. The frequency of testing is based on timely scheduling of work by others and properly conveying progress of work in progress. At no time will TME be responsible for Safety considerations for other parties on the site.

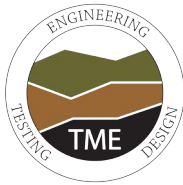


FIELD REPORT ATTACHMENTS

Project: Lakeside Storage Building B & G Client: The Imperial Group Date: 08/19/26



All locations should be considered approximate and were not surveyed.

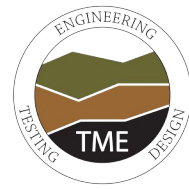

CONCRETE FIELD REPORT

Project: Lakeside Storage Building B & G Client: The Imperial Group Date: 08/19/26
 City: Angier Arrived On-Site: 4:30 pm Left Site: 6:30 am
 Temperature: 74 Weather Conditions: Sunny Number of Trips: 1
 Material(s) Tested: ☒ Slab ☐ Foundation ☐ Wall ☐ Masonry ☒ Other: Footing
 Personnel: Ken P Notified Macon of The Imperial Group of results
 Concrete Supplier: Concrete Service Co., Inc. Specified Strength: 3,000 psi Specified Slump: 6.5 inches
 Concrete Strength on ticket: 3,000 psi

TEST DATA

Truck No.	Batch Time	Plant No.	Ticket No.	Size of Load	Sample	Slump (in)	Air %	Unit Wt. (pcf)	H2O Added (gallons)	Concrete Temp.	No. of Test Samples	Daily Set No.
6,005	04:42	15	1521280	10.00	05:22	8.0	2.00	145.08	0.00	72	5	1

Daily Set No.	Sample Type	Specified Strength	Detailed Location
1	Concrete	3,000 psi	Building G
		psi	
		psi	
		psi	
		psi	
		psi	

Super P was added to Concrete Mix

The above report is the field rendition of the author only and subject to review