



**ECS Southeast, LLC**

6151 Raeford Road, Suite A  
Fayetteville, NC 28304  
9104013288  
9103230539

**LETTER OF TRANSMITTAL**

November 17, 2023  
Phalanx Crossfit

Cameron, NC 28326  
ATTN: Mike Lancaster

RE: **Phalanx Crossfit**  
ECS Job # **33:6659**

Permits:  
Location: **2659 NC 87 S**  
**Cameron, NC 28326**


Field Reports       For your use       As requested

CC:

ENCL: Field Report # 1      11/15/2023

Jack Cowsert, P.E.  
Office Manager

Aaron Kyle Adair  
Team Leader

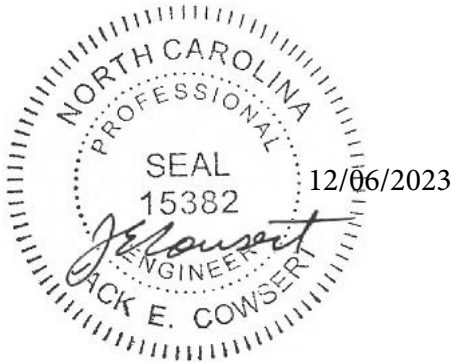

*Disclaimer*

1. This report (and any attachments) shall not be reproduced except in full without prior written approval of ECS.
2. The information in this report relates only to the activities performed on the report date.
3. Where appropriate, this report includes statements as to compliance with applicable project drawings, and specifications for the activities, performed on this report date.
4. Incomplete or non-conforming work will be reported for future resolution.
5. The results of samples and/or specimens obtained or prepared for subsequent laboratory testing will be presented in separate reports/documents.



ECS Southeast, LLC  
6151 Raeford Road, Suite A  
Fayetteville, NC 28304  
(910) 401-3288 [Phone]  
(910) 323-0539 [Fax]

## FIELD REPORT

Project **Phalanx Crossfit**  
Location **Cameron, NC**  
Client **Phalanx Crossfit**  
Contractor **None Listed**

Project No. **33:6659**  
Report No. **1**  
Day & Date **Wednesday 11/15/2023**  
Weather **68 °/ Cloudy**  
On-Site Time **3.25**  
Lab Time **0.00**  
Travel Time\* **0.00**  
Total **3.25**  
Re Obs Time **0.00**

Remarks

Trip Charges*	Tolls/Parking*	Mileage*	Time of Arrival	Departure
Chargeable Items			<b>1:15P</b>	<b>4:30P</b>

\* Travel time and mileage will be billed in accordance with the contract.

**Summary of Services Performed (field test data, locations, elevations & depths are estimates) & Individuals Contacted.**

An ECS representative arrived on site, as requested, to check the bearing capacity of soils via hand auger/DCP method (ASTM STP-399) for foundation footings. Please see the attached sketch for location details.

A total of 6 hand auger/DCP evaluations were performed to a depth of approximately 3 feet below the current sub grade elevation. Test results indicated that the materials in place (at the locations and elevations tested) did appear to be suitable to support the design bearing capacity 2,000 psf.

ECS will return, as requested, to perform additional services.



## Report of Spread Footing - Foundation Observations

**Project:** Phalanx Crossfit  
**Location:** 2659 NC 87 S  
 Cameron - Moore - NC - 28326  
**Contractor:** None Listed

**Project No.:** 33:6659  
**Day/Date:** 11/15/2023

Footing Number	Location	Size (W x H x L)		Footing Bottom Elevation		Description of Steel Placed	Description of Subgrade Material	Required Blow Counts		Design Bearing Pressure
		Design	Actual	Design **	Depth of Undercut (in)			# of Blows / Increment		
1	S.W Corner	x x	x x	N/A	N/A		(0)-3 Orange Gray Sand	6	(0)8, 14, 18(-1)20, 21, 23(-2)15, 8, 9(-3)13, 10, 13	2000
2	West Side	x x	x x	N/A	N/A		(0)-1 Orange Sand(-2)/-3 Orange Red Clay Sand	6	(0)20, 25+(-1)17, 19, 19(-2)20, 18, 16(-3)16, 12, 10	2000
3	North West Side	x x	x x	N/A	N/A		(0)-3 Orange Sand	6	(0)11, 16, 15(-1)10, 12, 13 (-2)17, 20, 19(-3)11, 14, 16	2000
4	North East Corner	x x	x x	N/A	N/A		(0)-3 Orange Sand	6	(0)4, 6, 7(-1)13, 12, 12(-2)13, 10, 12	2000
5	East Side	x x	x x	N/A	N/A		(0)-1 Orange Sand(-2)/Tan Brown Sand(-3)/Black Sand	6	(0)17, 25+(-1)20, 25+(-2)20, 16, 18(-3)11, 11, 11	2000
5	South East Corner	x x	x x	N/A	N/A		(0)-2 Orange Sand	6	(0)24, 22, 25+(-1) 25+(-2) HAR	2000

\*\* SGE: Subgrade Elevation to be determined by surveyor.

By: George Pate Oxendine Jr.

ECS Southeast, LLC

WO: 75228

