DEPARTMENT OF HEALTH AND HUMAN SERVICES DIVISION OF PUBLIC HEALTH, ENVIRONMENTAL HEALTH SECTION ON-SITE WATER PROTECTION BRANCH

	Page 1 of
PROPERTY ID #:	
COUNTY:	

SOIL/SITE EVALUATION for ON-SITE WASTEWATER SYSTEM

OWNE	R:	Taylor		(Complete all f	ields in full)		DAT	E EVALU	ATED:	
ADDR	ESS: 355 a	8 bld 0	15 421 PR	OPOSED DESIGN I	ELOW (0400):	480 6	PD PROPI	ERTY SIZE	2.	
LOCA'	TION OF SITE:		Same	OI OSED DESIGN I	LO 11 (.0400).	700 (RTY REC		
	R SUPPLY:		gle Family Well			er			SETBACK	
EVAL	JATION METH	OD: (Auge	r Boring Pit	Cut TY	PE OF WASTE	WATER:	Domesti	ic High	Strength	IPWW
P R O F			SOIL MORPHOLOGY		ОТНЕК	R PROFIL	E FACTO	ORS		
L E #	.0502 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	.0503 STRUCTURE/ TEXTURE	.0503 CONSISTENCE/ MINERALOGY	.0504 SOIL WETNESS/ COLOR	.0505 SOIL DEPTH	.0506 SAPRO CLASS	.0507 RESTR HORIZ	.0509 PROFILE CLASS & LTAR*	.0503 SLOPE CORRE CTION
1	L	26-48	Ser Ser	Fr/NSP/NXP	10 YR 7/2	. >4g [']	_		5	
	2-5%				≥3 6 "					
2	L	26-48	LS Sc1	Fr/NSp/NX8 Fr/85p/5xP	104R6/2	>48''		_	5.5	
	2-52				<u> </u>		an an			
3	L z-5%	20-48	LS SCI	Filssplace	10 yR7h = 36"	>48"	-		5	
1										
4										

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM	
Available Space (.0508)			SITE CLASSIFICATION (.0509):
System Type(s)	25% red	252 12	EVALUATED BY: NA REHS
Site LTAR	.5	.5	OTHER(S) PRESENT: $A \cdot \omega$
Maximum Trench Depth	24"	24"	
Comments:			

LEGEND


LANDSCAPE POSITION	SOIL GROUP	SOIL TEXTURE	CONVENTIONAL LTAR (gpd/ft²)	SAPROLITE LTAR (gpd/ft²)	LPP LTAR (gpd/ft²)	MINERALOGY/ CONSISTENCE		STRUCTURE		
CC (Concave slope)		S (Sand)		0.6 - 0.8		MOIST	WET	SG (Single grain)		
CV (Convex Slope)	'	LS (Loamy sand)	0.8 - 1.2	0.5 -0.7	0.4 -0.6	Lo (Loose)	NS (Non-sticky)	M (Massive)		
D (Drainage way)	11	SL (Sandy loam)	0.6 - 0.8	0.4 -0.6	0.3 - 0.4	VFR (Very friable)	SS (Slightly sticky)	GR (Granular)		
FP (Flood plain)		L (Loam)		0.2 - 0.4		FR (Friable)	S (Sticky)	SBK (Subangular blocky)		
FS (Foot slope)	III	SiL (Silt loam)		0.1 - 0.3		FI (Firm)	VS (Very sticky)	ABK (Angular blocky)		
H (Head slope)		SCL (Sandy clay loam)		0.05 - 0.15**		VFI (Very firm)	NP (Non-plastic)	PR (Prismatic)		
L (Linear Slope)		CL (Clay loam)	0.3 - 0.6		0.15 - 0.3	EFI (Extremely firm)	SP (Slightly plastic)	PL (Platy)		
N (Nose slope)		SiCL (Silty clay loam)			ý.		P (Plastic)			
R (Ridge/summit)		Si (Silt)		None		,	VP (Very plastic)			
S (Shoulder slope)		SC (Sandy clay)						SEXP (Slightly expansive)		
T (Terrace)	IV	SiC (Silty clay)	0.1 - 0.4		0.05 - 0.2	EXP (Expansive)				
TS (Toe Slope)		C (Clay)	.5					•		
	1	O (Organic)	None							

HORIZON DEPTH In inches below natural soil surface In inches from land surface DEPTH OF FILL RESTRICTIVE HORIZON Thickness and depth from land surface

S(suitable) or U(unsuitable); Evaluation of saprolite shall be by pits. **SAPROLITE**

Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation SOIL WETNESS

CLASSIFICATION S (Suitable) or U (Unsuitable)

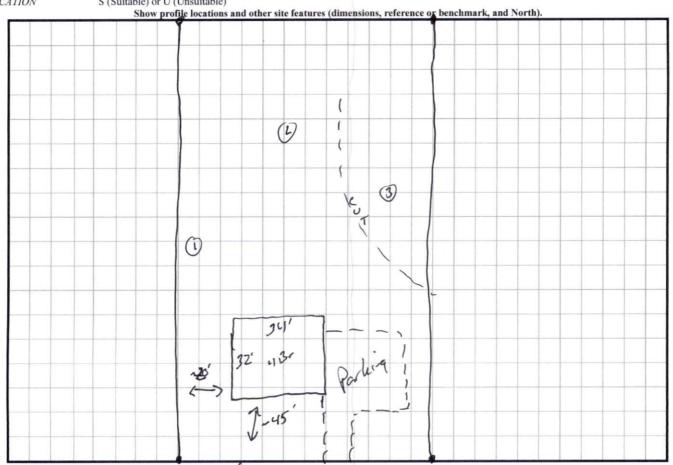

^{*} Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.

**Sandy clay loam saprolite can only be used with advanced pretreatment in accordance with 15A NCAC 18E .1200.