


SITE/SOIL EVALUATION FOR ON-SITE WASTEWATER

APPLICANT NAME _____

DATE _____

| FACTORS | | PROFILES | | | | | | | | | | | | |
|---------------------------|-------------|----------|-------|-------|-------|-------|-------|-------|---|---|----|--|--|--|
| | | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | | | |
| LANDSCAPE POSITION | .1940 | | | | | | | | | | | | | |
| SLOPE (%) | .1940 | | | | | | | | | | | | | |
| HORIZON 1 DEPTH | | 0-20 | 0-4 | 0-18 | 0-14 | 0-18 | 0-20 | 0-20 | | | | | | |
| Texture Group | .1941(A)(1) | SL | SL | SL | SL | SL | SL | SL | | | | | | |
| Consistence | .1941 | VFR | VFR | VFR | VFR | VFR | VFR | VFR | | | | | | |
| Structure | .1941(A)(2) | G | G | G | G | G | G | G | | | | | | |
| Mineralogy | .1941(A)(3) | NS/NP | NS/NP | NS/NP | NS/NP | NS/NP | NS/NP | NS/NP | | | | | | |
| HORIZON 2 DEPTH | | 20-30 | 4-32 | 18-30 | 14-30 | 18-24 | 20-32 | 20-32 | | | | | | |
| Texture Group | .1941(A)(1) | SC | FC | SC | SC | SC | SC | SC | | | | | | |
| Consistence | .1941 | FR | FR | FR | FR | FR | FR | FR | | | | | | |
| Structure | .1941(A)(2) | SBK | SBK | SBK | SBK | SBK | SBK | SBK | | | | | | |
| Mineralogy | .1941(A)(3) | SS/SP | SS/SP | SS/SP | SS/SP | SS/SP | SS/SP | SS/SP | | | | | | |
| HORIZON 3 DEPTH | | 20-30 | | 30" | 30" | 24-36 | 32-42 | 32-42 | | | | | | |
| Texture Group | .1941(A)(1) | SC | | PM | PM | SC | SC | SC | | | | | | |
| Consistence | .1941 | FR | | | | FR | FR | FR | | | | | | |
| Structure | .1941(A)(2) | SBK | | | | SBK | SBK | SBK | | | | | | |
| Mineralogy | .1941(A)(3) | SS/SP | | | | SS/SP | SS/SP | SS/SP | | | | | | |
| HORIZON 4 DEPTH | | 42" | | | | 36" | | | | | | | | |
| Texture Group | .1941(A)(1) | PM | | | | PM | | | | | | | | |
| Consistence | .1941 | | | | | | | | | | | | | |
| Structure | .1941(A)(2) | | | | | | | | | | | | | |
| Mineralogy | .1941(A)(3) | | | | | | | | | | | | | |
| SOIL WETNESS | .1942 | | 30" | | | | | | | | | | | |
| RESTRICTIVE HORIZON | .1944 | | | | | | | | | | | | | |
| SAPROLITE | .1943/1956 | | | | | | | | | | | | | |
| CLASSIFICATION | .1948 | P5 | P5 | P5 | P5 | P5 | P5 | P5 | | | | | | |
| LONG TERM ACCEPTANCE RATE | .1955 | .4 | .4 | .4 | .4 | .4 | .4 | .4 | | | | | | |

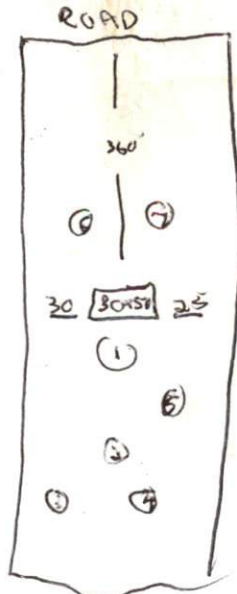

18" DEEP
5 80' LINES
ON CONTOUR
9' ON CENTER

REPAIR
PUMP TO CONVEN
SAME AS INITIAL