


SITE/SOIL EVALUATION FOR ON-SITE WASTEWATER

APPLICANT NAME

BUCCESS TIMBERLING LOT 5

DATE 7/9/07

FACTORS		PROFILES												
		1	2	3	4	5	6	7	8	9	10			
LANDSCAPE POSITION	.1940													
SLOPE (%)	.1940													
HORIZON 1 DEPTH		0-12"	0-10"	0-12"										
Texture Group	.1941(A)(1)	SL	LS	SL										
Consistence	.1941	VFR	VFR											
Structure	.1941(A)(2)	G	G											
Mineralogy	.1941(A)(3)	NS/MP	NS/MP											
HORIZON 2 DEPTH		12-36"	10-17"	12-24"										
Texture Group	.1941(A)(1)	SL/CL	LS	SL/LS										
Consistence	.1941	FR	VFR	VFR										
Structure	.1941(A)(2)	SSK	G	G										
Mineralogy	.1941(A)(3)	SS/SR	NS/MP											
HORIZON 3 DEPTH		36-48"	17-32"	24-48"										
Texture Group	.1941(A)(1)	PM	CL/CL	CL/PM										
Consistence	.1941		VFR											
Structure	.1941(A)(2)		G											
Mineralogy	.1941(A)(3)		NS/MP											
HORIZON 4 DEPTH			35-48"											
Texture Group	.1941(A)(1)		CL/AM											
Consistence	.1941													
Structure	.1941(A)(2)													
Mineralogy	.1941(A)(3)													
SOIL WETNESS	.1942													
RESTRICTIVE HORIZON	.1944													
SAPROLITE	.1943/1956													
CLASSIFICATION	.1948	PS	PS	PS										
LONG TERM ACCEPTANCE RATE	.1955	.3	.3											

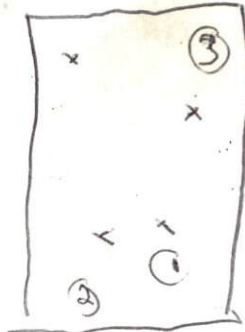

ROAD