



SITE/S EVALUATION FOR ON-SI WASTEWATER

APPLICANT NAME _____

DATE _____

FACTORS		PROFILES									
		1	2	3	4	5	6	7	8	9	10
LANDSCAPE POSITION	.1940										
SLOPE (%)	.1940										
HORIZON 1 DEPTH		0-3"	0-6"	0-3"	0-6"	0-7"					
Texture Group	.1941(A)(1)	SL	SL	SL	SL	SL					
Consistence	.1941	VFR	VFR	VFR	VFR	VFR					
Structure	.1941(A)(2)	G	C	G	G	G					
Mineralogy	.1941(A)(3)	NS/NP	NS/NP	NS/NP	NS/NP	NS/NP					
HORIZON 2 DEPTH		3"-30"	6"-30"	3"+	6"-32"	7-34"					
Texture Group	.1941(A)(1)	C	SL	C	SL	SL					
Consistence	.1941	FR	FR	FI/FR	FR	FR					
Structure	.1941(A)(2)	SBK	SBK	SBK	SBK	SBK					
Mineralogy	.1941(A)(3)	SS/SP	SS/SP	SIQ	SS/SP	SS/ST					
HORIZON 3 DEPTH											
Texture Group	.1941(A)(1)										
Consistence	.1941										
Structure	.1941(A)(2)										
Mineralogy	.1941(A)(3)										
HORIZON 4 DEPTH											
Texture Group	.1941(A)(1)										
Consistence	.1941										
Structure	.1941(A)(2)										
Mineralogy	.1941(A)(3)										
SOIL WETNESS	.1942	30"	28"	7"	32"	32"					
RESTRICTIVE HORIZON	.1944										
SAPROLITE	.1943/.1956										
CLASSIFICATION	.1948	PS	PS	US	PS	PS					
LONG TERM ACCEPTANCE RATE	.1955	.3	.4		.4	.4					

1 x 300' E 2.241)

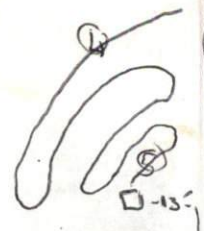

70'