


SITE/SOIL EVALUATION FOR ON-SITE WASTEWATER

APPLICANT NAME _____

FACTORS		PROFILES									
		1	2	3	4	5	6	7	8	9	10
LANDSCAPE POSITION	.1940										
SLOPE (%)	.1940										
HORIZON 1 DEPTH		0-12"	0-14"	0-8"	0-8"						
Texture Group	.1941(A)(1)	SL	SL	SL	SL						
Consistence	.1941	VFR	VFR	VFR	VFR						
Structure	.1941(A)(2)	CR	CR	CR	CR						
Mineralogy	.1941(A)(3)	NS/NP	NS/NP	NS/NP	NS/NP						
HORIZON 2 DEPTH		12-36"	14-38"	8-36"	8-36"						
Texture Group	.1941(A)(1)	SCL	SCL	SCL	SCL						
Consistence	.1941	FR	FR	FR	FR						
Structure	.1941(A)(2)	SBK ⁴	SBK ³	SBK	SBK						
Mineralogy	.1941(A)(3)	S/SF	S/SF	S/SF	S/SF						
HORIZON 3 DEPTH											
Texture Group	.1941(A)(1)										
Consistence	.1941										
Structure	.1941(A)(2)										
Mineralogy	.1941(A)(3)										
HORIZON 4 DEPTH											
Texture Group	.1941(A)(1)										
Consistence	.1941										
Structure	.1941(A)(2)										
Mineralogy	.1941(A)(3)										
SOIL WETNESS	.1942	36"	38"	36"	36"						
RESTRICTIVE HORIZON	.1944										
SAPROLITE	.1943/.1956										
CLASSIFICATION	.1948	PS	PS	PS	PS						
LONG TERM ACCEPTANCE RATE	.1955	.3	.3	.35	.35						

5x70' @ 18-24"

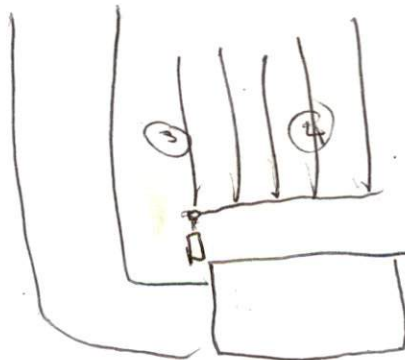

~~5x70'~~
25' @ 2
REQ.
REPAIR

