

**SOIL/SITE EVALUATION
 for ON-SITE WASTEWATER SYSTEM**

Owner: Applicant:

Address: Date Evaluated:
 Proposed Facility: 3 660 room Design Flow (.1949): 360 gpd

Property Size:

Location of Site: Property Recorded:
 Water Supply: Public Individual Well Spring Other
 Evaluation Method: Auger Boring Pit Cut
 Type of Wastewater: Sewage Industrial Process Mixed

P R O F I L E #	.1940 Landscape Position/ Slope %	Horizon Depth (In.)	SOIL MORPHOLOGY .1941		OTHER PROFILE FACTORS				Profile Class & LTAR
			.1941 Structure/ Texture	.1941 Consistence Mineralogy	.1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	
1	L5 5-10%	0-5"	G LS	VFL NS/MP					
		5"	SBK C	F1 s/p	10YR 7/2e 18"				U
2		0-12"	G LS	VFL NS/MP					
		12-30"	SBK CL	F2 s/p	10YR 7/2e 20"				us/PS FILL
3		0-48"	G S	VFL NS/MP					S.8
4		0-10"	G LS	VFL US/MP					
		10"	SBK CL	F2 s/p	10YR 7/2e 18"				us/PS FILL
5		0-16"	G LS	VFL NS/MP					
		16"	SBK CL	F2 s/p	10YR 7/2e 20"				us/PS FILL
6		0-48"	G S	VFL NS/MP					S.8

Description	Initial System	Repair System	Other Factors (.1946): Site Classification (.1948): Evaluated By: Others Present:
Available Space (.1945)	✓	✓	
System Type(s)	pump 25%	FILL	
Site LTAR	.8	.3	


CUMBERLAND HOMES THE CAPE WITH SCREEN PORCH LOT # 183 YORKSHIRE PLANTATION SCALE: 1"=40'

SITE PLAN APPROVAL

DISTRICT Bham USE SEF

#BEDROOMS 3

Date 5-6-10 [Signature]
Zoning Administrator

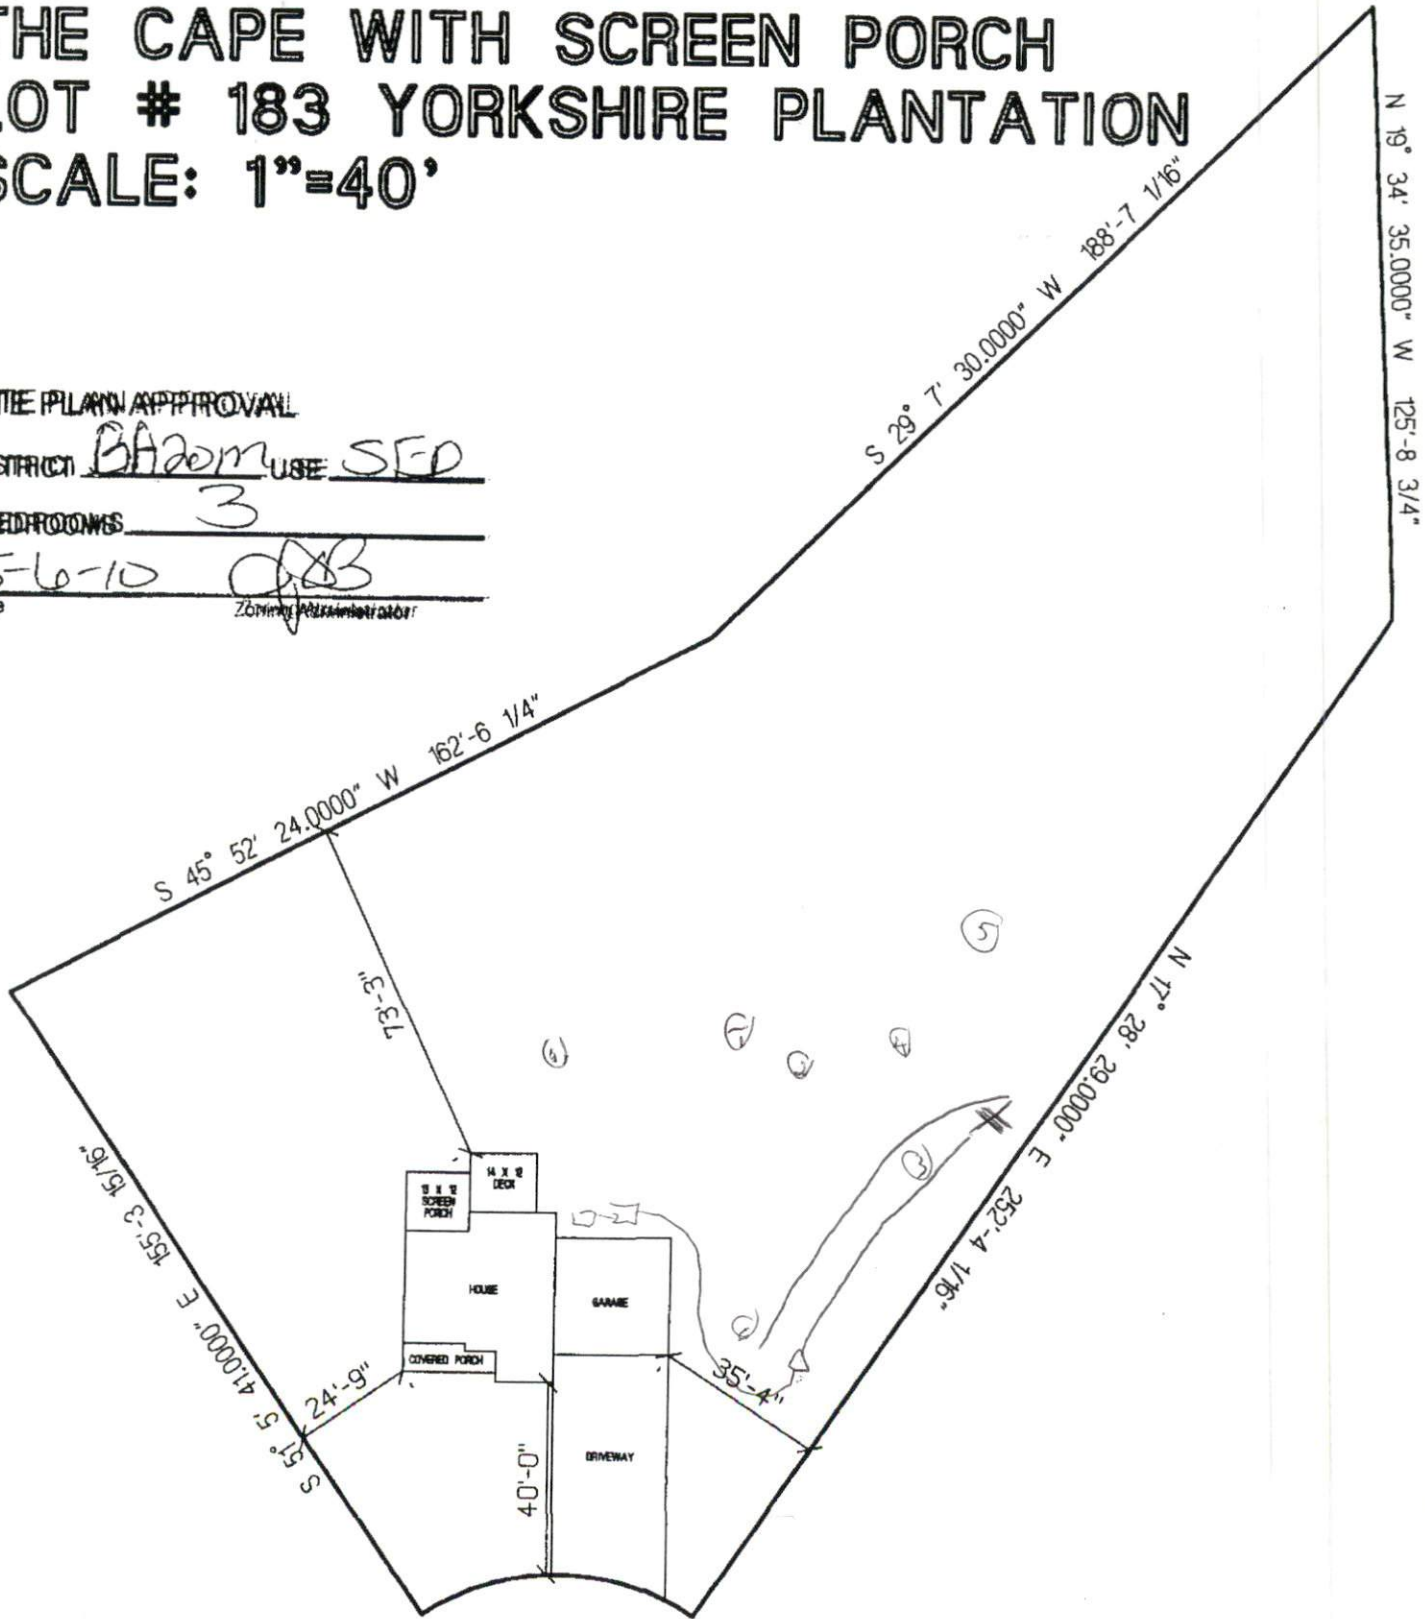

162 JUBILEE COURT