
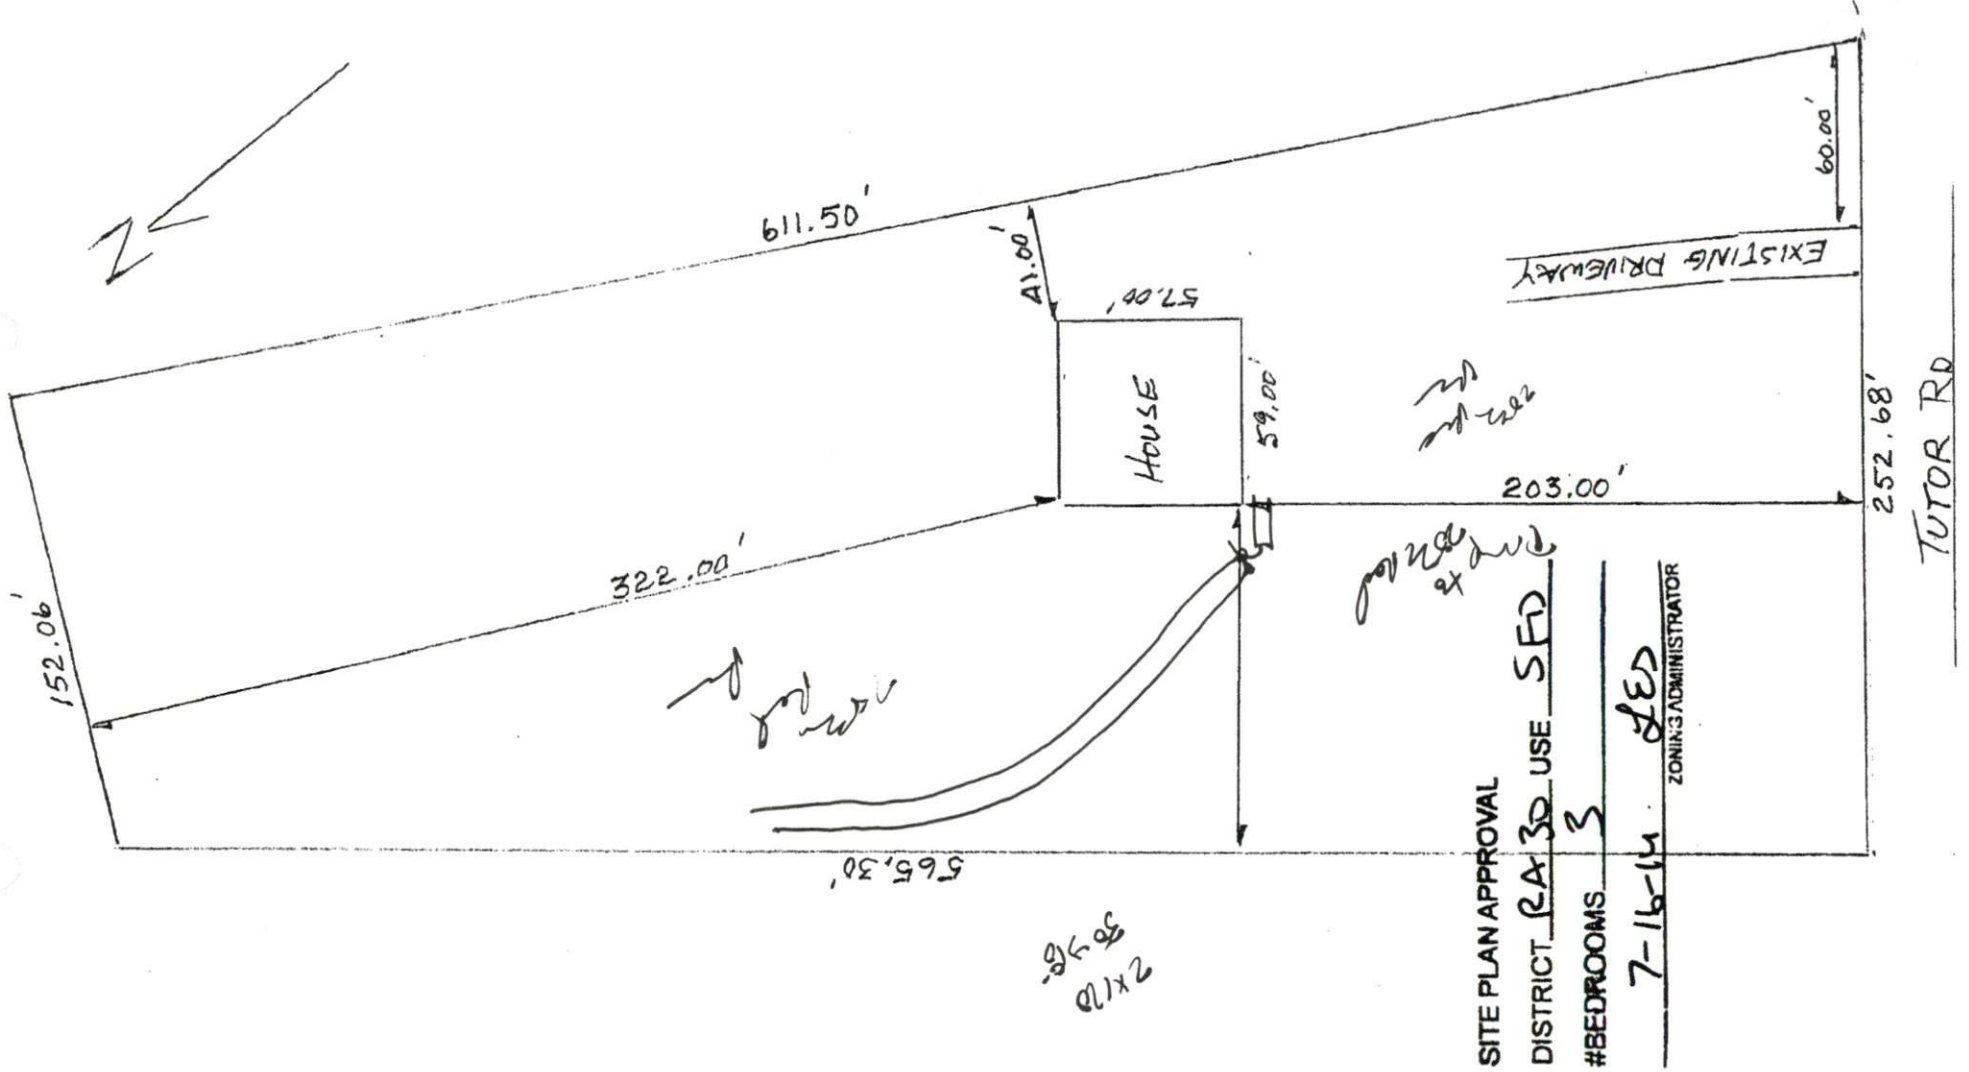


**SOIL/SITE EVALUATION
 for ON-SITE WASTEWATER SYSTEM**

Owner: Applicant: Date Evaluated:
 Address: Design Flow (.1949): **360** Property Size:
 Proposed Facility: Property Recorded:
 Location of Site: Public Individual Well Spring Other
 Water Supply:
 Evaluation Method: Auger Boring Pit Cut
 Type of Wastewater: Sewage Industrial Process Mixed

P R O F I L E #	.1940 Landscape Position/ Slope %	Horizon Depth (In.)	SOIL MORPHOLOGY .1941		OTHER PROFILE FACTORS				Profile Class & LTAR
			.1941 Structure/ Texture	.1941 Consistence Mineralogy	.1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	
1, 2	2-4%	0-24	SL	CLAY SAND					
		24-42	SCU	5% FINE SAND S.P.	30-40	3.1			.4
3, 4, 5	2-4%	0-36	SL	RED SAND					
		36-48	SEL	5% FINE SAND S.P.	44-48	3.1			.4

Description	Initial System	Repair System	Other Factors (.1946): Site Classification (.1948): Evaluated By:  Others Present:
Available Space (.1945)			
System Type(s)	2.4	2.4	
Site LTAR	.4	.4	



OWNER 919-917-3236
 DANIEL & ANNA RUZICKA
 109 TUTOR RD.
 FUQUAY VARINA NC 27526

BUILDER 919-552-2630
 ROBERT SULLIVAN BLDG, INC.
 311 DESTINY TRL.
 FUQUAY VARINA N.C. 27526

PIN # 0625-90-7127.000
 BB 2789 Pg. 399
 BUCKHORN TWP

PLOT PLAN
 SCALE 1" = 60'