

ADDRESS : 1251 GRIFFIN RD
CONTRACTOR : LYON BUILDERS INC
OWNER : LYON BUILDERS INC
PARCEL : 13-0519- - -0103- -02-
APPL NUMBER: 17-50042656 CP NEW RESIDENTIAL (SFD)
DIRECTIONS : T/S: 10/30/2017 03:32 PM BPETRICH --
1251 GRIFFEN ROAD - NEST TO BOONE TRAIL
ELEMENTARY

SUBDIV:
PHONE : (919) 498-2074
PHONE :

APPL NOTES : BPMN 12/21/17 T/S: 12/21/2017 11:22 AM BPETRICH --
HOUSE IS PERMITTED AS A 3 BD 2.5BA WITH
AN UNFINISHED 2ND FLOOR. CUSTOMER WILL
BE FINISHING UPSTAIRS EVENTUALLY MAKING
A 5BD 3.5BA AND WILL PULL ALL PERMITS
NEEDED AT THAT TIME. ORIGINAL IPAC WAS
ISSUED FOR 5BD HOME AND WILL NOT NEED
TO GO BACK THROUGH ENVIRONMENTAL.

STRUCTURE: 000 000 71X56 3BD 2.5BA MONO W/GAR UNFIN 2ND FLR

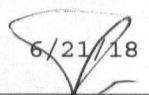
FLOOD ZONE : FLOOD ZONE X
BATHS : 2.5 # BEDROOMS : 3.00
PROPOSED USE : SFD SEPTIC - EXISTING? : NEW TANK
WATER SUPPLY : COUNTY

PERMIT: CPSF 00 CP * SFD

TYP/SQ	REQUESTED COMPLETED	INSP RESULT	DESCRIPTION RESULTS/COMMENTS
A814 01	12/22/17 12/22/17	SB AP	ADDRESS CONFIRMATION TIME: 17:00 VRU #: 003070117 1251 GRIFFIN RD LILLINGTON 27546 T/S: 12/22/2017 09:54 AM SBENNETT -----
E205 01	1/11/18 1/11/18	TSG AP	R*ELEC UNDER SLAB TIME: 17:00 VRU #: 003075066 T/S: 01/10/2018 01:44 PM LLUCAS -----
P309 01	1/11/18 1/11/18	TSG AP	R*PLUMB UNDER SLAB TIME: 17:00 VRU #: 003075058 T/S: 01/10/2018 01:44 PM LLUCAS -----
B114 01	1/24/18 1/24/18	TSG AP	R*BLDG MONO SLAB/TEMP SVC POLE TIME: 17:00 VRU #: 003079217 T/S: 01/23/2018 11:54 AM LLUCAS -----
E207 01	2/14/18 2/14/18	TSG AP	R*ELEC TEMP SERVICE POLE TIME: 17:00 VRU #: 003088689 T/S: 02/13/2018 08:13 AM LLUCAS -----
R425 01	3/20/18 3/20/18	TSG DA	FOUR TRADE ROUGH IN TIME: 17:00 VRU #: 003103090 T/S: 03/19/2018 09:56 AM LLUCAS ----- 1-air barrier required at stair /garage wall 2-caulk all hole in house/garage wall at joist area 3-a/b at exit doors each side 12" 4-dryer vent max length 35' 5-complete all hvac duct and fire block and stop 6-install midstory strapping on vent pipes. 7-need all lvl cut sheets. 8-attach all interior load bearing walls. 9-strap all stud columns of 4 or more. 10- attach toilet flanges. 11-install all plumbing rest drain and supply.12-install rafter ties in main room. ok to side
R425 02	3/27/18 3/27/18	TSG DA	FOUR TRADE ROUGH IN TIME: 17:00 VRU #: 003106515 T/S: 03/26/2018 01:47 PM BPETRICH ----- T/S: 03/27/2018 03:41 PM DJOHNSON ----- 1. PLUMBING TEST NEEDS TO BE UP. 2. MOVE AIR BARRIER TO OUTSIDE WALL IN GARAGE.
R425 03	3/28/18	KS	FOUR TRADE ROUGH IN TIME: 17:00 VRU #: 003107372

ADDRESS : 1251 GRIFFIN RD
 CONTRACTOR : LYON BUILDERS INC
 OWNER : LYON BUILDERS INC
 PARCEL : 13-0519- - -0103- -02-
 APPL NUMBER: 17-50042656 CP NEW RESIDENTIAL (SFD)

SUBDIV:
 PHONE : (919) 498-2074
 PHONE :

TYP/SQ	REQUESTED COMPLETED	INSP RESULT	DESCRIPTION RESULTS/COMMENTS
	3/28/18	AP	T/S: 03/27/2018 01:52 PM JBRÖCK ----- T/S: 03/28/2018 04:17 PM KSLATTUM -----
I129 01	4/03/18 4/03/18	TSG AP	R*INSULATION INSPECTION TIME: 17:00 VRU #: 003109394 T/S: 04/02/2018 11:33 AM BPETRICH ----- T/S: 04/03/2018 03:57 PM BPETRICH -----
H824 01	5/22/18 5/22/18	OT AP	ENVIR. OPERATIONS PERMIT TIME: 17:00 VRU #: 003131240 T/S: 05/23/2018 10:29 AM KHINSON ----- T/S: 05/23/2018 10:29 AM KHINSON -----
R429 01	6/18/18 6/18/18	TSG DA	FOUR TRADE FINAL TIME: 17:00 VRU #: 003140845 T/S: 06/15/2018 08:58 AM BPETRICH ----- 4 -remove toe from roof 5 -seal foundation insulation 3 -outside recp required to be w/resistant type with inuse cover. 4 -locte two ground rods 5-sewer clean out to grade level 6 -garage door recep not protected. 7 flex plumbing adapter not allowed. 8 -dishwasher requires proper air gap. 9 -complete and protect a/c disconnect box. 10 -duct presure test required. 11 -strap 2" vent pipe in attic. 12 -energy cert
R429 02	6/21/18	 TAP	FOUR TRADE FINAL TIME: 17:00 VRU #: 003142841 T/S: 06/20/2018 12:30 PM JBRÖCK -----

COMMENTS AND NOTES