


# SITE/SOIL EVALUATION FOR ON-SITE WASTEWATER

APPLICANT NAME \_\_\_\_\_

DATE \_\_\_\_\_

FACTORS		PROFILES									
		1	2	3	4	5	6	7	8	9	10
LANDSCAPE POSITION	.1940	T	T	T	T	T	T				
SLOPE (%)	.1940	D-2%	D-2%	D-2%	D-2%	D-2%	D-2%				
HORIZON 1 DEPTH		0-40"	0-40"	0-40"	0-40"	0-40"	0-40"				
Texture Group	.1941(A)(1)	C	SC2	SC2	SC2	SC2	SC2				
Consistence	.1941	FI	FR	FR	FR	FR	FR				
Structure	.1941(A)(2)	SBK	SBK	SBK	SBK	SBK	SBK				
Mineralogy	.1941(A)(3)	SS/P	SS/P	SS/P	SS/P	SS/P	SS/P				
HORIZON 2 DEPTH		40"+	12-40"	12-34"	12-40"	12-38"	12-38"				
Texture Group	.1941(A)(1)	>50%SS	C	C	C	C	C				
Consistence	.1941		FR	FR	FR/FI	FR	FR				
Structure	.1941(A)(2)		SBK	SBK	SBK	SBK	SBK				
Mineralogy	.1941(A)(3)		SS/P	SS/P	SS/P	SS/P	SS/P				
HORIZON 3 DEPTH			40"	34"	40"	38"	38"				
Texture Group	.1941(A)(1)		PM	>50%SS	PM	PM	PM				
Consistence	.1941										
Structure	.1941(A)(2)										
Mineralogy	.1941(A)(3)										
HORIZON 4 DEPTH											
Texture Group	.1941(A)(1)										
Consistence	.1941										
Structure	.1941(A)(2)										
Mineralogy	.1941(A)(3)										
SOIL WETNESS	.1942										
RESTRICTIVE HORIZON	.1944										
SAPROLITE	.1943/1956	40"	40"	34"	40"	38"	38"				
CLASSIFICATION	.1948	PS	PS	PS	PS	PS	PS				
LONG TERM ACCEPTANCE RATE	.1955	.3	.3	.3	.3	.3	.3				

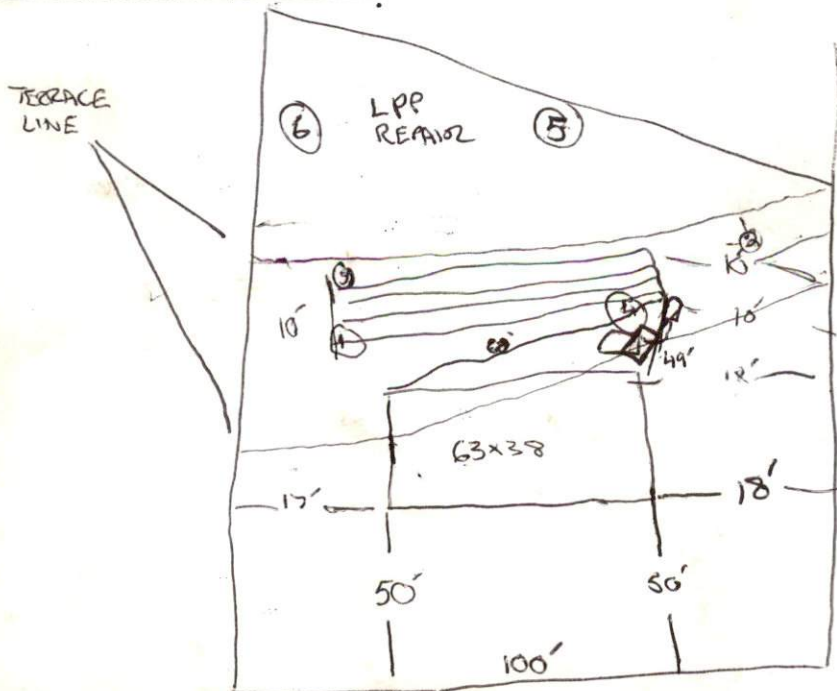

25% REDUCTION SYS  
 4 75' LINES  
 20" DEEP  
 RUN ON CONTOUR

LINES DRAINAGE MAY BE SHIFTED ALONG CONTOUR TO MAINTAIN ALL MINIMUM SET BACKS