

SITE/SOIL EVALUATION FOR ON-SITE WASTEWATER

APPLICANT NAME _____


DATE _____

FACTORS		PROFILES									
		1	2	3	4	5	6	7	8	9	10
LANDSCAPE POSITION	.1940										
SLOPE (%)	.1940										
HORIZON 1 DEPTH		0-18	0-16	0-15	0-28	0-12	0-25	0-3			
Texture Group	.1941(A)(1)	LS	LS	LS	LS	LS	LS	LS	...		
Consistence	.1941	VFr	VFr	VFr	VFr	VFr	VFr	VFr			
Structure	.1941(A)(2)	G	G	G	G	G	G	G			
Mineralogy	.1941(A)(3)	Nx	Nx	Nx	Nx	Nx	Nx	Nx			
HORIZON 2 DEPTH		18-28	16-28	15-27	24-2	12-15	28-34	3-22			
Texture Group	.1941(A)(1)	SL A2	C	SC	SC	C	SC	C			
Consistence	.1941	Vr	VFi	Vr	Fv	Fv	Fv	VFi			
Structure	.1941(A)(2)	SbK	ABK	SbK	SbK	ABK	SbK	ABK			
Mineralogy	.1941(A)(3)	Sx	Cv	Sx	Sx	Cv	Sx	Sx/Cv			
HORIZON 3 DEPTH											
Texture Group	.1941(A)(1)										
Consistence	.1941										
Structure	.1941(A)(2)										
Mineralogy	.1941(A)(3)										
HORIZON 4 DEPTH											
Texture Group	.1941(A)(1)										
Consistence	.1941										
Structure	.1941(A)(2)										
Mineralogy	.1941(A)(3)										
SOIL WETNESS	.1942		25"	24"		17"		18"			
RESTRICTIVE HORIZON	.1944	28" rock									
SAPROLITE	.1943/.1956										
CLASSIFICATION	.1948		CS	CS	CS	CS	CS	CS			
LONG TERM ACCEPTANCE RATE	.1955				.5		.3				



Required Property Line Setbacks

	Minimum	Actual
Front	35	60
Side	10	14
Corner	20	N/A
Rear	25	101
Nearest Building	10	N/A

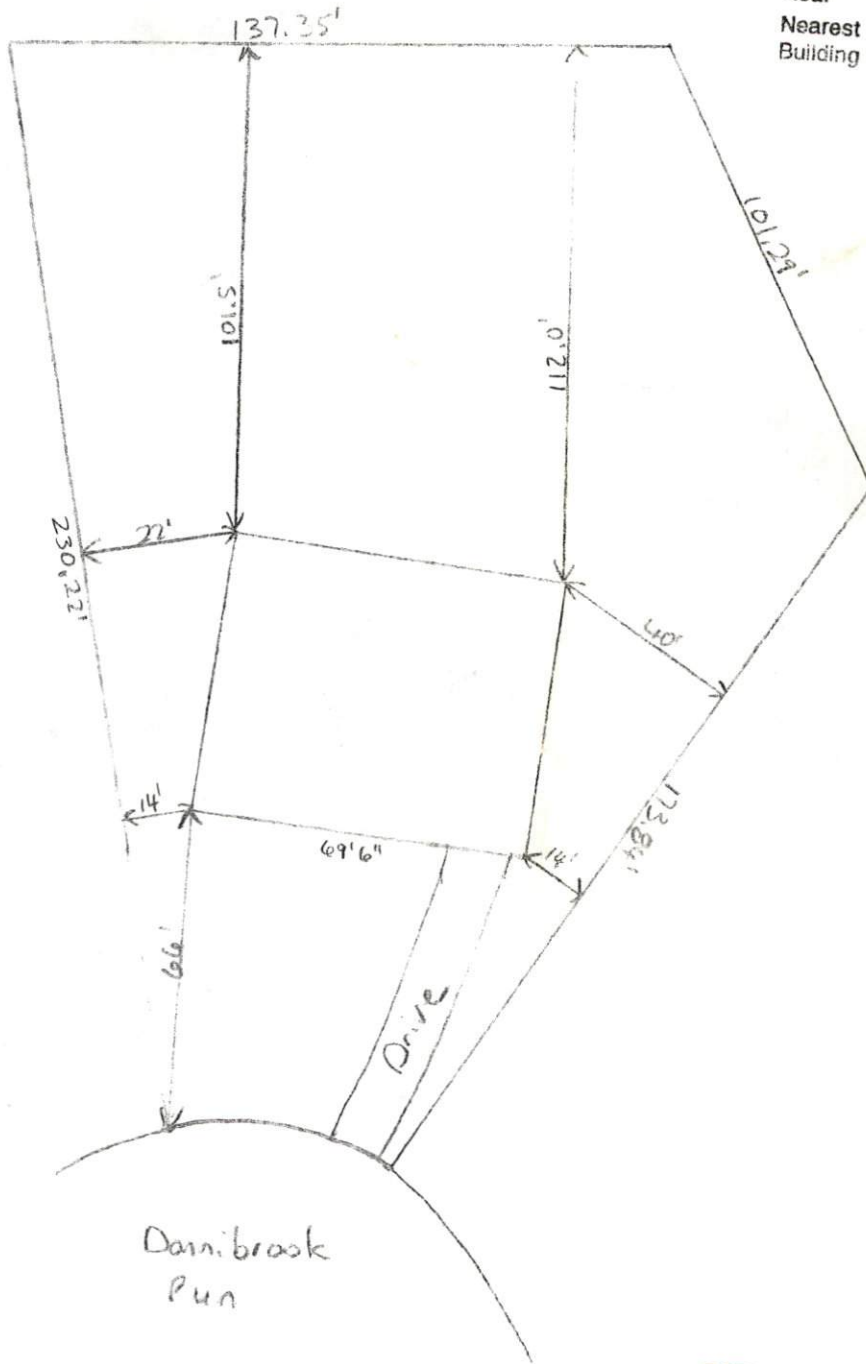

Robert Jones General Contractor
 Lot 12 Dannibrack Pines
 1" = 40'

SITE PLAN APPROVAL
 DISTRICT RA-30 USE SFP
 #BEDROOMS 3
 Date 26 Jun 01 Andie Bell
 Zoning Administrator

