


SITE/SOIL EVALUATION FOR ON-SITE WASTEWATER

FACTORS		PROFILES									
		1	2	3	4	5	6	7	8	9	10
LANDSCAPE POSITION	.1940	L	L	L							
SLOPE (%)	.1940	2	2	2							
HORIZON 1 DEPTH		0-18									
TEXTURE GROUP	.1941(A)(1)	sl									
CONSISTENCE	.1941	fn									
STRUCTURE	.1941(A)(2)	ca									
MINERALOGY	.1941(A)(3)	NSMP									
HORIZON 2 DEPTH		18-24									
TEXTURE GROUP	.1941(A)(1)	sc									
CONSISTENCE	.1941	fn									
STRUCTURE	.1941(A)(2)	ca									
MINERALOGY	.1941(A)(3)	NSMP									
HORIZON 3 DEPTH		24-48									
TEXTURE GROUP	.1941(A)(1)	sc-cl									
CONSISTENCE	.1941	spn									
STRUCTURE	.1941(A)(2)	ca									
MINERALOGY	.1941(A)(3)	SSS1									
HORIZON 4 DEPTH											
TEXTURE GROUP	.1941(A)(1)										
CONSISTENCE	.1941										
STRUCTURE	.1941(A)(2)										
MINERALOGY	.1941(A)(3)										
SOIL WETNESS	.1942										
RESTRICTIVE HORIZON	.1944										
SAPROLITE	.1943/.1956	40"	40"	40"							
CLASSIFICATION	.1948										
LONG TERM ACCEPTANCE RANGE	.1955	.4	.35	.4							

Victoria Hills Drive South

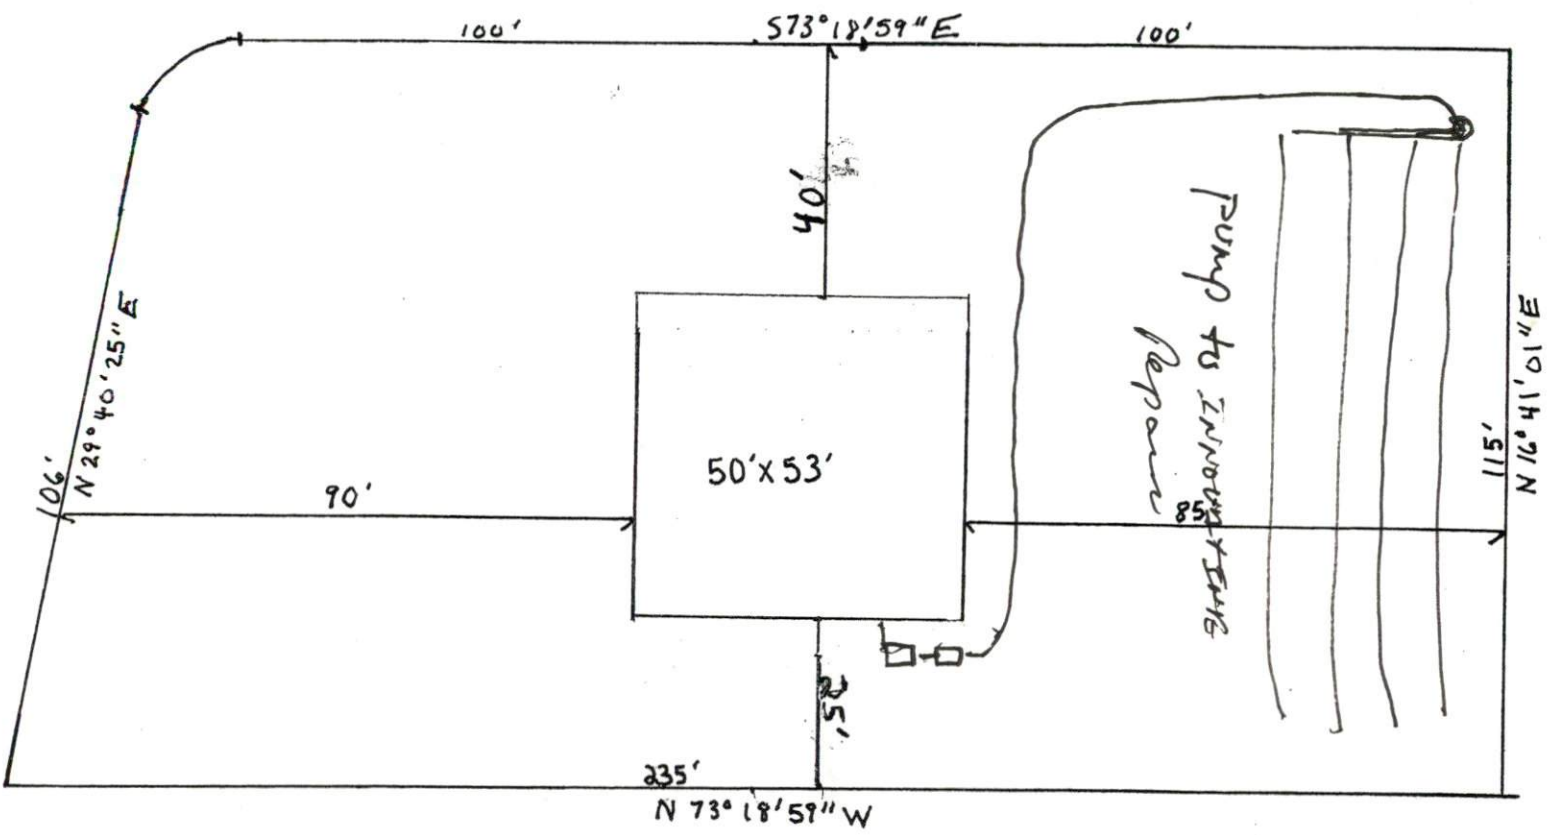

Lot 71

1 inch = 30ft

Required Property Line Setbacks

	Minimum	Actual
Front	<u>35</u>	<u>40</u>
Side	<u>10</u>	<u>25</u>
Corner	<u>20</u>	<u>90</u>
Rear	<u>25</u>	<u>25</u>
Nearest Building	<u>10</u>	<u>—</u>

SITE PLAN APPROVAL

DISTRICT RA-30 USE SFD

#BEDROOMS 3

Date 03 Jul 02 C Bell
Zoning Administrator