SITE/SOIL EVALUATION FOR ON-SITE WASTEWATER

APPLICANT NAME _____ _____ _____

FACTORS		PROFILES									
		1	2	3	4	5	6	7	8	9	10
LANDSCAPE POSITION	.1940	L	L	L							
SLOPE (%)	.1940	2	2	2							
HORIZON 1 DEPTH		0-18									
Texture Group	.1941(A)(1)	SL									
Consistence	.1941	VFR									
Structure	.1941(A)(2)	GR									
Mineralogy	.1941(A)(3)	NSNP									
HORIZON 2 DEPTH		18-30									
Texture Group	.1941(A)(1)	SCL									
Consistence	.1941	FR									
Structure	.1941(A)(2)	GR									
Mineralogy	.1941(A)(3)	NSSP									
HORIZON 3 DEPTH		30-42									
Texture Group	.1941(A)(1)	SC-CL									
Consistence	.1941	SL Firm									
Structure	.1941(A)(2)	SBK									
Mineralogy	.1941(A)(3)	SSSP									
HORIZON 4 DEPTH											
Texture Group	.1941(A)(1)										
Consistence	.1941										
Structure	.1941(A)(2)										
Mineralogy	.1941(A)(3)										
SOIL WETNESS	.1942	36	36	36							
RESTRICTIVE HORIZON	.1944										
SAPROLITE	.1943/.1956										
CLASSIFICATION	.1948										
LONG TERM ACCEPTANCE RATE	.1955	.4	.4	.4							

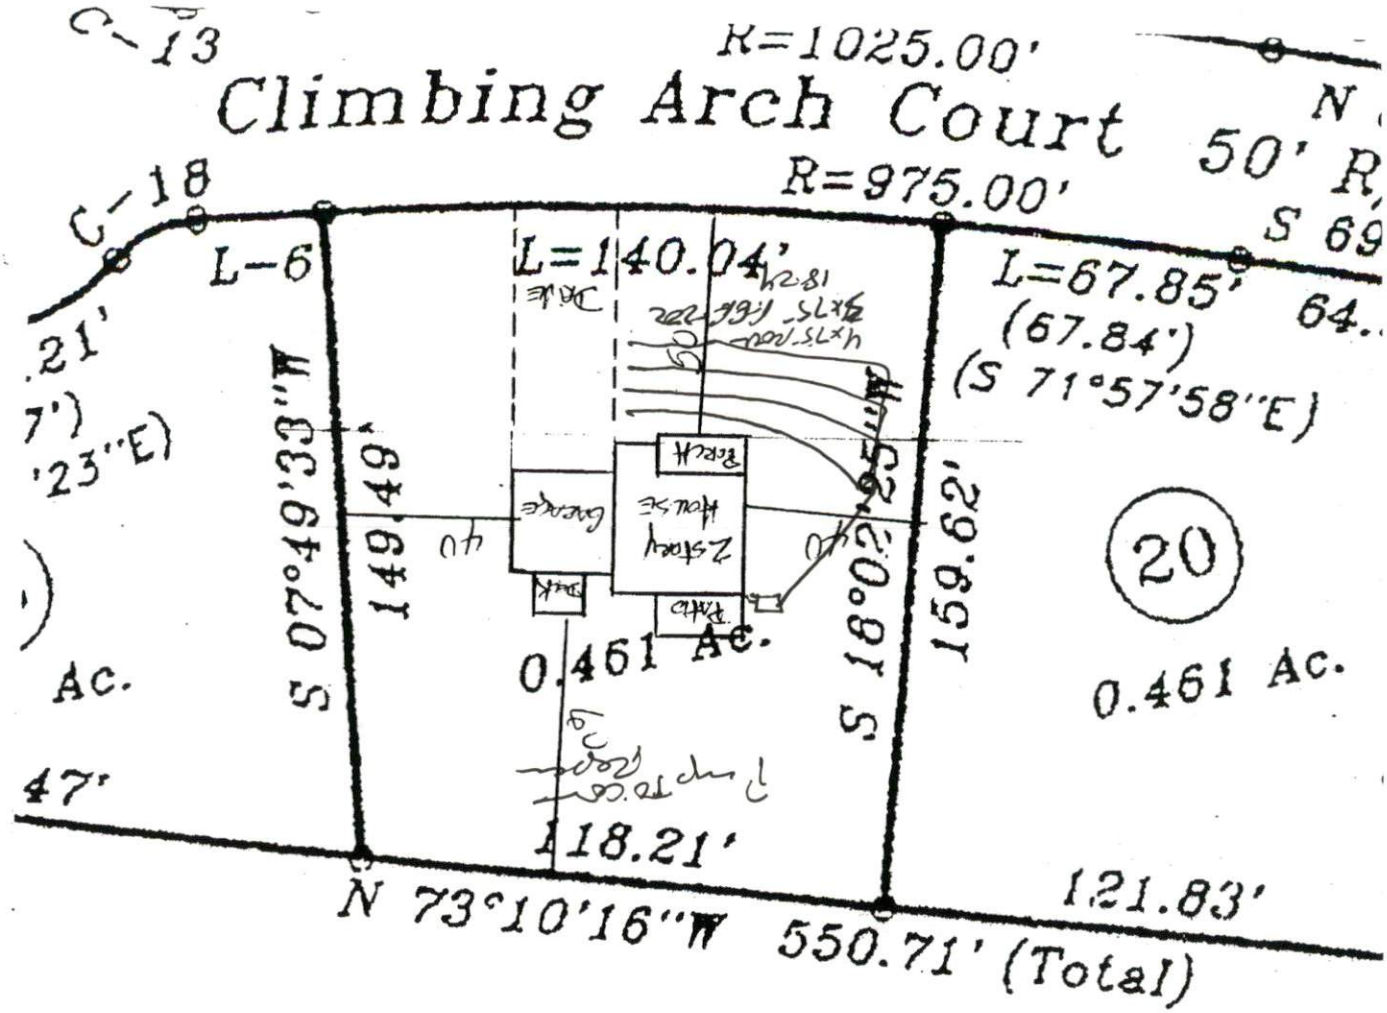

SITE PLAN APPROVAL
DISTRICT MHO USE SFD
#BEDROOMS 3
1-25-03 D. Clulson
Zoning Administrator

Lot # 19 Liveyard Estates
Cumberland Homes Inc.
1/4" = 10'