
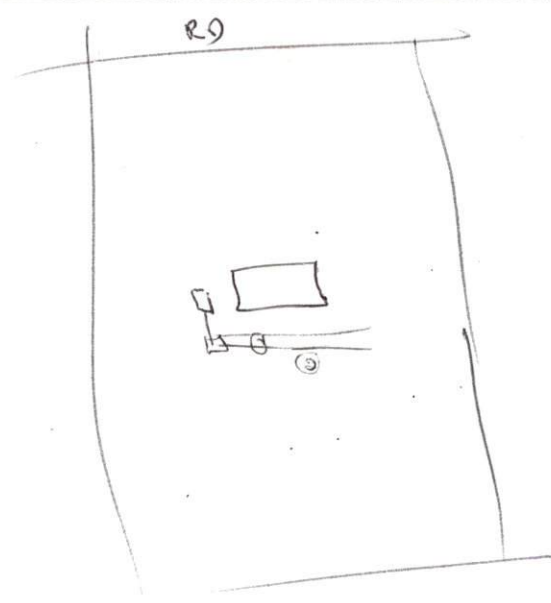


SITE/SOIL EVALUATION FOR ON-SITE WASTEWATER

FACTORS		PROFILES													
		1	2	3	4	5	6	7	8	9	10				
LANDSCAPE POSITION	.1940														
SLOPE (%)	.1940	0-3%													
HORIZON 1 DEPTH		0-3	0-30"												
TEXTURE GROUP	.1941(A)(1)	SL	SL												
CONSISTENCE	.1941	VFL	VFL												
STRUCTURE	.1941(A)(2)	G	G												
MINERALOGY	.1941(A)(3)	NS/MP	NS/MP												
HORIZON 2 DEPTH		3-36	30-40"												
TEXTURE GROUP	.1941(A)(1)	LS	SLL												
CONSISTENCE	.1941	VFL	FL												
STRUCTURE	.1941(A)(2)	G	SBK 2												
MINERALOGY	.1941(A)(3)	NS/MP	S/P												
HORIZON 3 DEPTH		36-40	40"												
TEXTURE GROUP	.1941(A)(1)	SCL	C												
CONSISTENCE	.1941	FR	FR												
STRUCTURE	.1941(A)(2)	SBK 2	SBK 2												
MINERALOGY	.1941(A)(3)	S/P	S/P												
HORIZON 4 DEPTH		40"													
TEXTURE GROUP	.1941(A)(1)	C													
CONSISTENCE	.1941	SBK FR													
STRUCTURE	.1941(A)(2)	SBK 2													
MINERALOGY	.1941(A)(3)	S/P													
SOIL WETNESS	.1942	40"	40"												
RESTRICTIVE HORIZON	.1944														
SAPROLITE	.1943/1956														
CLASSIFICATION	.1948	PS	PS												
LONG TERM ACCEPTANCE RANGE	.1955	.4	.4												

2 x 25'
START LINE @ 30' DEGR



4" DITF