
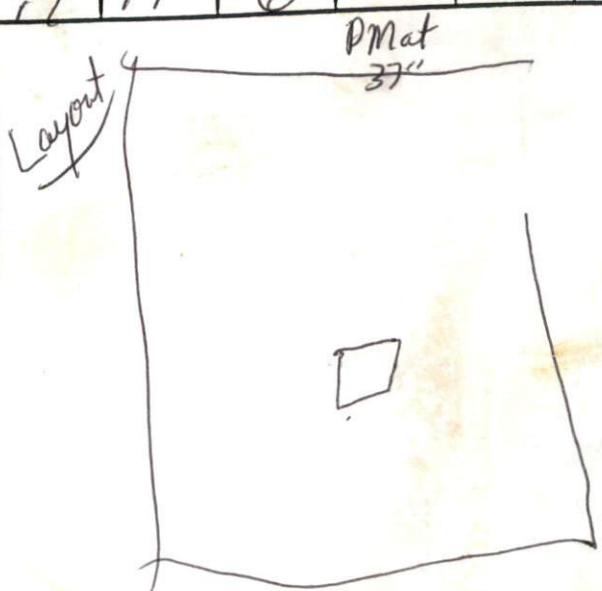


SITE SOIL EVALUATION FOR ON-SITE WASTEWATER

APPLICANT NAME _____

DATE _____

FACTORS		PROFILES								
		1	2	3	4	5	6	7	8	9
LANDSCAPE POSITION	.1940	SS								
SLOPE (%)	.1940	5%								
HORIZON 1 DEPTH		0-12	→	→	0-12	0-12	0-12			
Texture Group	.1941(A)(1)	Sand	→	→	Sand	Sand	Sand			
Consistence	.1941									
Structure	.1941(A)(2)									
Mineralogy	.1941(A)(3)									
HORIZON 2 DEPTH		12-42	→	→	12-38	12-36	12-36			
Texture Group	.1941(A)(1)	SL	→	→	SL	SL	LS			
Consistence	.1941	UR			UR	UR				
Structure	.1941(A)(2)	Gr			Gr	Gr				
Mineralogy	.1941(A)(3)	NEXP			NEXP	NEXP				
HORIZON 3 DEPTH					38-42	26-38				
Texture Group	.1941(A)(1)				SCL	SCL				
Consistence	.1941				Fr	Fr				
Structure	.1941(A)(2)				LSBK/Gr	LSBK				
Mineralogy	.1941(A)(3)				NEXP	NEXP				
HORIZON 4 DEPTH										
Texture Group	.1941(A)(1)									
Consistence	.1941									
Structure	.1941(A)(2)									
Mineralogy	.1941(A)(3)									
SOIL WETNESS	.1942									
RESTRICTIVE HORIZON	.1944									
SAPROLITE	.1943/.1956									
CLASSIFICATION	.1948	S	S	S	PS					
LONG TERM ACCEPTANCE RATE	.1955	.7	.7	.7	.6					

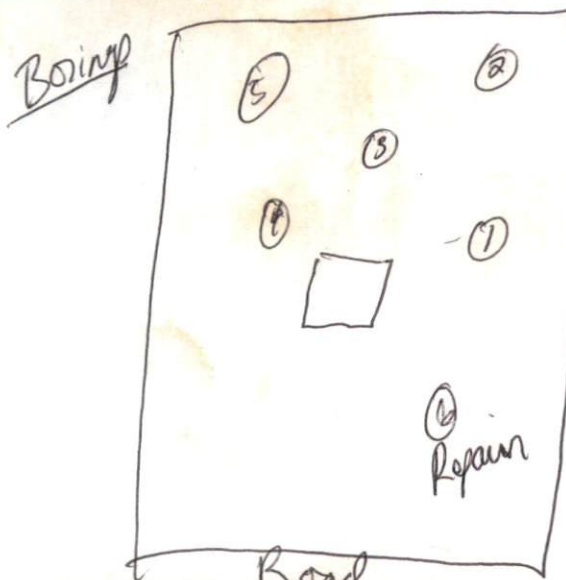

ROLLINS ROAD (S.R. 1413)
(60' PUBLIC R/W)

S 72°14'18"E 150.00'

Existing Pt

CH = 11'

Proposed


BOBBY L. MORTON & WIFE
JAXIE S. MORTON
D.B. 1037 PG. 758-760

BOBBY L. MORTON
JAXIE S. MORTON
D.B. 1037 PG. 758-

SITE PLAN APPROVAL

DISTRICT: RA-30 USE: SRD
#BEDROOMS: 3

6-5-98
Date
Zoning Administrator

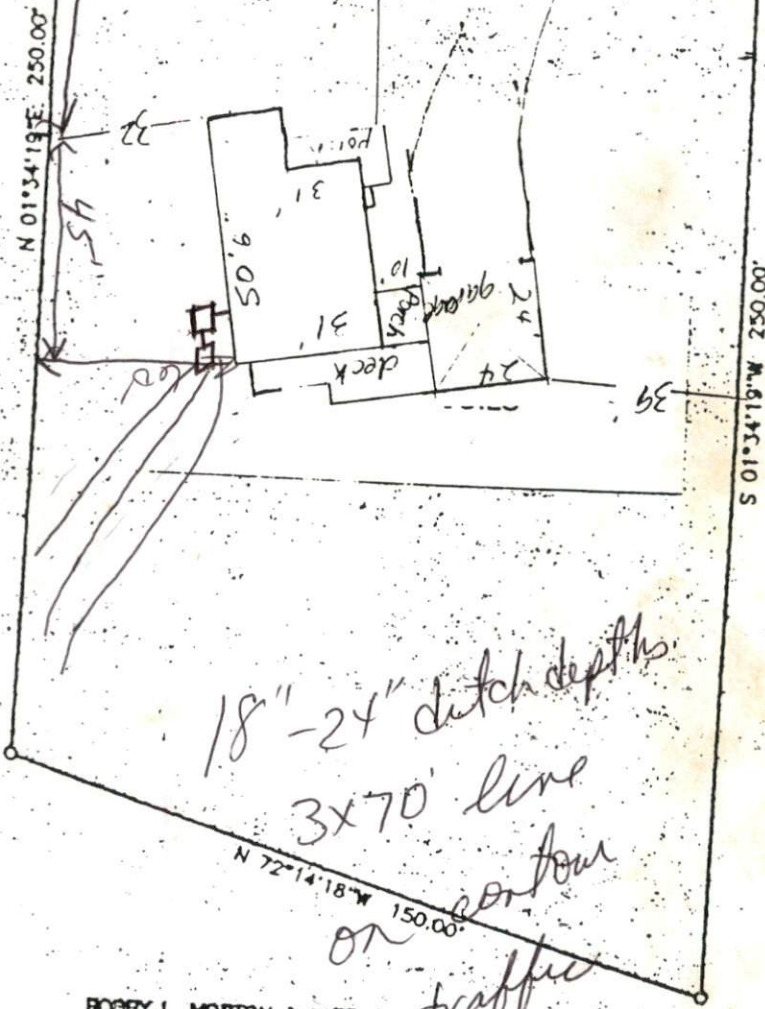

18"-24" ditch depths
3x70' line
on contour
no traffic

BOBBY L. MORTON & WIFE
JAXIE S. MORTON
D.B. 1037 PG. 758-760

SURVEY F
BOBBY
JAXIE S