


# Crosslink Subdivision True Homes - Lot #62 4-Bedroom Septic System Design

62

0.740 Ac.

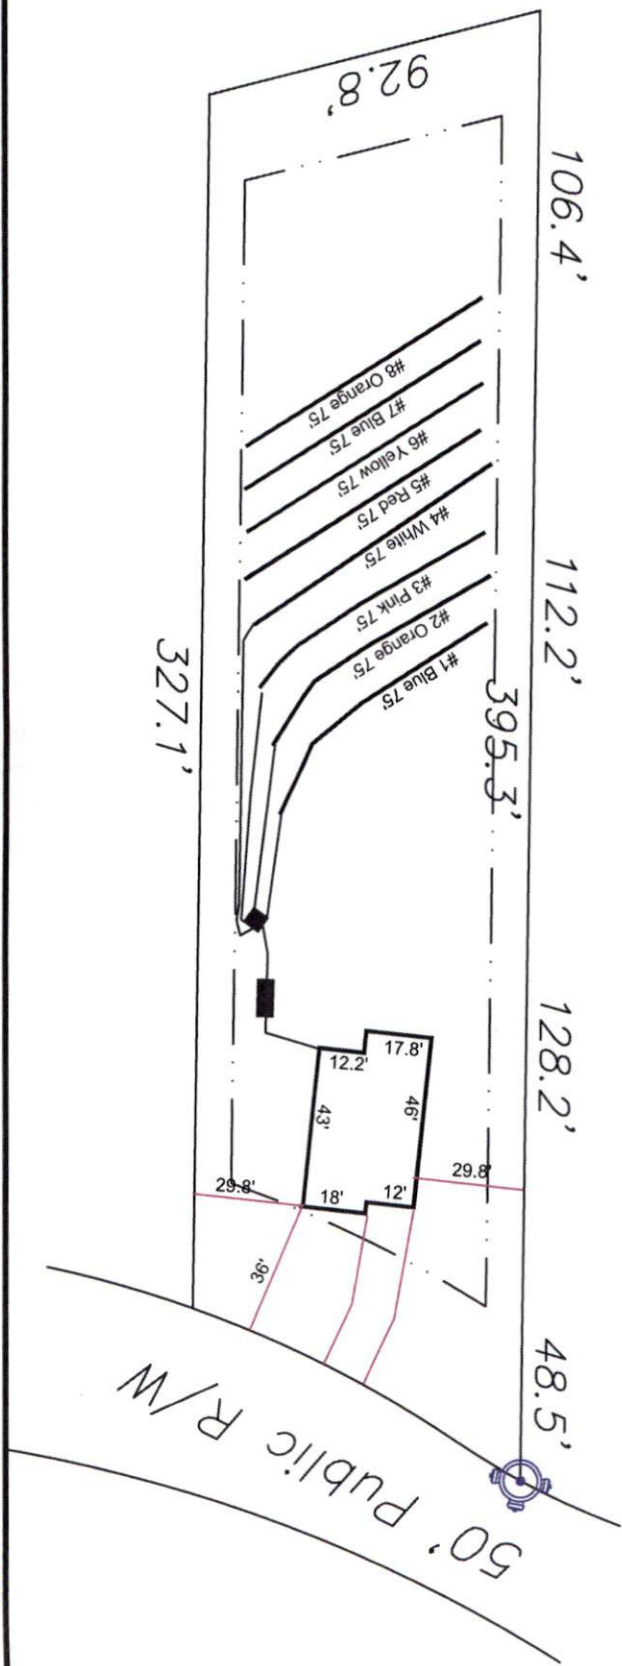

System: Gravity to D-Box  
 Lines: 1-4 (300')  
 0.4 LTAR  
 18" Trench Bottom  
 Accepted Status System  
 Repair: Gravity to D-Box  
 Lines: 5-8 (300')  
 0.4 LTAR  
 18" Trench Bottom  
 Accepted Status System

GRAPHIC SCALE  
 1" = 50'



Adams  
 Soil Consulting  
 919-414-6761  
 Job #522

**Crosslink Subdivison Phase III**

True Homes - Lot #62

4-Bedroom Home (480 gal./day)

<u>LINE #</u>	<u>COLOR</u>	<u>BS</u>	<u>HI</u>	<u>FS</u>	<u>ELEVATION</u>	<u>LINE LENGTH</u>	<u>Design Length</u>
TBM		2.0		100.0		<u>in field</u>	<u>installation</u>
INST. 1			102.0				
1	Blue			4.2	97.8	88	75
2	Orange			4.8	97.2	88	75
3	Pink			5.1.	#VALUE!	85	75
4	White			5.6	96.4	85	75
5	Red			6	96	80	75
6	Yellow			6.8	95.2	80	75
7	Blue			7.5	94.5	80	75
8	Orange			8.2	93.8	80	75
Total						666	600

	<u>System</u>	<u>Repair</u>
	Lines 1-4	Lines 5-8
<b>System Type</b>	Accepted Status System EZ-FLOW	Accepted Status System EZ-FLOW
Suggested Soil LTAR	0.40	0.40
<b>Total Line Length</b>	300	300
<b>Square Footage</b>	900	900
<b>Proposed Trench Bottom</b>	18"	18"
<b>Distribution Method</b>	Gravity to D-Box	Gravity to D-Box