Department of Environment, Health and Natural Resources Division of Environmental Health On-Site Wastewater Section

Sheet: Property ID: Lot #: File #: Code:

SOIL/SITE EVALUATION for ON-SITE WASTEWATER SYSTEM

SFD 2107-0101 Owner: Ren Applicant: Date Evaluated: 5-6-21 Address:
Proposed Facility: Design Flow (.1949): 480 GPD Property Size: Property Recorded: Location of Site: Public Individual Water Supply: ☐ Spring Other Evaluation Method Auger Boring
Type of Wastewater: Sewage Pit Industrial Process Mixed

P R O F I L E	.1940 Landscape Position/ Slope %	Horizon Depth (In.)	SOIL MORPHOLOGY .1941		OTHER PROFILE FACTORS				
			.1941 Structure/ Texture	.1941 Consistence Mineralogy	.1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	Profile Class & LTAR
3	1	0-24	4 Gr	VF1/NS/NP/NKP	>48"	>48"	_	_	S. 6 Group
	< 2%	24-48	SL Gr	VFO/NS/NO/NXE					11
			4.		9				
				ì	,1			*	11.78
					u 2				
					4				
			,						

Description	Initial	Repair System	Other Factors (.1946):
	System		Site Classification (.1948):
Available Space (.1945)			Evaluated By: MOshow REH
System Type(s)	25214	252 100	Others Present:
Site LTAR	. 6	. 6	

COMMENTS: ____

LANDSCAPE POSITIONS	GROUP	TEXTURES	.1955 LTAR	CONSISTENCE MOIST	WET
R-RIDGE	ī	S-SAND	1.2 - 0.8		
The second secon	1		1.2 - 0.8		
S-SHOULDER SLOPE		LS-LOAMY SAND		VFR-VERY FRIABLE	NS-NON-STICKY
L-LINEAR SLOPE				FR-FRIABLE	SS-SLIGHTY STICKY
FS-FOOT SLOPE	II	SL-SANDY LOAM	0.8 - 0.6	FI-FIRM	S-STICKY
N-NOSE SLOPE		L-LOAM		VFI-VERY FIRM	VS-VERY STICKY
H-HEAD SLOPE				EFI-EXTREMELY FIRM	NP-NON-PLASTIC
CC-CONCLAVE SLOPE	Ш	SI-SILT	0.6 - 0.3		SP-SLIGHTLY STICKY
CV-CONVEX SLOPE		SIL-SILT LOAM			P-PLASTIC
T-TERRACE		CL-CLAY LOAM			VP-VERY PLASTIC
FP-FLOOD PLAN		SCL-SANDY CLAY LOAM			

0.4 - 0.1


IV SIC-SILTY CLAY C-CLAY

SC-SANDY CLAY

STRUCTURE SG-SINGLE GRAIN M- MASSIVE CR-CRUMB GR-GRANULAR SBK-SUBANGULAR BLOCKY ABK-ANGULAR BLOCKY PL-PLATY

MINERALOGY SLIGHTLY EXPANSIVE

EXPANSIVE

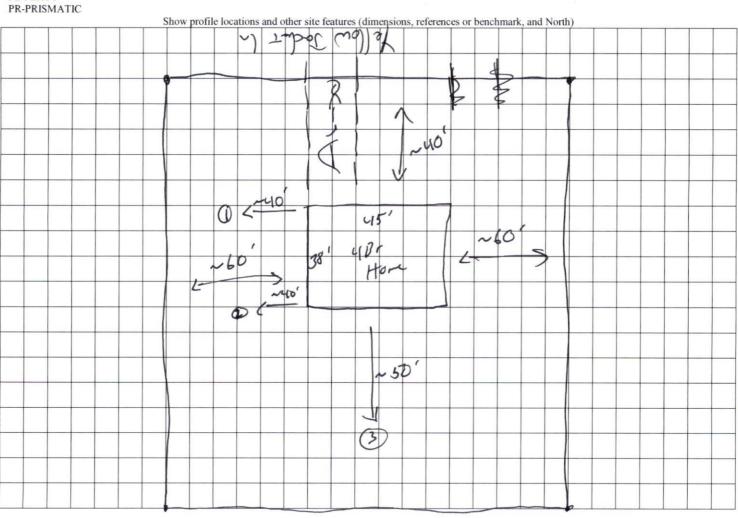

← Dove Rd >>