Department of Environment, Health and Natural Resources Division of Environmental Health On-Site Wastewater Section

Sheet: Property ID: Lot #: File #:

Code:

SOIL/SITE EVALUATION for ON-SITE WASTEWATER SYSTEM

Owner: Wear Applicant; Address: 1264 Hayes Rd Proposed Facility: FD	Date Evaluated: 3-31-22 Design Flow (.1949): 360 GPD	Property Size:	
Location of Site: Water Supply: Public	Property Recorded: Individual Well	☐ Spring	Other
Evaluation Method: Auger Boring Type of Wastewater: Sewa	ge Pit Cut Industrial Process	☐ Mixed	

71	. Traste trate		_						
P R O F I L E	.1940 Landscape Position/ Slope %	Horizon Depth (In.)		DRPHOLOGY 1941 .1941 Consistence Mineralogy	.1942 Soil Wetness/ Color	OTHER PROFILE FACTOR .1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	Profile Class & LTAR
Pir	L	0-18			10426/2	>48"		_	P5.4
	<2%	18-49	SCI EBK	Fr/ss/sv 8 /wxe Fr/ss/se / sx P	≥ 30"				Group
PIT	L	0-18	45 G-	F-/NS/NP/NXP	10 YR 6/2	>48*	>48	_	P1.4
	<2%	18-48	sc1 sph	F-/NS/NP/NXP F:/SS/SP/SXP	≥34"				Ps. 4 Group
							1		

Description	System	Repair System
Available Space (.1945)		
System Type(s)	25 % rud	Prop 25 Tral
Site LTAR	. 4	. 4

Other Factors (.1946):
Site Classification (.1948):
Evaluated By:
Others Present:

COMMENTS: ____

LANDSCAPE POSITIONS	GROUP	TEXTURES	. <u>1955 LTAR</u>	CONSISTENCE MOIST	WET
R-RIDGE S-SHOULDER SLOPE L-LINEAR SLOPE	I	S-SAND LS-LOAMY SAND	1.2 - 0.8	VFR-VERY FRIABLE FR-FRIABLE	NS-NON-STICKY SS-SLIGHTY STICKY
FS-FOOT SLOPE N-NOSE SLOPE H-HEAD SLOPE	II	SL-SANDY LOAM L-LOAM	0.8 - 0.6	FI-FIRM VFI-VERY FIRM EFI-EXTREMELY FIRM	S-STICKY VS-VERY STICKY NP-NON-PLASTIC
CC-CONCLAVE SLOPE CV-CONVEX SLOPE T-TERRACE FP-FLOOD PLAN	III	SI-SILT SIL-SILT LOAM CL-CLAY LOAM SCL-SANDY CLAY LOAM	0.6 - 0.3		SP-SLIGHTLY STICKY P-PLASTIC VP-VERY PLASTIC

SIC-SILTY CLAY 0.4 - 0.1 ΙV C-CLAY

SC-SANDY CLAY


STRUCTURE SG-SINGLE GRAIN

MINERALOGY

SLIGHTLY EXPANSIVE

EXPANSIVE

M- MASSIVE CR-CRUMB GR-GRANULAR SBK-SUBANGULAR BLOCKY ABK-ANGULAR BLOCKY PL-PLATY PR-PRISMATIC

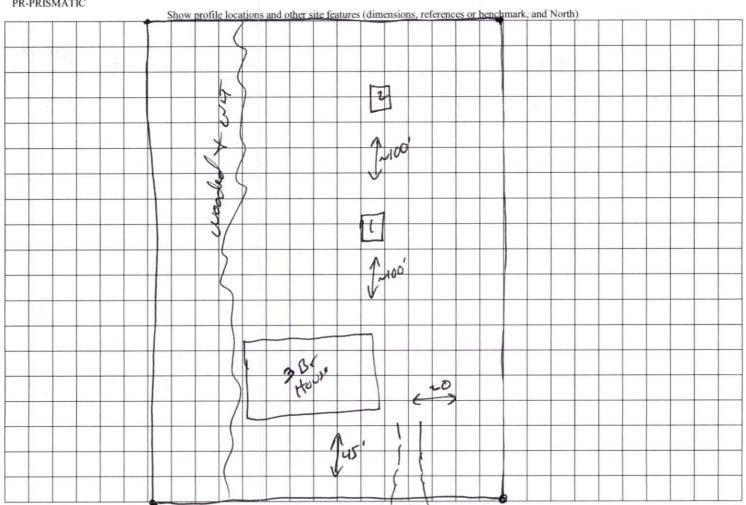

Hages Rd