Department of Environment, Health and Natural Resources
Division of Environmental Health
On-Site Wastewater Section

Sheet:
Property ID: SFD 2210-0046
Lot #:
File #:
Code:

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

Owner: Applicant: Steve Silver
Address: Date Evaluated: 11-6-22
Proposed Facility: SFD Design Flow (.1949): 240 Property Size:
Location of Site: Property Recorded:
Water Supply: ☑ Public ☐ Individual ☐ Well ☐ Spring ☐ Other
Evaluation Method: ☑ Auger Boring ☐ Pit ☐ Cut
Type of Wastewater: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 Landscape Position/ Slope %	Horizon Depth (In.)	SOIL MORPHOLOGY .1941		OTHER PROFILE FACTORS				Profile Class & LTAR
			.1941 Structure/ Texture	.1941 Consistence Mineralogy	.1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	
1.3	L-2-2	0-18	SL	FR GR NONP					PS
		18-40	SCLay	FM SBK S.P	30"-32" 7.5YR 2/1				.35-.4
2	L-2-2	0-12	SL	FR GR NSNP					
		12-36	SCLay	FM SBK S.P	28"-30" 7.5YR 2/1				.35
4	L-2-2	0-20	SL	FR GR NSNP					
		20-40	SCL	FM SBK S.P	34"-36" 7.5YR 2/1				.4

Description	Initial System	Repair System
Available Space (.1945)		
System Type(s)	2 SYS	2 SYS
Site LTAR	.35-.4	.35-.4

Other Factors (.1946):
Site Classification (.1948): PS
Evaluated By:
Others Present:

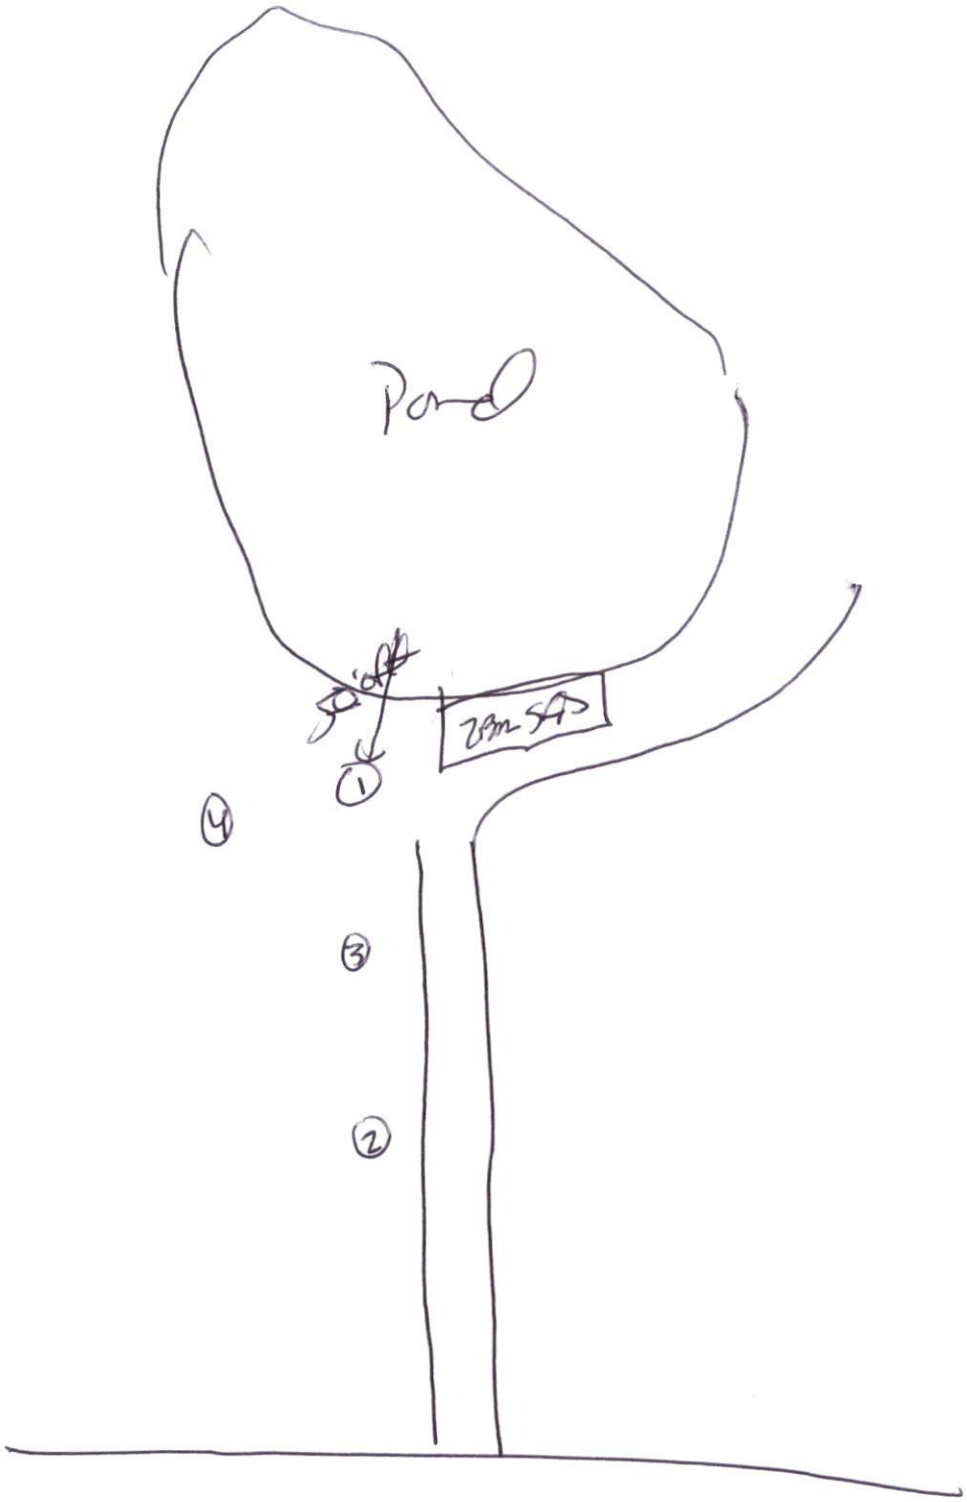

SR 1500 Bear RD