PROPERTY ID #:	Pa	ge _1_	of
PROPERTY ID #:	XV	2402	- 208/
COUNTY:	Hara	ett	

SOIL/SITE EVALUATION for ON-SITE WASTEWATER SYSTEM

OWNER: Jaren' Baker (Complete all fields in full) DATE EVALUATED: 4-27-24 ADDRESS: 10 52 Pa: Ley 10 Conf PROPOSED DESIGN FLOW (.0400): 48 PROPERTY SIZE:										
ADDR	ESS: 10 52	Bailey	38' VULL PR	OPOSED DESIGN E	T OW (0400):	480	PROP	ERTY SIZI		
LOCATION OF SITE: PROPERTY RECORDED:										
WATER SUPPLY: Public Single Family Well Shared Well Spring Other WATER SUPPLY SETBACK: EVALUATION METHOD: Auger Boring Pit Cut TYPE OF WASTEWATER; Domestic High Strength IPWW										
	JATION METH	OD: < Auge	er Boring Pit	Cut TYI	PE OF WASTE	WATER	Domest	c High	Strength	IPWW
P R O F			SOIL MO	RPHOLOGY	ОТНЕК	E FACTO	FACTORS			
L E #	.0502 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	.0503 STRUCTURE/ TEXTURE	.0503 CONSISTENCE/ MINERALOGY	.0504 SOIL WETNESS/ COLOR	.0505 SOIL DEPTH	.0506 SAPRO CLASS	.0507 RESTR HORIZ	.0509 PROFILE CLASS & LTAR*	.0503 SLOPE CORRE CTION
	2% 45	0-15	56, gr	Fr, NSND, SE	· · · · · ·					
		15-38	SLL, SEK	FI, SS, NP, SC	7/ = 384	46"			.35	
ļ		38-48	CL, YSAK	FILSE, NO, SE	6/					
1,2/3				7 7						
4,	21/15	0-15	56,91	Frasal PSE						
4/5		15-36	SU. 38K	FE,52,50,5E	7/2.5				2	
#		36-48	CL, HKSEK	FI,59,50,50	7-5/K 7/1=36"	48"			.3	
			/	11/1						
_										100
3										
,										
4										
D	ESCRIPTION	INITIAL SYS	FEM REPAIR S	YSTEM						

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM	
Available Space (.0508)			SITE CLASSIFICATION (.0509):
System Type(s)	25% Red	25% Red	EVALUATED BY:
Site LTAR	.3	.3	OTHER(S) PRESENT:
Maximum Trench Depth	18"-24"	18'1- 2411	
Comments:			

LEGEND

LANDSCAPE POSITION	SOIL GROUP	SOIL TEXTURE	CONVENTIONAL LTAR (gpd/ft²)			LPP LTAR (gpd/ft²)	MINERALOGY/ CONSISTENCE		STRUCTURE			
CC (Concave slope)		S (Sand)		0.6 - 0.8			MOIST	WET	SG (Single grain)			
CV (Convex Slope)	1	LS (Loamy sand)	0.8 - 1.2	0.	5 -0.7	0.4 -0.6	Lo (Loose)	NS (Non-sticky)	M (Massive)			
D (Drainage way)	п	SL (Sandy loam)	0.6 - 0.8	0.4	4 -0.6	0.3 - 0.4	VFR (Very friable)	SS (Slightly sticky)	GR (Granular)			
FP (Flood plain)		L (Loam)	0.0 0.0	0.2	2 - 0.4		FR (Friable)	S (Sticky)	SBK (Subangular blocky)			
FS (Foot slope)	111	SiL (Silt loam)		0.:	1 - 0.3	0.15 - 0.3	FI (Firm)	VS (Very sticky)	ABK (Angular blocky)			
H (Head slope)		SCL (Sandy clay loam)	0.3 - 0.6	0.05 - 0.15**	- 0.15**		VFI (Very firm)	NP (Non-plastic)	PR (Prismatic)			
L (Linear Slope)		CL (Clay loam)			None		EFI (Extremely firm)	SP (Slightly plastic)	PL (Platy)			
N (Nose slope)		SiCL (Silty clay loam)						P (Plastic)				
R (Ridge/summit)		Si (Silt)						VP (Very plastic)				
S (Shoulder slope)		SC (Sandy clay)								SEXP (Slightly	expansive)	
T (Terrace)	IV	IV SiC (Silty clay) 0.1 - 0.4		0.05 - 0.2	EXP (Expansive)							
TS (Toe Slope)		C (Clay)							-			
		O (Organic)	None									

HORIZON DEPTH DEPTH OF FILL

In inches below natural soil surface In inches from land surface

RESTRICTIVE HORIZON


Thickness and depth from land surface

SAPROLITE

S(suitable) or U(unsuitable); Evaluation of saprolite shall be by pits.

SOIL WETNESS

Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation

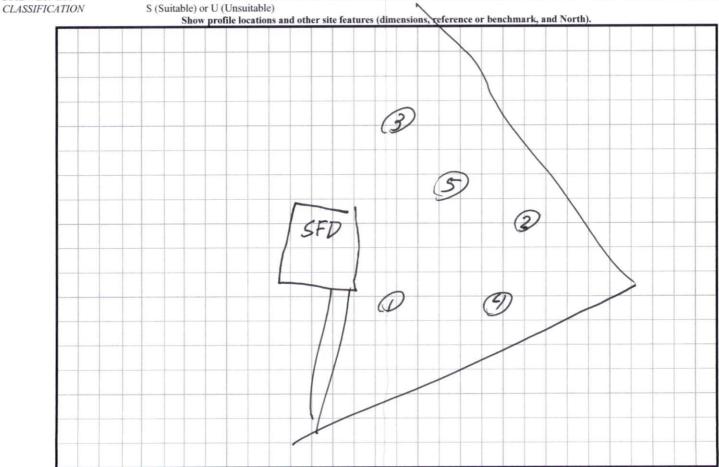

^{*} Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.

**Sandy clay loam saprolite can only be used with advanced pretreatment in accordance with 15A NCAC 18E .1200.